



**Users Manual** 

July 2011 Rev. 1, 8/12 © 2011-2012 Fluke Corporation. All rights reserved. Specifications are subject to change without notice. All product names are trademarks of their respective companies.

**Find Quality Products Online at:** 

www.GlobalTestSupply.com

#### LIMITED WARRANTY AND LIMITATION OF LIABILITY

This Fluke product will be free from defects in material and workmanship for three years from the date of purchase. This warranty does not cover fuses, disposable batteries, or damage from accident, neglect, misuse, alteration, contamination, or abnormal conditions of operation or handling. Resellers are not authorized to extend any other warranty on Fluke's behalf. To obtain service during the warranty period, contact your nearest Fluke authorized service center to obtain return authorization information, then send the product to that Service Center with a description of the problem. THIS WARRANTY IS YOUR ONLY REMEDY. NO OTHER WARRANTIES, SUCH AS FITNESS FOR A PARTICULAR PURPOSE, ARE EXPRESSED OR IMPLIED. FLUKE IS NOT LIABLE FOR ANY SPECIAL, INDIRECT, INCIDENTAL OR CONSEQUENTIAL DAMAGES OR LOSSES, ARISING FROM ANY CAUSE OR THEORY. Since some states or countries do not allow the exclusion or limitation of an implied warranty or of incidental or consequential damages, this limitation of liability may not apply to you.

Fluke Corporation P.O. Box 9090 Everett, WA 98206-9090 U.S.A. Fluke Europe B.V. P.O. Box 1186 5602 BD Eindhoven The Netherlands

11/99

**Find Quality Products Online at:** 

## **Table of Contents**

## Title

## Page

Introduction	1
How to Contact Fluke	1
Safety Information	2
Standard Equipment	6
Functions	9
Get Started	11
Operation Features	13
Input and Output Jacks	13
Buttons	15
Display	18
Strap and Stand	21
The Battery	22
Charge the Battery	22
Battery Charge Level	23
Battery Life	23
-	

## i

Find Quality Products Online at:

## 753/754

Users Manual

Preserve Battery Life	25
The Battery Charger	25
Display Languages	26
Display Intensity	26
Date and Time	26
The Backlight	28
Personalize the Product	28
Measure Mode	29
Measurement Ranges	29
Electrical Parameter Measurement	30
Continuity Test	32
Pressure Measurement	32
Temperature Measurement	36
Thermocouple Use	36
Resistance-Temperature Detectors (RTDs)	39
Measurement Scale	43
Linear-Output Transmitters	43
Square-Law Process Variables	43
Measure or Source with Custom Units	44
Using the 700-IV Current Shunt	44
Damping Measurements	45
Source Mode	45
Source Electrical Parameters	45
4 to 20 mA Transmitter Simulation	48
Supply Loop Power	50
Source Pressure	52
Thermocouple Simulation	55
RTD Simulation	56
Source Temperature with a Hart Scientific Drywell	59

#### ii

Find Quality Products Online at:

## Contents (continued)

Source Scale	61
Linear-Responding Transmitters	61
Square-Root Process Variables	61
Step and Ramp the Output Value	62
Manual Step Use	62
Auto Step Use	62
Ramp the Output	63
Simultaneous Measure/Source	66
Process Instrument Calibration	69
Generate "As Found" Test Data	69
Transmitter Adjustment	74
"As Left" Test Run	75
Test Comments	75
Calibrate a Delta-Pressure Flow Instrument	75
Switch Calibration	76
Transmitter Mode	79
Memory Operations	80
Save Results	80
Review the Memory	83
Log Data	83
Record Min and Max Measurements	86
Run a Preloaded Task	87
Clear the Memory	87
The Calculator	87
Save to and Recall from the Registers	88
Use the Calculator to Set the Source Value	88
Quick Guide to Applications	88
Communication with a PC	101
Maintenance	101

#### iii

Find Quality Products Online at:

## 753/754

Users Manual

Battery Replacement	101
Clean the Product	101
Calibration Data	101
In Case of Difficulty	102
	102
Service Center Calibration or Repair	102
User-Replaceable Parts	102
Accessories	104
Specifications	106
General Specifications	106
Environmental Specifications	106
Standards and Agency Approval Specifications	106
Detailed Specifications	107
DC mV Measurement	107
DC Voltage Measurement	108
AC Voltage Measurement	108
DC Current Measurement	109
Resistance Measurement	109
Continuity Testing	109
Frequency Measurement	110
±DC Voltage Output	110
+DC Current Source	111
+DC Current Simulate (External Loop Power)	111
Resistance Sourcing	111
Frequency Sourcing	112
Temperature, Thermocouples	113
Temperature, Resistance Temperature Detectors	116
Loop Power	117

#### iv

Find Quality Products Online at:

## List of Tables

#### Title Table Page 1. Symbols...... 4 Summary of Source and Measure Functions ...... 10 2. 3. 4. 5. 6. 7. 8. RTD Types Accepted ...... 39 9. 10. 11. 12.

#### v

Find Quality Products Online at:

www.GlobalTestSupply.com

**753/754** Users Manual

vi

Find Quality Products Online at:

www.GlobalTestSupply.com

## List of Figures

Figure	Title	Page
1.	Standard Equipment	7
2.	Jumper Connections	12
3.	Measure/Source Example	12
4.	Input/Output Jacks and Connectors	14
5.	Buttons	15
6.	Elements of a Typical Display	19
7.	Stand Use and Strap Attachment	21
8.	Battery Removal and Charger Use	24
9.	Time and Date Display	27
10.	Edit the Date Format	27
11.	Personalize the Product	28
12.	Electrical Measurement Connections	31
13.	Gage and Differential Pressure Modules	33
14.	Pressure Measurement Connections	35
15.	Temperature Measurement with a Thermocouple	38

#### vii

Find Quality Products Online at:

www.GlobalTestSupply.com

### **753/754** Users Manual

16.	Correct Jumper Use	41
17.	Temperature Measurement with an RTD	42
18.	Electrical Source Connections	47
19.	Connections fo Simulate a 4 to 20 mA Transmitter	49
20.	Connections to Supply Loop Power	51
21.	Connections to Source Pressure	54
22.	Connections to Simulate a Thermocouple	57
23.	Connections to Simulate an RTD	58
24.	Source Temperature with Drywell	60
25.	Ramp Screen	64
26.	Check a Relay Output Trip Alarm	65
27.	Measure and Source Screen	66
28.	Process Instrument Calibration Screen	70
29.	Process Instrument Calibration Screen 2	70
30.	Calibrate a Thermocouple Temperature Transmitter	71
31.	Calibration Parameters Screen	72
32.	Measure and Source Screen for Calibration	73
33.	Error Summary Screen	73
34.	As Left Data Screen	75
35.	Switch Terminology	76
36.	Saved Data Screen	81
37.	Additional Data Input Screen	81
38.	Alphanumeric Entry Window	82
39.	Memory Review Screen	83
40.	Data Log Parameters Screen	83
41.	Start Logging Screen	85
42.	Min Max Screen	86
43.	Chart Recorder Calibration	89
44.	Voltage Drop Measurement	89

#### viii

Find Quality Products Online at:

## Contents (continued)

45.	Monitor AC Line Voltage and Frequency	90
46.	Current-to-Pressure (I/P) Transmitter Calibration	91
47.	Output Current of a Transmitter Measurement	92
48.	Precision Resistor Measurement	93
49.	Resistance Source	93
50.	Checking a Switch	94
51.	Tachometer Examination	94
52.	Analog and HART Pressure Transmitter Connection	95
53.	mV to Current Transmitter Calibration	96
54.	Vortex Sheding Flowmeter Check	97
55.	HART and Analog RTD Transmitter Connections	98
56.	Analog and HART Thermocouple Transmitter Connections	99
57.	Transmitter HART- Comm Only	100

ix

Find Quality Products Online at:

www.GlobalTestSupply.com

**753/754** Users Manual

x

Find Quality Products Online at:

www.GlobalTestSupply.com

#### Introduction

The 753 and 754 Documenting Process Calibrators (the Product) are battery-powered, hand-held instruments that measure and source electrical and physical parameters. In addition, the 754 supplies basic HART<sup>®</sup> communicator functions when used with HART-capable transmitters. See the *754 HART Mode Users Guide* for instructions on how to use the HART communication feature.

The Product helps troubleshoot, calibrate, verify, and document work performed on process instruments.

Note

All figures in this manual show the 754.

## www.GlobalTestSupply.com

## sales@GlobalTestSupply.com

1

Users Manual

### Safety Information

A **Warning** identifies conditions and actions that pose hazards to the user; a **Caution** identifies conditions and actions that may damage the Product or the equipment under test.

### <u>∧∧</u> Warning

To prevent personal injury, use the Product only as specified, or the protection supplied by the Product can be compromised.

To prevent possible electrical shock, fire, or personal injury:

- Read all safety Information before you use the Product.
- Carefully read all instructions.
- Use only correct measurement category (CAT), voltage, and amperage rated probes, test leads, and adapters for the measurement.
- The battery must be locked in place before you operate the Product.
- Recharge the battery when the low battery indicator shows to prevent incorrect measurements.
- Do not apply more than the rated voltage, between the terminals or between each terminal and earth ground.

- Limit operation to the specified measurement category, voltage, or amperage ratings.
- Do not exceed the Measurement Category (CAT) rating of the lowest rated individual component of a Product, probe, or accessory.
- Measure a known voltage first to make sure that the Product operates correctly.
- Do not touch voltages > 30 V ac rms, 42 V ac peak, or 60 V dc.
- Do not use the Product around explosive gas, vapor, or in damp or wet environments.
- Do not use and disable the Product if it is damaged.
- Do not use the Product if it operates incorrectly.
- Keep fingers behind the finger guards on the probes.
- Remove all probes, test leads, and accessories that are not necessary for the measurement.
- Only use probes, test leads, and accessories that have the same measurement category, voltage, and amperage ratings as the Product.

2

#### Documenting Process Calibrators Safety Information

- Connect the common test lead before the live test lead and remove the live test lead before the common test lead.
- Use only current probes, test leads, and adapters supplied with the Product.
- Do not touch the probes to a voltage source when the test leads are connected to the current terminals.
- Use only cables with correct voltage ratings.

- Do not use test leads if they are damaged. Examine the test leads for damaged insulation, exposed metal, or if the wear indicator shows. Check test lead continuity.
- Examine the case before you use the Product. Look for cracks or missing plastic. Carefully look at the insulation around the terminals.
- Always put the stackable end of the test lead into a terminal of the Product.

## www.GlobalTestSupply.com

### sales@GlobalTestSupply.com

3

#### **753/754** Users Manual

Symbols used on the Product and in this manual are explained in Table 1.

Symbol	Meaning	Symbol	Meaning
Ŧ	Earth ground	Ą	Common (LO) Input equipotentiality
~	AC- alternating current	C S C S S S S S S S S S S S S S S S S S	Conforms to relevant North American Safety Standards.
	DC- direct current		Conforms to European Union directives.
	Risk of danger. Important information. See manual.		Pressure
	Hazardous voltage. Risk of electrical shock.	X	This product complies with the WEEE Directive (2002/96/EC) marking requirements. The affixed label indicates that you must not discard this electrical/electronic product in domestic household waste. Product Category: With reference to the equipment types in the WEEE Directive Annex I, this product is classed as category 9 "Monitoring and Control Instrumentation" product. Do not dispose of this product as unsorted municipal waste. Go to Fluke's website for recycling information.

Table	1.	Symbols
IUNIC		0,110010

4

www.GlobalTestSupply.com

## Documenting Process Calibrators Safety Information

Table 1. Symbols (cont.)			
Symbol	Meaning	Symbol	Meaning
4	Application around and removal from HAZARDOUS LIVE conductors is permitted.	<b>C</b> N10140	Conforms to relevant Australian standards.
	Double insulated	SUD	German certifying body.
CAT II	CAT II equipment is designed to protect against transients from energy-consuming equipment supplied fro the fixed installation, such as TVs, PCs, portable tools, and other household appliances.		

Find Quality Products Online at:

www.GlobalTestSupply.com

### Users Manual

### Standard Equipment

Items included with the Product are listed below and shown in Figure 1. If the Product is damaged or something is missing, contact the place of purchase immediately.

- Battery with integrated charger/power supply and international adapters
- Printed multilingual 753/754 Getting Started Manual
- 753/754 Manual CD containing multilingual Users Manuals
- Three sets of TP220-1 test probes
- Three sets of 75X industrial test leads with stackable ends
- Three pairs of 754 Alligator Clip Set (extended tooth)
- Two sets of AC280 Suregrip Hook Clips (red and black)

- Adjustable quick-release strap
- Jumper for three-wire RTD measurement connections
- USB Cable: 6 ft. type A to type mini-B
- HART communications cable (754)
- Calibration Manual (available from Fluke's website)
- Sample DPCTrack2 application software
- NIST-traceable Certificate of Calibration
- TC Input Cap

6

## Documenting Process Calibrator Standard Equipment



Figure 1. Standard Equipment

7

Find Quality Products Online at:





Figure 1. Standard Equipment (cont)

8

Find Quality Products Online at:

www.GlobalTestSupply.com

#### Documenting Process Calibrator Functions

#### **Functions**

A summary of functions supplied by the Product is shown in Table 2. More features include:

- Analog display for easy to read measurements when inputs are unstable.
- Localized display (5 languages). See "Display Languages".
- Thermocouple (TC) input/output jack and internal isothermal block with automatic reference-junction temperature compensation. Or manually record an external temperature reference.
- Test results storage.
- Data logging. Automatically log up to 8,000 data points.
- A USB computer interface to upload or download tasks, lists, and results.
- Automatic calibration procedures for transmitters and limit switches when you use split screen MEASURE/SOURCE mode.

- Transmitter mode in which the Product can be configured to emulate the functions of a process instrument.
- Calculator feature with square-root function, and accessible registers that contain measure and source values.
- Damp feature (smoothes the last several readings), with display indicator of damped status.
- Display of measurements in engineering units, percent of scale, square-law inputs, or custom units.
- Min/Max feature captures and shows minimum and maximum measured levels.
- Set source values to engineering units, percent of scale, square-law outputs, or custom units.
- Manual and automatic stepping and an output ramp feature for testing limit switches. Trip detect is either a 1 V change or a continuity status change (Open or Short) from one ramp increment to the next.

For performance testing and calibration instructions, download the *753/754 Calibration Manual* from Fluke's website.

#### 753/754

Users Manual

Function Measure Source			
VDC Volts dc	0 V to ±300 V	0 V to ±15 V (10 mA max)	
Vac Volts ac 0.27 V to 300 V rms, 40 Hz to 500 Hz No sourcing		No sourcing	
VAC HEITI Frequency	Frequency       1 Hz to 50 kHz         0.1 V to 30 V p-p sine wave, or 15 V p         square wave, 0.1 Hz to 50 kHz sine wave         0.01 Hz square wave		
Resistance	0 Ω to 10 kΩ	0 Ω to 10 kΩ	
dc Current	0 mA to 100 mA	0 to 22 mA sourcing or sinking	
Continuity Beep and the word Short indicates No sourcing		No sourcing	
	Types E, N, J, K, T, I	B, R, S, C, L,U, BP, or XK	
$\begin{array}{c c} \hline \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ $			
Pressure $[1]$ 29 modules ranging from 0 to 1 inch H2O (250 Pa) to 0 to 10.000 psi (69.000 kPa)			
SETUP LOOP Power	SETUP Loop Power 26 V		
[1] Use an external hand pump or other pressure source as a pressure stimulus for the source pressure function.			

#### Table 2. Summary of Source and Measure Functions

10

#### Documenting Process Calibrator Get Started

#### **Get Started**

#### <u>∧</u>∧ Warning

To prevent possible electrical shock, fire, or personal injury:

- Remove circuit power before you connect the Product in the circuit when you measure current. Connect the Product in series with the circuit.
- Do not touch exposed metal on banana plugs, they can have voltages that could cause death.
- Disconnect power and discharge all highvoltage capacitors before you measure resistance or continuity.

A brief getting started exercise follows:

1. After you unpack the Product, charge the battery for 8 hours (if the battery is outside of the Product, charge for 5 hours). For more information, see "The Battery". The Battery will only charge if the Product is off.

- 2. Connect voltage output to the voltage input. To do this connect the left pair of jacks (V  $\Omega$  RTD SOURCE) to the right pair of jacks (V MEASURE). See Figure 2.
- Push (1) to turn on the Product. If necessary, adjust the display brightness. See "Display Brightness". The Product powers up in the dc voltage measurement function, and is reading on the V MEASURE pair of input jacks.
- 4. Push still to show the SOURCE screen. The Product still measures dc voltage and the active measurement is at the top of the display.
- 5. Push vec to select dc voltage sourcing. Push 5 on the keypad and verter to begin sourcing 5.0000 V dc.
- Push INNEE to go to the split-screen, simultaneous MEASURE/SOURCE mode. The Product simultaneously sources dc volts and measures dc volts. The measurement readings are shown on the top display, and the active source value on the bottom display as shown in Figure 3.

**753/754** Users Manual





12

Find Quality Products Online at:

www.GlobalTestSupply.com

## **Operation Features**

## Input and Output Jacks

Figure 4 shows the input and output jacks and connectors. Table 3 explains their use.

No.	Name	Description
1	HART jack (754 only)	Connects the Product to HART devices.
2	Pressure module connector	Connects the Product to a pressure module.
3	TC input/output	Jack to measure or simulate thermocouples. This jack accepts a miniature polarized thermocouple plug with flat, in-line blades spaced 7.9 mm (0.312 in) center to center.
(4),(5)	<u> </u>	Input jacks to measure voltage, frequency, or three- or four-wire RTDs (Resistance Temperature Detectors).
6,7	$\underline{\Lambda}$ SOURCE mA, MEASURE mA $\Omega$ RTD jacks	Jacks to source or measure current, measure resistance and RTDs, and supply loop power.
(8,9)	$\underline{\mathbb{M}}$ SOURCE V $\Omega$ RTD jacks	Output jacks to source voltage, resistance, frequency, and to simulate RTDs.
10	Battery Charger jack	Jack for the battery charger/universal power supply (referred to as the battery charger throughout this manual). Use the battery charger for bench-top applications where ac line power is available.
(1)	USB port (Type 2)	Connects the Product to a USB port on a PC.

#### Table 3. Input/Output Jacks and Connectors

13

## www.GlobalTestSupply.com

**753/754** Users Manual



Figure 4. Input/Output Jacks and Connectors

14

Find Quality Products Online at:

### Documenting Process Calibrator Operation Features

#### **Buttons**

Figure 5 shows the Product buttons and Table 4 tells their functions. The softkeys are the four (F1-F4) blue buttons below the display. Softkey functions are defined by the labels that show above the softkey during operation. Softkey labels and other display text are shown in this manual in bold type, for example, **Choices**.



Figure 5. Buttons

15

Find Quality Products Online at:

www.GlobalTestSupply.com

### 753/754

Users Manual

Table 4. Buttons						
ltem	Button	Description				
1		Turns the Product on and off.				
2	mA	Selects mA (current) measure or source function. For loop power on/off, go to the Setup mode.				
3	VDC	Selects the dc voltage function in MEASURE mode, or selects dc voltage in SOURCE mode.				
(4)		Selects TC (thermocouple) or RTD (resistance temperature detector) measurement or sourcing functions.				
5	<b>A</b>	Selects the pressure measurement or source function.				
6	F1 F2 F3 F4	Softkeys. Does the function specified by the label above each softkey on the display.				
7	<b>\$</b>	Adjusts the backlight intensity (three levels).				
8	SETUP	Enters and exits Setup mode to change operating parameters.				
9	hart (754) range (753)	(754) Toggles between HART communication mode and analog operation. In calculator mode, this key supplies the square root function. (753) Adjusts the Range of the Product.				

16

Find Quality Products Online at:

# Documenting Process Calibrator Operation Features

ltem	Button	Description		
10	۵, ۳, ۹, ۵	<ul> <li>Push</li></ul>		
(11)	CLEAR (ZERO)	Clears a partial data entry, or prompts for output value when in the SOURCE mode. When you use a pressure module, zeros the pressure module indication.		
(12)	ENTER	Completes a numeric entry when a source value is set, or confirms a choice in a list. In calculator mode, acts as the equals arithmetic operator (=).		
(13)	Ω ₩)))	Toggles between resistance and continuity functions in MEASURE mode, or selects the resistance function in SOURCE mode.		
(14)	VAC Hz T	Toggles between ac voltage and frequency functions in MEASURE mode, or selects frequency output in SOURCE mode.		
(15)	Numeric keypad	Used when a numeric entry is necessary.		
(16)	MEASURE SOURCE	Cycles the Product through MEASURE, SOURCE, and MEASURE/SOURCE modes.		

17

Users Manual

#### Display

Figure 6 and Table 5 show a typical display. The display shown is MEASURE mode. Near the top of the display is **"Source Off**." This display area shows what is happening in the other mode (SOURCE or MEASURE). The other parts of the display are:

- Status Bar: Shows the time and date, and the status of Loop Power, Auto Battery Save, and Backlight Timeout; all of which are set in Setup mode. The selected HART channel (if HART is active-754 only) and low-battery and backlight-on symbols are also show here.
- Mode Indicator: Shows if the Product is in MEASURE or SOURCE mode. In split screen MEASURE/SOURCE mode, there is a Mode Indicator for each window.

- Measured Value: Shows the measured value in a selection of engineering units or percent of scale.
- **Range Status:** Shows if Auto Range is on, and what range is currently in operation.
- **Custom Units Indicator:** Shows that the displayed units are custom. The initial engineering units of the measure or source function are not shown.
- Secondary Value: Shows the measure or source value in initial engineering units when scaling or custom units are on.

18

#### Documenting Process Calibrator Operation Features



Figure 6. Elements of a Typical Display

19

Find Quality Products Online at:

www.GlobalTestSupply.com

## 753/754

Users Manual

Table 5. Elements of a Typical Display						
ltem	Description					
1	Time and Date Display					
2	HART Indicator					
3	Loop Power Indicator					
4	Battery Gauge					
5	Backlight Indicator					
6	Source Status					
7	Undamped (Unsettled) Indicator					
8	Custom Units Indicator					
9	Secondary Value					
(10)	Softkey Labels					
(11)	Measured Value					
(12)	Mode Indicator					
(13)	Status bar					

20

Find Quality Products Online at:

www.GlobalTestSupply.com

#### Documenting Process Calibrator Operation Features

#### Strap and Stand

After you unpack the Product, attach its carrying strap as shown in Figure 7. The straps can be adjusted as necessary to hang the Product on any sturdy support. Figure 7 also shows how to open the Stand to put the Product at an optimal sight angle for bench top use.



Figure 7. Stand Use and Strap Attachment

21

Find Quality Products Online at:

### The Battery

#### **∧**Caution

For safe operation and maintenance of the product:

- Do not keep cells or batteries in a container where the terminals can be shorted.
- Repair the Product before use if the battery leaks.
- Remove battery to prevent battery leakage and damage to the Product if it is not used for an extended period.
- Connect the battery charger to the mains power outlet before the Product.
- Use only Fluke approved power adapters to charge the battery.
- Keep cells and battery packs clean and dry. Clean dirty connectors with a dry, clean cloth.
- Do not short the battery terminals together.

#### A Warning

To prevent personal injury:

- Do not put battery cells and battery packs near heat or fire. Do not put in sunlight.
- Do not disassemble or crush battery cells and battery packs.
- Do not disassemble the battery.
- Batteries contain hazardous chemicals that can cause burns or explode. If exposure to chemicals occurs, clean with water and get medical aid.

#### Charge the Battery

Before you use the Product for the first time, charge its battery.

To charge the battery while it is inside the Product:

- 1. Turn the Product OFF.
- 2. Connect the battery charger to the Product and keep it OFF. The battery will not charge if the Product is on.

The battery fully charges in 8 hours while inside the Product. See Figure 8.

To charge the battery while it is outside of the Product:

- 1. Turn the Product face down.
- 2. Use a flat-head screwdriver and move the battery lock from **Q** (locked) to **Q** (unlocked).

## **Documenting Process Calibrator**

The Battery

3. Remove the battery.

4. Connect the battery charger to the input. Outside of the Product, the battery will charge in 5 hours.

Note

An optional 12-Volt car charger is available. See "Accessories".

#### **Battery Charge Level**

Use these two methods to make sure the Battery is charged:

- See the Battery Gauge Bar Graph on the display.
- See the Battery Charge Indicator on the battery.

The Battery Charge Indicator can be seen while the battery is outside of the Product. With the battery removed and not connected to its charger, push the button below the Battery Charge Indicator. Solid Green LEDs show the level of charge on the battery. The Battery is fully charged when all LEDs are illuminated.

Connect the battery charger to the battery and push the button below the Battery Charge Indicator. LEDs flash to show the charge level but also show that the battery is being recharged. As the battery charges, the LED flashes and moves to the top of the charge indicator.

#### **Battery Life**

The battery gauge bar graph [------ is shown on the upper right of the display.

Table 6 shows the typical operation time for a new, fullycharged battery. Product performance is guaranteed to its specification until the battery gage reads empty ( -1).

To replace the battery, see "Battery Replacement".

Table 6. Typical Battery Life

Operation Modes	Backlight Low	Backlight High
Measure, continuous	13 Hours	12 Hours
Measure and source, with loop power on, continuous	7 Hours	6 Hours
Typical intermittent operation	>16 Hours	>16 Hours





Figure 8. Battery Removal and Charger Use

24

Find Quality Products Online at:
#### Documenting Process Calibrator The Battery

#### Preserve Battery Life

An optional Auto Battery Save feature turns the Product off after a selected set idle time. The default setting for Auto Battery Save is **Off**. The setting is kept after the Product power is off. Auto Battery Save operates the same when the battery charger is used.

To turn on the Auto Battery Save feature:

- 1. Push SETUP.
- Push 
   The to highlight Off that follows Auto Battery Save.
- 3. Push enter or the **Choices** softkey.
- 4. Push to  $\bigcirc$  highlight **On**, then push  $\square$ .
- 5. To use the timeout period shown on the display, stop here. Push the **Done** softkey to exit Setup mode and do not go on to step 6.
- If you wish to change the timeout period, push 
   ▼ to select the timeout period following Battery Save Timeout.
- 7. Push enter or the **Choices** softkey.
- 8. Record choice of timeout period in minutes (accepted range: 1 to 120 minutes).
- 9. Push the Done softkey.

10. Push the **Done** softkey or **SETUP** to exit Setup mode.

#### **The Battery Charger**

#### **≜**Caution

#### To avoid damage to the Product, use only the Battery that comes with the Product, Fluke model BP7240, part number 4022220.

Where ac power is available, the battery charger can be used to conserve battery power and energize the Product. When the battery is in the Product, the battery charges only when the Product is off. When you calibrate an instrument, best results come from battery power use.

An optional 12-V car adapter is available that can be used to charge the battery outside of the Product. See "Accessories".

Users Manual

# **Display Languages**

The Product shows information in five languages:

- English
- European French
- Italian
- German
- Spanish

To change the display language:

- 1. Push SETUP.
- 2. Push F3 twice.
- 3. Push 👁 three times.
- 4. Push ENTER.
- 5. Push a or e to highlight the language choice.
- 6. Push **EVITER** to confirm the language choice. This language is the power-up default.
- 7. Push SETUP to exit Setup mode.

# **Display Intensity**

There are two ways to increase display intensity:

- Push 😵. There are three levels of intensity when using this button.
- Push 

   or increase display intensity. Push 
   or increase display intensity. Push 
   or intensity. There are six levels of intensity when these buttons are used.

In calculator mode, all four direction keys are used for arithmetic functions.

# **Date and Time**

The date and time can be shown at the top of the display during normal operation. The date and time can be turned on or off in Setup mode. Date and time formats can also be controlled. If you choose to not use the date and time display, the calendar and clock must be set since a timestamp is applied to all kept results.

26

### Documenting Process Calibrator Date and Time

To set the time and date displays:

- 1. Push SETUP.
- 2. Push the Next Page softkey. See Figure 9.

			( <b>IIII</b> ※				
SETUP							
	Date Disp	lay Off					
	D.	ate 05/11/11	1				
	Date Forr	9					
	Time Display Off						
	Time 08:00:01 am						
	Time Format 12:00:00 am						
Numeric Format 0.000							
Choices	Prev.	Next	Done				
	Page	Page	Dulle				
			gks38s.t				

Figure 9. Time and Date Display

3. Push and to move the cursor to the necessary parameter, then push ENTER or the **Choices** softkey to choose a setting for that parameter.

For example, the display in Figure 10 is shown after you select **Date Format**.



- Push (a) or (a) to move the cursor to the necessary da
- Push 
   or to move the cursor to the necessary date format.
- 5. Push ENTER to select the format and go back to Setup mode.
- 6. Choose a different selection or push the **Done** softkey or **SETUP** to save the settings and exit Setup mode.

27

# The Backlight

Push 🕲 to change the backlight intensity from dim to bright and back again. 🔅 shows at the top of the display when the backlight is active. Set the Product to turn the backlight off automatically to keep battery use to minimum. When the backlight is on and Auto Backlight Off is in operation, 🔯 is shown at the top of the display.

To automatically dim the backlight after a set time:

- 1. Push SETUP.
- 2. Push To move the cursor to the same line as Auto Backlight Off.
- 3. Push enter or the **Choices** softkey.
- 4. Push ( to highlight **On**, then push [ INTER ].
- 5. To use the timeout period shown on the display, stop here. Push the **Done** softkey to exit Setup mode and do not go on to step 6.
- 7. Push enter or the **Choices** softkey.
- 8. Record the choice of timeout period in minutes (accepted range: 1 to 120 minutes).
- 9. Push the **Done** softkey.
- 10. Push the **Done** softkey or **SETUP** to exit Setup mode.

28

When the backlight dims, the Product also beeps.

# Personalize the Product

Alphanumeric identifiers can be put into the Product to be shown at power-up and in results that you keep. To install an identifier:

- 1. Push SETUP
- 2. Push Next Page twice.
- 3. Push To move the cursor to the same line as ID.
- 4. Push ever or the **Choices** softkey. The screen in Figure 11 is shown.



Figure 11. Personalize the Product

- 5. The ID string is shown at the bottom of the boxed area. To erase a character, push the Back Space softkey. To erase the complete string, push (CLEAR). Information recorded in the ID string is recorded with all measurements stored in memory.
- 7. Do step 6 until satisfied with the ID string.
- 8. Push the Done softkey.
- 9. Push the **Done** softkey or **SETUP** to exit Setup mode.

# Measure Mode

Note

To get the best noise rejection and highest accuracy performance when you measure, use the battery; do not use the battery charger.

The operation mode (for example, MEASURE, SOURCE) is shown in the top left of the display. If the Product is not in MEASURE mode, push I to MEASURE is shown. The Product must be in MEASURE mode to change the MEASURE parameters.

#### Measurement Ranges

The Product usually changes to the correct measurement range automatically. The lower left side of the display shows "Range" or "Auto" if on the range status. Auto Range switch points are shown in Specifications. When the **Range** softkey is pushed, the range is locked. Push it again to go to and lock on the next higher range. Auto Range is in operation when a different measurement function is selected.

If the range is locked, overrange inputs show on the display as -----. In Auto Range, out of range is shown as !!!!!!.

Users Manual

#### **Electrical Parameter Measurement**

When the Product is turned on, it is in the dc voltage measurement function. Figure 12 shows electrical measurement connections. To select an electrical measurement function from SOURCE or MEASURE/SOURCE mode, first push [fifth] for MEASURE mode:

1. Push a for current, voc for dc voltage, voc for ac voltage or twice for frequency, or for resistance.

Note

When you measure frequency, the Product tells you to select a frequency range. If the measured frequency is expected to be below 20 Hz, push to select the lower frequency range, and then push ENTER.

2. Connect the test leads for your measurement function as shown in Figure 12.

30



Figure 12. Electrical Measurement Connections

Find Quality Products Online at:

Users Manual

### **Continuity Test**

When you do a continuity test, the beeper sounds and **Short** is shown on the display when the resistance between the  $\Omega$  MEASURE jack and its common jack is less than 25  $\Omega$ . **Open** is shown when the resistance is larger than 400  $\Omega$ .

To do a continuity test:

- 1. De-energize the circuit under test.
- 2. If necessary, push so for MEASURE mode.
- 3. Push is shown.
- 4. Connect the Product to the circuit under test. See Figure 12.

#### **Pressure Measurement**

Many ranges and types of pressure modules are available from Fluke. See "Accessories". Before you use a pressure module, read its instruction sheet. The modules are different in how they are used, zeroed, what types of process pressure media are allowed, and accuracy specifications.

Figure 13 shows gage and differential modules. Differential modules also operate in gage mode when you leave the low fitting open to atmosphere.

To measure pressure, attach the applicable pressure module for the process pressure you will test as described in the module's Instruction Sheet.

To measure pressure:

#### A Warning

To prevent personal injury, shut off the valve and slowly bleed off the pressure before attaching the pressure module to the pressure line to avoid a violent release of pressure in a pressurized system.

32





Figure 13. Gage and Differential Pressure Modules

#### ▲Caution

To prevent possible damage to the Product or to equipment under test:

- Never apply more than 10 ft.-lb. of torque between the pressure module fittings, or between the fittings and the body of the module.
- Always apply correct torque between the pressure module fitting and connecting fittings or adapters.
- Never apply pressure above the rated
  maximum printed on the pressure module.
- Use the pressure module only with specified materials. See the printing on the pressure module or the pressure module instruction sheet for the acceptable material compatibility.

Connect a pressure module to the Product as shown in Figure 14. The threads on the pressure modules accept standard ¼ NPT pipe fittings. Use the supplied ¼ NPT to ¼ ISO adapter if necessary.

- 1. Push [Source] for MEASURE mode.
- Push a. The Product automatically senses which pressure module is attached and sets its range accordingly.
- 3. Zero the pressure. See the module's Instruction Sheet. Modules can have different zeroing procedures that depend on module type.

Note

Zeroing MUST be done before doing a task that sources or measures pressure.

- 4. If necessary, the pressure display units can be changed to psi, mHg, inHg, inH2O, ftH2O, mH2O, bar, Pa, g/cm2, or inH2O@60°F. Metric units (kPa, mmHg, etc.) are shown in Setup mode in their base units (Pa, mHg, etc.). To change pressure display units:
  - 1. Push SETUP.
  - 2. Push Next Page twice.
  - 3. Push **EVITER** or the **Choices** softkey with the cursor on **Pressure Units**.
  - 4. Set the pressure units with  $\bigcirc$  or  $\bigcirc$ .
  - 5. Push ENTER.
  - 6. Push the Done softkey.

34



Figure 14. Pressure Measurement Connections

. . . . .

Find Quality Products Online at:

### **Temperature Measurement**

#### Thermocouple Use

The Product supports thirteen standard thermocouples, each identified with an alpha character: E, N, J, K, T, B, R, S, C, L, U, XK, or BP. Table 7 summarizes the ranges and qualities of the supported thermocouples.

To measure temperature using a thermocouple:

1. Attach the thermocouple leads to the correct TC miniplug, then to the TC input/output. See Figure 15.

#### ▲Caution

To prevent possible damage to the Product, do not try to force a miniplug in the wrong polarization. One pin is wider than the other.

Note

If the Product and the thermocouple plug are at different temperatures, stop for one minute or more for the connector temperature to stabilize after you plug the miniplug into the TC input/output.

- 2. If necessary, push some for MEASURE mode.
- 3. Push TC .
- 4. Select TC.
- 5. The display tells you to select the thermocouple type.
- 36

- If necessary, change between °C, °F, °R, and °K Temperature Units as follows:
  - 1. Push SETUP.
  - 2. Push the Next Page softkey twice.

  - 4. Push ever or the **Choices** softkey to choose a setting for that parameter.

  - 6. Push ENTER to go back to the SETUP display.
  - 7. Push the **Done** softkey or **SETUP** to exit Setup mode.
- 8. If necessary, change between **ITS-90** or **IPTS-68 Temperature Scale** in Setup mode. The procedure is the same as steps 1-7 above.

Table 7. Thermocouple Types Accepted								
Туре	Positive Lead	Positive Lead (H) Color		Negative Lead	Specified Range			
	Material	ANSI <sup>[1]</sup>	<b>IEC</b> <sup>[2]</sup>	Material	(°C)			
E	Chromel	Purple	Violet	Constantan	-250 to 1000			
N	Ni-Cr-Si	Orange	Pink	Ni-Si-Mg	-200 to 1300			
J	Iron	White	Black	Constantan	-210 to 1200			
К	Chromel	Yellow	Green	Alumel	-270 to 1372			
Т	Copper	Blue	Brown	Constantan	-250 to 400			
В	Platinum (30 % Rhodium)	Gray		Platinum (6 % Rhodium)	600 to 1820			
R	Platinum (13 % Rhodium)	Black	Orange	Platinum	-20 to 1767			
S	Platinum (10 % Rhodium)	Black	Orange	Platinum	-20 to 1767			
C <sup>[3]</sup>	Tungsten (5 % Rhenium)	White		Tungsten (26 % Rhenium)	0 to 2316			
L (DIN J)	Iron			Constantan	-200 to 900			
U (DIN T)	Copper			Constantan	-200 to 600			
		GOST						
BP	95 % W + 5 % Re	Red or Pink		80 % W + 20 % Re	0 to 2500			
XK	90.5 % Ni = 9.5 % Cr	Violet or Black		56 % CU + 44 % Ni	-200 to 800			
<ol> <li>American National Standards Institute (ANSI) device negative lead (L) is always red.</li> <li>International Electrotechnical Commission (IEC) device negative lead (L) is always white.</li> <li>Not an ANSI designation but a Hoskins Engineering Company designation.</li> </ol>								

#### . . . . . **\*** . . . . **\*** . **\*** . .

37

Find Quality Products Online at:

# www.GlobalTestSupply.com

# sales@GlobalTestSupply.com





Figure 15. Temperature Measurement with a Thermocouple

38

Find Quality Products Online at:

#### Resistance-Temperature Detectors (RTDs)

The Product accepts RTD types shown in Table 8. RTDs are characterized by their resistance at 0 °C (32 °F), which is called the "ice point" or  $R_0$ . The most common  $R_0$  is 100  $\Omega$ . A large number of RTDs come in a three-terminal configuration. The Product accepts RTD measurement inputs in two-, three-, or four-wire connections. See Figure 17. A four-wire configuration gives the highest measurement precision, and two-wire gives the lowest measurement precision.

Table 0. KTD Types Accepted								
RTD Type	lce Point (R₀)	Material	α	Range (°C)				
Pt100 (3926)	100 Ω	Platinum	0.003926 Ω/Ω/°C	-200 to 630				
Pt100 (385) <sup>[1]</sup>	100 Ω	Platinum	0.00385 Ω/Ω/°C	-200 to 800				
Ni120 (672)	120 Ω	Nickel	0.00672 Ω/Ω/°C	-80 to 260				
Pt200 (385)	200 Ω	Platinum	0.00385 Ω/Ω/°C	-200 to 630				
Pt500 (385)	500 Ω	Platinum	0.00385 Ω/Ω/°C	-200 to 630				
Pt1000 (385)	1000 Ω	Platinum	0.00385 Ω/Ω/°C	-200 to 630				
Cu10 (427)	$9.035 \ \Omega^{[2]}$	Copper	0.00427 Ω/Ω/°C	-100 to 260				
Pt100 (3916)	100 Ω	Platinum	0.003916 Ω/Ω/°C	-200 to 630				
[1] Per IEC 751-Standard								
[2] 10 Ω @ 25 °C								

### Table 8. RTD Types Accepted

39

# www.GlobalTestSupply.com

# sales@GlobalTestSupply.com

To measure temperature where an RTD input is used:

- 1. If necessary, push so for MEASURE mode.
- 2. Push 🔚.
- 3. Push  $\bigcirc$  and  $\square$  then **Select RTD Type** is shown.
- 4. Push ext{ or extbf o
- 5. Push ENTER.
- 7. Attach the RTD to input jacks as the display or Figure 14 shows. Use the supplied jumper between the mA  $\Omega$  RTD MEASURE low jack and the V MEASURE low jack as shown if using a 3-wire connection.
- 8. Push ENTER.

#### ▲Caution

To prevent possible damage to the Product, do not force a dual banana plug between any two jacks in the horizontal orientation. Doing so will damage the jacks. Use the supplied jumper wire when needed for RTD measurements. A dual banana plug may be used in the vertical orientation. See Figure 16.

40



Figure 16. Correct Jumper Use

- 8. If necessary, change between °C, °F, K, and °R temperature units in Setup:
  - 1. Push SETUP.
  - 2. Push the Next Page softkey twice.

  - 4. Push ever or the **Choices** softkey to choose a setting for that parameter.

  - 6. Push **ENTER** to go back to the **SETUP** display.
  - 7. Push the **Done** softkey or **SETUP** to exit Setup mode.
- If necessary, change between ITS-90 or IPTS-68 Temperature Scale in Setup mode. The procedure is the same as steps 1-7 above.





Figure 17. Temperature Measurement with an RTD

42

Find Quality Products Online at:

www.GlobalTestSupply.com

# sales@GlobalTestSupply.com

#### **Measurement Scale**

This feature scales measurements in accordance with a applicable process instrument's response. Percent of scale works for linear-output transmitters or square-law transmitters such as differential pressure transmitters that report flow rate.

#### Linear-Output Transmitters

- 1. If necessary, push [Source] for MEASURE mode.
- 3. Push the Scale softkey.
- 4. Select % from the list.
- 5. Use the numeric keypad to record the 0% of scale value (**0% Value**).
- 6. Push ENTER.
- Use the numeric keypad to record the 100% of scale value (100% Value).
- 8. Push ENTER.
- 9. Push the **Done** softkey.

Percent of scale stays in effect until you change to a different measurement function or until you push the **Scale** softkey and select a different scale mode.

#### Square-Law Process Variables

When you select  $\sqrt{}$  within scaling, the Product takes the square root of its input and shows the measurement in percent. For example, when the Product is connected to the output of a delta-pressure transmitter, the Product indication is in proportion to flow rate.

- 1. If necessary, push source for MEASURE mode.
- Select a measurement function (
   , voc, 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   , 
   <li
- 3. Push the **Scale** softkey.
- 4. Select  $\sqrt{1000}$  from the list.
- 5. Use the numeric keypad to record the 0% of scale value (**0% Value**).
- 6. Push ENTER.
- 7. Use the numeric keypad to record the 100% of scale value (100% Value).
- 8. Push the **Done** softkey.

Square root percent of scale stays in effect until you change to a different measurement function or the **Scale** softkey is pushed and you select a different scale mode.

### Measure or Source with Custom Units

#### <u>∧</u>∧ Warning

To avoid possible electric shock, when using Custom Units for measurement, always see the secondary value displayed below and to the right of the main display for the actual value of the measurement in native engineering units.

The measurement or source display can be setup to show custom units. To do this, select a function, for example mV dc, scale it as necessary, then record an alphanumeric name for the custom units, for example, "PH."

To set up a custom unit:

- When you measure or source the necessary function, push the Scale softkey, and then select Custom Units from the list.
- Record the 0% and 100% scale points for the input of the transfer function.
- 3. Push the Custom Units softkey.
- 4. Record the 0% and 100% scale points for the output of the transfer function.
- Record the name of the custom units (up to four characters), for example PH (for pH), using the alphanumeric entry window, then push [ENTER].

While **Custom Units** are active,  $\triangle$  shows on the display to the right of the custom unit. Once the custom measurement unit has been programmed, the unit is available for calibration procedures in split-screen MEASURE/SOURCE mode. To cancel **Custom Units**, push the **Custom Units** softkey again.

#### Using the 700-IV Current Shunt

To source and measure current simultaneously, a current shunt is necessary and uses the volts measure function. The Fluke 700-IV Current Shunt is designed specifically for use with the 700 Series Documenting Process Products.

To measure current with the current shunt:

- 1. Connect the current shunt to the MEASURE V jacks.
- 2. Connect the current signal to be measured to the current shunt.
- 3. Push vec to select the dc voltage measure function.
- 4. Push the Scale softkey.
- 5. Select Current Shunt from the list.
- 6. Push ENTER.
- 7. The Product is automatically configured and uses the correct custom scaling factor for the current shunt.

44

#### **Damping Measurements**

The Product normally applies a software filter to dampen measurements in all functions except continuity. The specifications assume that damping is turned on. The damping method is a running average of the last eight measurements. Fluke recommends leaving damping on. Turning damping off may be useful when measurement response is more important than accuracy or noise reduction. To turn damping off, push the **More Choices** softkey twice, then push the **Dampen** softkey so that **Off** is shown. Push **Dampen** again to turn damping back on. The default state is **On**.

#### Note

### Source Mode

The operating mode (for example, MEASURE, SOURCE) is shown on the display. If the Product is not in SOURCE mode, push []] until SOURCE is shown. The Product must be in SOURCE mode to change any of the SOURCE parameters.

#### **Source Electrical Parameters**

To select an electrical source function:

- 1. Connect the test leads as shown in Figure 18, depending on the source function.
- 2. Push a for current, vc for dc voltage, k for frequency, or a for resistance.
- 3. Record the necessary output value, then push ENTER. For example, to source 5.5 V dc, push vcc (5) (0) (ENTER.

# **753/754** Users Manual

#### Note

If sourcing frequency, respond when the Product asks you to select a zero-symmetric sine or positive square wave. The amplitude specified is p-p amplitude.

4. To change the output value, record a new value and push [ENTER].

#### Note

If sourcing current, wait for the *whit* symbol to disappear before you use the output.

- 5. To set the output value in the present source function, push CLEAR then enter the desired value and push ENTER.
- 6. To turn off sourcing completely, push CLEAR twice.

Note

Use the source current function to drive a current loop. This is different than the loop power function in which the Product is powering a process instrument. To source loop power, use the **Loop Power** function accessible from Setup mode.

46



Figure 18. Electrical Source Connections

Find Quality Products Online at:

Users Manual

#### 4 to 20 mA Transmitter Simulation

The Product can be configured as a load on a current loop through the SOURCE mA function. In SOURCE mode, when may is pressed, the display prompts to select **Source mA** or **Simulate Transmitter**. When you **Source mA** the Product is sourcing current, and when you **Simulate Transmitter** the Product is sourcing a variable resistance to keep the current to the specified value. Connect an external loop supply to the positive (top) mA jack as shown in Figure 19.

#### Note

Also see "Transmitter Mode" in which the Product can be temporarily configured to replace a two-wire process transmitter.

48



Figure 19. Connections to Simulate a 4 to 20 mA Transmitter

49

Find Quality Products Online at:

### Supply Loop Power

The Product supplies loop power at 26 V dc through an internal series resistance of 250  $\Omega$ . The setting supplies sufficient current for two or three 4-20 mA devices on the loop.

When you use loop power, the mA jacks are dedicated to measuring the current loop. This means that the SOURCE mA, measure RTD, and measure  $\Omega$  functions are not available (see Table 10.)

Connect the Product in series with the instrument current loop as Figure 20 shows. To supply loop power:

1. Push **SETUP** for Setup mode.

Note

Loop Power, Disabled is highlighted.

- 2. Push  $\odot$  and  $\odot$  to select **Disabled** or **Enabled**.
- 3. Push ENTER.
- 4. Push the **Done** softkey. "**LOOP**" is shown on the display when Loop Power is in operation.

50



Figure 20. Connections to Supply Loop Power

ioc.eps

Find Quality Products Online at:

#### **Source Pressure**

The Product has a source pressure display function where an external pressure hand pump is necessary. Use this function to calibrate instruments where a pressure source or differential pressure measurement is necessary. See Figures 21 and 36 for information about that application.

Many ranges and types of pressure modules are available from Fluke, see "Accessories". Before you use a pressure module, read its instruction sheet. The modules are different in how they are used, zeroed, what types of process pressure media are allowed, and accuracy specifications.

To use the source pressure display, see Figure 21:

#### ▲Warning

To avoid a violent release of pressure in a pressurized system, shut off the valve and slowly bleed off the pressure before attaching the pressure module to the pressure line.

#### **≜**Caution

To avoid mechanically damaging the pressure module:

- Never apply more than 10 ft.-lb. of torque between the pressure module fittings or between the fittings and the body of the module.
- Always apply correct torque between the pressure module fitting and connecting fittings or adapters.
- To avoid damaging the pressure module from overpressure, never apply pressure above the rated maximum printed on the pressure module.
- To avoid damaging the pressure module from corrosion, use it only with specified materials. See the printing on the pressure module or the pressure module instruction sheet for the acceptable material compatibility.

52

- Connect a pressure module and pressure source to the Product as Figure 21 shows. The threads on the pressure modules accept ¼ NPT fittings. Use the supplied ¼ NPT to ¼ ISO adapter if necessary.
- 2. If necessary, push source mode.
- 3. Push (a). The Product automatically senses which pressure module is attached and sets its range accordingly.
- Zero the pressure module as described in the module's instruction sheet. The module types are different in how they are zeroed. The pressure module MUST be zeroed before doing a task that sources or measures pressure.
- 5. Pressurize the pressure line with the pressure source to the necessary level as shown on the display.
- If necessary, change the pressure display units to psi, mHg, inHg, inH<sub>2</sub>O, ftH<sub>2</sub>O, mH<sub>2</sub>O, bar, Pa, g/cm<sup>2</sup>, or inH<sub>2</sub>O@60°F. Metric units (kPa, mmHg, etc.) are shown in Setup mode in their base units (Pa, mHg, etc.).

To change the pressure display units:

- 1. Push SETUP.
- 2. Push Next Page twice.
- 3. Push with the cursor on **Pressure Units**.
- 4. Select the pressure units with  $\bigcirc$  or  $\bigcirc$ .
- 5. Push ENTER.
- 6. Push the Done softkey.

53





Figure 21. Connections to Source Pressure

54

Find Quality Products Online at:

#### **Thermocouple Simulation**

#### Note

See "Temperature Measurement" for a table of thermocouple types that are supported by the Product.

Connect the Product TC input/output to the instrument under test with thermocouple wire and the correct thermocouple mini-connector (polarized thermocouple plug with flat, in-line blades spaced 7.9 mm (0.312 in) center to center).

#### ▲ Caution

To prevent possible damage to the Product, do not try to force a miniplug in the wrong polarization. One pin is wider than the other.

Figure 19 shows this connection. To simulate a thermocouple:

- Attach the thermocouple leads to the correct TC miniplug, and then to the TC input/output. See Figure 15.
- 2. If necessary, push source mode.

- Push TC, and then push TC sensor type. The display asks you to select the thermocouple type.

- 6. Record the temperature to simulate as prompted by the display and push [ENTER].

#### Note

If you use copper wire instead of thermocouple wire, the reference junction is no longer inside the Product. The reference junction moves to the instrument (transmitter, indicator, controller, etc.) input terminals. The external reference temperature must be measured accurately and recorded into the Product. To do this, push SETUP and set **Ref. Junc. Compensat.** and **Ref. Junc. Temp.**. After you record the external reference temperature, the Product corrects all voltages to adjust for this new reference junction temperature.

# **RTD Simulation**

#### Note

See Table 8 for data about RTD (Resistance-Temperature Detector) types compatible with the Product.

Connect the Product to the instrument under test as shown in Figure 23. The figure shows connections for two, three, or four-wire transmitters. For three or four-wire transmitters, use the 4-inch long stackable jumper cables to connect the third and fourth wires at the source V  $\Omega$  RTD jacks.

To simulate an RTD (Resistance-Temperature Detector):

- 1. If necessary, push for SOURCE mode.
- 2. Push  $\frac{\text{TC}}{\text{RTD}}$ .
- 3. Push  $\bigcirc$  or  $\bigcirc$  to select RTD.
- 4. Push [ENTER]. The Select RTD Type display is shown.
- Push or followed by ENTER to select the necessary RTD type.
- 6. The product tells you to use the keypad to enter the temperature to simulate. Input the temperature, and then push [ENTER].

56



Figure 22. Connections to Simulate a Thermocouple

Find Quality Products Online at:





Figure 23. Connections to Simulate an RTD

58

Find Quality Products Online at:

#### Source Temperature with a Hart Scientific Drywell

The Product can source temperature using a Hart Scientific Drywell. Many models are supported.

The drywell driver is able to talk to other drywells from Hart Scientific, provided that they respond to Hart Scientific's standard serial interface commands.

Connect the Product to the drywell by plugging the drywell interface cable into the pressure module connector as shown in Figure 24. If the drywell has a DB9 connector, plug the drywell interface cable directly into the drywell using the DB9 Null Modem adapter. Drywells with the 3.5 mm jack connector need to use the serial cable supplied with the drywell in addition to the Product drywell interface cable. Join the DB9 connectors of the two cables, and connect the 3.5 mm jack to the drywell.

Be sure the drywell is configured for serial communication at 2400, 4800, or 9600 bits per second. Other rates are not supported by the Product.

To source a temperature with a drywell:

- 1. If necessary, push start for SOURCE mode.
- 2. Push  $\frac{\text{TC}}{\text{RD}}$  to display the temperature mode menu.
- 3. Select **Drywell** from the list of options, and press **ENTER**.
- 4. The Product will begin to search for a drywell. If the Product shows **Attempting connection** for more than

10 seconds, double check your cable connections and drywell configuration.

- 5. If a dual well is recognized, a menu will pop up that allows you to select a "hot" or "cold" side of the dual well. Only one side of the drywell may be controlled at a time. Switching sides requires the drywell to be reconnected, by disconnecting the serial cable or by leaving drywell source mode and selecting it again.
- 6. When the drywell is connected, the primary display will show the actual temperature of the drywell, as measured by the drywell internally. The drywell model number will appear above the primary reading. The setpoint for the drywell is displayed in the secondary display, at the bottom of the screen. Initially, the setpoint will be set to the value already stored in the drywell.
- 7. Enter the temperature you wish to source and press  $\left[ \frac{\text{EVTER}}{2} \right]$ .

The settled indicator will be cleared when the actual temperature is within one degree of the setpoint, and the actual temperature is not changing quickly. Refer to the drywell documentation for that model's recommendations for stabilization time.

The upper temperature limit is restricted by the "High Limit" setting stored in the drywell. If the Product will not set the drywell to temperatures within the drywell spec, refer to the drywell manual to check the "High Limit" setting.

59

**753/754** Users Manual



Figure 24. Source Temperature with Drywell

60

Find Quality Products Online at:
#### Documenting Process Calibrator Source Mode

#### Note

When the Product is set to display temperatures in Kelvin, the drywell readout will show Celsius, and when the Product shows Rankine, the drywell will show Fahrenheit.

#### Source Scale

This feature scales the output in accordance with the input requirements of an applicable process instrument's response. Percent of scale can be used for linear-responding transmitters, or square-root responding transmitters.

#### Linear-Responding Transmitters

- 1. If necessary, push source mode.
- Select a source function (ma, wc, Wc, Mar, a), TC (ma), or
   a) as previously described, and record a value.
- 3. Push the Scale softkey.
- 4. Select % from the list.
- 5. Push ENTER.
- Use the numeric keypad to record the 0% of scale value (0% Value).
- 7. Push ENTER.
- 8. Use the numeric keypad to record the 100% of scale value (**100% Value**).

9. Push the Done softkey.

Percent of scale stays in effect until you change to a different source function or until the **Scale** softkey is pushed and you select a different scale mode.

#### Square-Root Process Variables

When you select  $\sqrt{}$  within scaling, the Product output value is the percent value recorded, squared, and converted to engineering units.

- 1. If necessary, push source for SOURCE mode.
- Select a source function (ma), vcc, vdc, and record a value.
   as previously described, and record a value.
- 3. Push the **Scale** softkey.
- 4. Select  $\sqrt{100}$  from the list.
- 5. Use the numeric keypad to record the 0% of scale value (**0% Value**).
- 6. Push ENTER.
- Use the numeric keypad to record the 100% of scale value (100% Value).
- 8. Push ENTER.
- 9. Push the Done softkey.

Square root percent of scale is in effect until the Product is changed to a different source function or the **Scale** softkey is pushed and you select a different scale mode.

#### Step and Ramp the Output Value

Two features are available that let you adjust the value of source functions, except pressure. For pressure, an external pressure source must be used:

- Step the output manually with ⓐ and ♥, or in automatic mode.
- Ramp the output with optional continuity or V trip detect.

#### Manual Step Use

The manual **Step** feature selects a step size in engineering units (mV, V, mA, °C, etc.) or % of scale. Step the output in % of scale to quickly jump between 0 % and 100 % (set step size = 100 %) or 0-50-100 % (set step size = 50 %). Step works in SOURCE and in MEASURE/SOURCE modes.

To select a step size:

- 1. See the applicable Source Mode subheading in this manual (for example, "Source Electrical Parameters") and connect the Product to the test circuit.
- 2. If necessary, push source mode.
- 3. Set the Product for the necessary source value.

- 4. To step the source value in % of scale, set the % of scale value as given before in "Measurement Scale".
- 5. Push the Step softkey.
- 6. Use the numeric keypad to record the step size in the units shown on the display.
- 7. Push the **Done** softkey.
- 8. Push and to adjust the output in steps.

#### Auto Step Use

To configure the Product to make a sequence of steps automatically, either once through the sequence or repetitively:

- See the applicable Source Mode subheading in this manual (for example, "Source Electrical Parameters") and connect the Product to the test circuit.
- 2. If necessary, push source mode.
- 3. Set the Product for the necessary source value.
- 4. To step the source value in % of scale, set the % of scale value as given before in "Measurement Scale".
- 5. Push the **Step** softkey.
- 6. Push the Auto Step softkey.

# www.GlobalTestSupply.com

#### Documenting Process Calibrator Source Mode

- 7. The display tells you to select values for these parameters:
  - Start point (in units or % of scale)
  - End point
  - Number of steps
  - Time per step
  - Repeat mode, single shot or continuous repetition
  - Step style, Sawtooth or Triangle pattern
  - Start delay

Push the **Start Step** softkey to automatically start the step function. The softkey label changes to **Stop Step**.

- 8. To Push the **Stop Step** softkey to stop the automatic step function.
- 9. Push the **Done** softkey to continue normal operation.

#### Ramp the Output

When ramped, the source sweeps up or down in value. Use the ramp feature to check a switch or alarm, or when a smooth increase or decrease of the output function is necessary. The Product can be set to ramp up or down in engineering units (mV, V, mA, °C, etc.) or % of scale.

While the signal ramps, the output is adjusted 4 times per second. The size of the steps is bound by the selection of endpoints and ramp time. For example, if you set the Product to ramp from 1 mV to 1 V over 10 seconds, the output is adjusted in approximately 25 mV steps.

The Ramp function continues until you get the selected limit, or until an optional trip condition is met. The optional trip detect works as follows: during ramping, the Product checks for either a 1 V change in dc voltage or a change in continuity status (**Open** or **Short**) from one <sup>1</sup>/<sub>4</sub> second interval to the subsequent interval.

#### **753/754** Users Manual

To ramp (for example, sweep the source):

- 1. See the applicable section earlier in this manual (for example, "Source Electrical Parameters") and connect the Product to the test circuit.
- 2. To automatically stop the Ramp function if a trip condition is sensed, connect a voltage trip circuit to the V MEASURE jacks or a continuity trip circuit to the mA  $\Omega$  RTD MEASURE jacks. (Continuity detection is not available when sourcing current.)
- 3. If necessary, push source mode.
- 4. Set the Product for the necessary source value as given before.
- 5. To Ramp the output in % of scale, set % of scale as given before under "Measurement Scale".
- 6. Push the More Choices softkey.
- 7. Push the **Ramp** softkey. The display changes to the screen shown Figure 25.
- 8. Record the parameters given. Record the **Start Value**, **End Value**, and **Ramp Time**.
- To automatically stop the Ramp function if a trip condition is sensed, set the Trip Detect to Enabled, and select Voltage or Continuity as the trip function.

SOURCE R	AMP		( <b>1111</b> ) %
Enter Start	Value		
	Start Value	????????	2 mA
	End Value	???????	? mA
	Ramp Time	????	? s
	Trip Detect	Disab	led
	Trip Function	V I	DC
	1		
Abort			Done
	•		gks41s.bm

#### Figure 25. Ramp Screen

- 10. Push the **Done** softkey. Note **RAMP** next to **SOURCE** at the top of the display.
- 11. Select a low-to-high ramp or a high-to-low ramp with the **Ramp Up/Down** softkey.
- 12. To start the Ramp function, push the **Start Ramp** softkey.
- 13. The Ramp function continues until a trip is sensed (if enabled), the ramp time expires, or the **Stop Ramp** softkey is pushed. See Figure 26.

64

#### Documenting Process Calibrator Source Mode



Figure 26. Check a Relay Output Trip Alarm

gks22c.eps

Find Quality Products Online at:

www.GlobalTestSupply.com

#### 753/754

Users Manual

#### Simultaneous Measure/Source

Use the MEASURE/SOURCE mode to calibrate or emulate a process instrument. Push so that a split screen display shows as in Figure 27.

MEASURE			⟨ⅢⅢ ※
	8.0	005 mA	L .
SOURCE			ТС Туре К
	15	0.0°C	
Int. Ref. 24.E	i⁰C	ITS-90	5.154mV
As Found	Step	Save	More Choices
	•	•	aks42s hmr

Figure 27. Measure and Source Screen

Table 9 shows the functions that can be used at the same time when Loop Power is disabled. Table 10 shows the functions that can be used at the same time when Loop Power is enabled.

**Step** or **Auto Step** features can be used to adjust the output in MEASURE/SOURCE mode, or use the calibration routine given when the **As Found** softkey is pushed.

Use the two softkeys shown in MEASURE/SOURCE mode when you calibrate a process instrument:

- **As Found**, which can be used to set up a calibration routine to get and record as found data.
- Auto Step, which can be used to set up the Product for auto-stepping, as given before.

66

# Documenting Process Calibrator Simultaneous Measure/Source

				Source	• Function		
Measure Function	dc V	mA	Freq	Ω	тс	RTD	Pressure
dc V	•	•	•	•	•	•	•
mA	•		•	•	•	•	•
ac V	•	•	•	•	•	•	•
Frequency (≥20 Hz)	•	•	•	•	•	•	•
Low Frequency (<20 Hz)							
Ω	•		•	•	•	•	•
Continuity	•		•	•	•	•	•
TC	•	•	•	•		•	•
RTD	•		•	•	•	•	•
3W RTD	•		•	•	•	•	•
4W RTD	•		•	•	•	•	•
Pressure	•	•	•	•	•	•	

#### Table 9. Simultaneous MEASURE/SOURCE Functions with Loop Power Disabled

67

#### **753/754** Users Manual

### Table 10. Simultaneous MEASURE/SOURCE Functions with Loop Power Enabled

Magazina Function				Source	Function		
measure Function	dc V	mA	Freq	Ω	тс	RTD	Pressure
dc V	•		•	•	•	•	•
mA	•		•	•	•	•	•
ac V	•		•	•	•	•	•
Frequency (≥20 Hz)	•		•	•	•	•	•
TC	•		•	•		•	•
Pressure	•		•	•	•	•	

68

Find Quality Products Online at:

#### Documenting Process Calibrator Process Instrument Calibration

#### **Process Instrument Calibration**

#### Note

To calibrate a HART-capable transmitter using the built-in HART interface, see the 754 HART Mode Users Guide for instructions.

When the Product is in MEASURE/SOURCE, a built-in calibration routine can be configured when the **As Found** softkey is pushed. As Found data is the test results that show the condition of a transmitter before it is adjusted. The Product can run preloaded tasks that are developed with a host computer and *DPCTrack2* application software. See "Communication with a PC".

#### Generate "As Found" Test Data

The subsequent example shows how to supply as found data for a thermocouple temperature transmitter.

Here, the Product simulates the output of a thermocouple and measures the current regulated by the transmitter. Other transmitters use this same procedure. Go back to MEASUREMENT or SOURCE mode and change the operation parameters before you push **As Found**.

- Connect the test leads to the instrument under test as shown in Figure 30. The connections simulate a thermocouple and measure the corresponding output current.
- 2. If necessary, push source for MEASURE mode.
- 4. Push source for SOURCE mode.
- 5. Push  $\frac{\text{TC}}{\text{RTD}}$  and ENTER to select TC sensor.
- 7. Push ENTER to select then ENTER to select Linear T source mode.
- 8. Record a source value, for example 100 degrees, and then push [ENTER].

69

# 753/754

#### Users Manual

9. Push **EXE** for MEASURE/SOURCE mode. The display changes to the screen shown in Figure 28.

MEASURE			( <b>IIII</b> ) %
	8.0	)05 mA	L .
SOURCE			ТС Туре К
	15	0.0 °C	
Int. Ref. 24.6	i°C	ITS-90	) 5.154mV≕
As Found	Step	Save	More Choices
			aks42s.bmp

Figure 28. Process Instrument Calibration Screen

10. Push the **As Found** softkey, followed by the **Instrument** selection (ENTER).

The display changes to the screen shown in Figure 29.

			( <b>IIII</b> ※
MEASURE			
	0% Value	e ???????	🖥 m A
	100% Value	e ???????	? mA
	Tolerance	e ??????	?%
	Delay	J	0 5
SOURCE			ТС Туре К
	0% Value	e ???????	? °C
	100% Value	e ???????	? °C
	Test Strategį	ј З	t
Abort	User Value	Custom Units	Done
-			aks44s hmr

#### Figure 29. Process Instrument Calibration Screen 2

11. Record values for **0%** and **100%** of 4.0 mA and 20.0 mA, in that sequence. Set **Tolerance** to 0.5% of span.

70

### **Documenting Process Calibrator** Process Instrument Calibration



Figure 30. Calibrate a Thermocouple Temperature Transmitter

gks23c.eps

Find Quality Products Online at:

- More delay time can be input for the process instrument to become stable than the Product's usual settling time (about 2 seconds). To change the delay time, input that time in seconds for **Delay**.
- Push and to move the cursor down to record 0% and 100% values for SOURCE temperature. Our example uses 100 °C and 300 °C.
- If the instrument calibration procedure requires you to manually record the measurement value or source, push the User Value softkey, for user-recorded values.

**Custom Units** lets you specify user units such as PH. See "Creating Custom Measurement Units", given before in this manual for an example.

When you use custom units,  $\underline{\Lambda}$  is shown next to the value on the display and in results.

Push the **Done** softkey after the custom unit has been programmed.

- 15. The **Test Strategy** is the number of test points and which test points are performed rising and falling in percent of scale. This example uses five points (0 %, 25 %, 50 %, 75 %, and 100 %), rising only. Rising is indicated by the up arrow on the display. Push even to change to a different test strategy on this line. A list of strategies is shown from which to choose. Select one, and then push the **Done** softkey.
- When you are done recording the calibration parameters, the display should change to the screen shown in Figure 31.

			( <b>IIII</b> ※
MEASURE			
	0% Valu	e 4.00	10 mA
	100% Valu	e 20.00	0 mA
	Tolerance	e 0.5	0 %
	Dela	y .	0 s
SOURCE			ТС Туре К
	0% Valu	e 100.	0 °C
	100% Valu	e 300.	0 °C
	Test Strateg	- 5	t
Abort	User Value	Custom Units	Done
	•		aks45s bmp

Figure 31. Calibration Parameters Screen

**Find Quality Products Online at:** 

17. Push the **Done** softkey to accept the calibration parameters. The display changes to the screen shown in Figure 32.

		( <b>1111</b> %
0.07 % <b>4.(</b>	)11 mA	
		ТС Туре К
10	0.0 °C	
۱۰C	ITS-90	2.917mV=
Auto Test	Manual Test	
	0.07% 4.0 10 ℃ Auto Test	0.07 % <b>4.011 mA</b> <b>100.0 °C</b> <sup>°C</sup> ITS-90 Auto Manual Test Test



18. At this time you can do an automatic test or step through the test points manually. Push the Auto Test softkey to have the Product go through the tests automatically. If necessary, push Abort to exit from the calibration procedure. The tests start at the first test point, sources the correct temperature and measures the corresponding current from the transmitter.

#### Documenting Process Calibrator Process Instrument Calibration

When a measurement is stable and recorded, the Product goes to the subsequent step. Because the Product waits until the measurement becomes stable, the Auto Test works as necessary for instruments with built-in damping. The error of the expected measured value is shown in the top left of the measure window.

19. The Product moves to the remaining set of points. For temperature and electrical parameter calibration, the points are done automatically. If your source pressure, the Product stops at each step to let you adjust the pressure source. When the tests are complete, an error summary table similar to Figure 33 is shown.

			( <b>IIII</b> ※
SOURC	E M	IEASURE	ERROR %
100.0	°C	3.904 mA	-0.60
150.0	°C	7.965 mA	-0.22
200.0	°C	12.053mA	0.33
250.0	°C	16.094mA	0.59
300.0	°C	20.175mA	1.09
		1	1
Abort	Prev.	Next	Done
	Page	Page	
			aks47s hmn

Figure 33. Error Summary Screen

73

Find Quality Products Online at:

In the results summary test, failures are highlighted. An adjustment is necessary in this example because three tests show failures. The failures were outside the  $\pm 0.5$  % tolerance that was selected.

20. Push the **Done** softkey to keep the data, or the **Abort** softkey to erase the data and start again.

See the data entry that was recorded and recall the table later with the **Review Memory** softkey during normal operation. This data can be uploaded to a host computer that runs compatible *DPCTrack2* application software. See "Communication with a PC".

#### Transmitter Adjustment

#### Note

Always read the transmitter manufacturer's instructions to find the adjustment controls and connection points for your transmitter.

To make calibration adjustments to the transmitter:

1. Push the **Done** softkey after you review the results summary.

- Push the Adjust softkey. The Product sources 0 % of span (100 °C in this example) and shows these softkeys:
  - Go to 100%/Go to 0%
  - Go to 50%
  - As Left
  - Done
- Adjust the transmitter output for 4 mA and then push the Go to 100% softkey.
- 4. Adjust the transmitter output for 20 mA. If HART adjustments (output Trim and Sensor trim) are necessary, please refer to the *754 HART Mode Users Guide*.
- 5. If the span was adjusted in step 4, do steps 3 and 4 until adjustment is no longer necessary.
- 6. Examine the transmitter at 50 %. If it is in specification, the adjustment is done. If not, adjust the linearity and start this procedure again at step 3.

74

#### "As Left" Test Run

Proceed as follows to generate and record *as left* data for the thermocouple temperature transmitter that was adjusted.

- 1. Push the As Left softkey to record as left data.
- 2. Push the **Auto Test** softkey to start an automatic sequence through all the test points, or step through the tests manually.
- 3. When the tests are complete, read the error summary table. See Figure 34.

SOURC	E N	1EASURE	ERROR %
100.0	°C	3.966 mA	-0.21
150.0	°C	7.991 mA	-0.06
200.0	°C	12.029mA	0.18
250.0	°C	16.023mA	0.14
300.0	°C	19.983mA	-0.11
	Drov	Nevt	
Abort	Page	Page	Done
			gks48s.br

Figure 34. As Left Data Screen

#### Documenting Process Calibrator Process Instrument Calibration

Unsettled measure or source values are highlighted. This means that there was an unsettled value  $( \sim \frac{1}{2} )$  annunciator) when the measurement was taken.

4. If all the results are in specification, as they are here, push the **Done** softkey. An entry in memory is made for *as left* data.

#### **Test Comments**

The Product does tasks (custom procedures) that are made with a host computer and *DPCTrack2* application software. See "Communication with a PC". A task can show a list of proposed comments as it operates . When the comment list is shown, push and and then to select a comment to be kept with the test results.

#### **Calibrate a Delta-Pressure Flow Instrument**

The procedure to calibrate a  $\sqrt{}$  instrument is the same as for other instruments, as given before, with these differences:

- Source square-root is automatically enabled after the As Found calibration template is complete.
- Measure/Source displays are in engineering units.
- The measurement percentage is automatically corrected for the transmitter's square-root response, and is used to calculate instrument errors.

75

Select the  ${\boldsymbol \sqrt{}}$  instrument procedure in a menu after you push the  ${\boldsymbol A}{\boldsymbol s}$  Found softkey.

#### Switch Calibration

The procedure to calibrate a switch also uses the As Found and As Left calibration templates. Select the **1 Pt. Switch** or **2 Pt. Switch** procedure in a menu after you push the **As Found** softkey. Figure 35 specifies the terminology used when you calibrate limit switches.

The template to set up the switch procedure uses these parameters:

- Switch sense (normally open or closed)
- For each setpoint:
  - Setpoint value
  - Setpoint tolerance
  - High limit or low limit
  - Minimum deadband
  - Maximum deadband



Figure 35. Switch Terminology

76

www.GlobalTestSupply.com

#### Documenting Process Calibrator Process Instrument Calibration

To do a pressure switch test: The switch in this example sets at a high limit of 10 psi. The set condition is a closed switch contact. For pressure switches, use the **Manual Test** selection. For switches where sourcing pressure is not necessary, use the **Auto Test** selection to do the test.

- 1. Connect the test leads between the pressure switch contact output and the mA  $\Omega$  RTD (center) jacks on the Product.
- 2. Connect the pressure module to the Product, and connect a pressure line to the switch. Keep the pressure line vented to atmosphere.
- 3. If necessary, push some for MEASURE mode.
- 4. Push 🗿 for the continuity measure function.
- 5. Push source mode.
- 6. Push  $\bigcirc$  for the pressure source function.

- 7. Push CLEAR to zero the pressure module.
- 8. Push MEASURE .
- 9. Push the As Found softkey.
- 10. Highlight **1 Pt. Switch Test** from the menu and push
- 11. Push **ENTER** to modify the parameters for Setpoint 1.
- 12. Make these selections: Setpoint 1 = 10.000 psi Setpoint Type = High Set State = Short
- 13. Push the **Done** softkey.
- 14. Set the Tolerance to 0.5 psi.
- The next parameters, Deadband Min and Deadband Max, are optional. Do not set them in this example. These parameters would describe the minimum allowable size of the deadband.

77

- 16. Push **EVITER** to move through the choices to Set **Trip Function** to **Trip Cont**.
- 17. Push the Done softkey.
- 18. Push the Manual Test softkey.
- 19. Close the pressure line vent and slowly move the pressure up to the trip point.
- 20. When the switch sets, slowly decrease the pressure until the switch resets. If necessary, this cycle can be done again.
- 21. Push the **Done** softkey and see the results.
- Push the Done softkey and if necessary, record Tag, S/N, and/or ID.
- 23. Push the Done softkey.
- 24. Exercise the switch by varying the applied pressure. Adjust the switch until the set point is correct.
- 25. Use the softkeys to control the Product, and adjust the switch as necessary.

- 26. Push the Done softkey.
- 27. Push the **As Left** softkey to start the test again with the same parameters. Results from the As Found and As Left tests are kept in Product memory to view later or upload.

The procedure for switches that respond to other parameters work similarly. When you do a 2 Pt. Switch Test, follow the directions given on the display for the first switch test, change test leads, and do the second switch test.

#### Documenting Process Calibrator Transmitter Mode

#### **Transmitter Mode**

The Product can be set so that a varying input (MEASURE) controls the output (SOURCE), like a transmitter. This is "Transmitter mode". In Transmitter mode, you can use the Product temporarily as an alternative for a defective transmitter or for one that you think could be defective.

#### ▲Warning

To avoid possible personal injury, do not use Transmitter mode in any environment that requires intrinsic safe equipment and practices.

#### <u>∧</u>Caution

Transmitter mode is for diagnostic purposes only. Use a completely charged battery. Do not use the Product in place of a transmitter for extended periods. To set up the Product to emulate a transmitter:

- 1. Disconnect the control bus wires from the transmitter output (loop current or dc V control signal).
- Connect test leads from the appropriate Product SOURCE jacks to the control wires in place of the transmitter.
- 3. Disconnect the process input (for example, thermocouple) from the transmitter.
- 4. Connect the process input to the applicable Product MEASURE jacks or input connector.
- 5. If necessary, push so for MEASURE mode.
- 6. Push the applicable function key for the process input.
- 7. Push source mode.

- Push the applicable function key for the control output (for example, vc or m). If the transmitter is connected to a current loop that has a power supply, select Simulate Transmitter for the current output.
- 9. Select a source value, for example, 4 mA.
- 10. Push [Source] for MEASURE/SOURCE mode.
- 11. Push **More Choices** until the **Transmitter Mode** softkey is shown.
- 12. Push the Transmitter Mode softkey.
- 13. Set the 0 % and 100 % values for MEASURE and SOURCE on the display. Linear or √ can be selected for the transfer function.
- 14. Push the Done softkey.

The Product is now in Transmitter mode. It measures the process input and sources the control signal output proportional to the input.

- 15. To change the Transmitter mode parameters, push **Change Setup**, and do the procedure in step 13 again.
- 16. To exit Transmitter mode, push the Abort softkey.

#### Memory Operations

#### Save Results

As Found/As Left test results are automatically kept at the end of each test routine. Any other time during MEASURE, SOURCE, or MEASURE/SOURCE, if necessary, push the **Save** softkey to keep the data on the display for later inspection.

80

Find Quality Products Online at:

#### Documenting Process Calibrator Memory Operations

After you push **Save**, the Product keeps the information on the display and shows a kept result index number, the date and time, and the percentage of memory available, as in Figure 36.

			( <b>IIII</b> ) %
Press Con	tinue to Input Ta	ag ID	
	Item S	aved 20	
	05/11/11 0	8:00:02 am	
	Memory Ava	ilable 98.0%	
	5		
			1
Abort		Continue	Done
	1	1	aks4

Figure 36. Saved Data Screen

To add information to the kept data, push the **Continue** softkey, the display asks you to record the instrument tag identifier (**Tag**), instrument serial number (**S/N**), and operator name (**ID**), as shown in Figure 37.

			\ <b></b> \
Press ENTE	R to Change		
	Tag <b>??????</b>		
	S/N 222222		
	ID No nom		
	ID NU Hall	6	
Abort			Done

Figure 37. Additional Data Input Screen

81

Record alphanumeric characters into the highlighted field with the optional bar code reader or the Product buttons.

To record alphanumeric characters using the Product buttons, push with the cursor on the necessary field to change (for example, Tag, above).

The display shows an alphanumeric entry window. See Figure 38.

									( <b>IIII</b> ※
				٦	Гag				
Select (	chara	icter	and	pre	ss El	NTEF	}		
A K U	E L V	C M W	D N X	E O Y	F P Z	G Q	H R -	I S Ñ	J T /
TT-10	4-10	B							
Abort		5	Spac	e		Ba Spa	ck Ice		Done
									aks51s

#### Figure 38. Alphanumeric Entry Window

- Record numbers using the numeric keypad, and letters by highlighting the necessary character with 
   , , , , and 
   followed by Errer
   Push the Space softkey, followed by Errer
   to record a space character.
- 2. When the entry is complete, push the **Done** softkey.

#### Documenting Process Calibrator Memory Operations

#### **Review the Memory**

Push the **More Choices** softkey until **Review Memory** is shown, then push the **Review Memory** softkey to recall and see results that you have kept.

When the **Review Memory** softkey is pressed, the display changes to the screen shown in Figure 39.

					( <b>IIII</b> ×
Results From (	05/23/11 1 of 1	8			
	Meas	ure	04:33:01	pm	
	Sou	rce	04:33:04	pm	
	TT-101-1	4A	04:33:24	pm	
	04:33:26	pm			
	Measure			pm	
PT-121-5			04:33:47	pm	
	Logged Data			pm	
	04:33:56	pm			
	Min N	1ax	04:33:57	pm	
	Meas	ure	04:34:00	pm	
Go To	Prev.		Next		Dene
Result	Page		Page		DOLLE
					gks52s.brr

Figure 39. Memory Review Screen

Push  $\textcircled{\ or \ }$  or  $\textcircled{\ }$  and  $\textcircled{\ }$  or the **Go to Result** softkey to view a result that was kept.

#### Log Data

Users can record a series of measurements for later upload to a host computer that uses *DPCTrack2* application software. See "Communication with a PC". Up to 8000 readings can be recorded, depending on the reading rate, duration, and how much memory is being used for other things such as tasks or kept results. Record the reading rate and duration in minutes. See Figure 40.

MEASURE	LOG		( <b>IIII</b> %
Press EN	TER to Change		
	Reading Rate	20	/min
	Duration	10	minutes
	Number of Points	200	
	Memory Available	98.0%	
Abort			Done
	I		gks53s.

Figure 40. Data Log Parameters Screen

83

Find Quality Products Online at:

- To log data:
- 1. If necessary, push store for MEASURE mode.
- 2. Push the More Choices softkey twice.
- 3. Push the **Log** softkey.
- A list is shown; select a reading rate (1, 2, 5, 10, 20, 30, or 60 readings per minute). Push or to select the reading rate.
- 5. Push ENTER.
- 6. Push  $\bigcirc$  to move the cursor to **Duration**.
- Use the numeric keypad to record the duration in minutes, followed by ENTER. The maximum duration will depend on the reading rate and how much memory is available to log data.

Table 11 gives an estimate of the limits for duration, assuming that no memory is being used for other purposes.

Table 11. Duration Limits						
Readings/Minute	Maximum Readings	Approximate Duration				
1	8000	133 hours				
2	8000	66 hours				
5	8000	26 hours				
10	8000	13 hours				
20	8000	6 hours				
30	7980	4 hours				
60	7980	2 hours				

84

www.GlobalTestSupply.com

#### **≜**Caution

To prevent possible damage to the Product, use a completely charged battery and the appropriate duration, or use the battery charger to avoid losing power during a logging session. If a low-battery condition occurs during a log session, the session is terminated and data collected to that point is kept. A long logging duration can exceed the life of a battery charge.

#### Documenting Process Calibrator Memory Operations

- 8. After the Product records the duration selection, the display shows how much memory that duration will consume. See the **Memory Available** percentage on the display. **Memory Available** indicates the percentage of available memory that will be used by the specified log.
- 9. Push the **Done** softkey. The display changes to the screen shown in Figure 41.

4.004 mA	MEASURE		Gource Off	×
		4.00	)4 m/	4
0.0 7.5 15.0 22.5 30.0 mA humanitation diamanda and a	0.0 I	7.5 19	5.0 22.5 I	30.0 mA
Abort Start Logging	Abort	Start Logging		

Figure 41. Start Logging Screen

85

- 10. Note the **LOG** annunciator next to **MEASURE**. Push the **Start Logging** softkey to record data.
- 11. The Product continues to keep data points until the duration has passed, or until the **Done** softkey is pushed. If logging is stopped by these procedures the Product keeps the data as a memory item that can be uploaded to a host computer that uses *DPCTrack2* application software. See "Communication with a PC".

#### **Record Min and Max Measurements**

You can set the display to record and show the maximum (max) and minimum (min) readings. Min and Max readings are always undamped, even if Dampen is On. Push the **More Choices** softkey twice, then push the **Min Max** softkey to energize this feature. Push CLARE to reset the Min Max registers. Push the **Min Max** softkey again to revert to the normal display. Figure 42 shows the display with Min Max on.

					( <b>IIII</b> %	
MEA	<u>SURE</u>	5	Source	Off		
			דר	<b>M</b> _		
		2.033	] /	V =		
Min:	0.29993	٧		Max:	6.2998 V	
	0.0	7.5 15	i.o i	22.5	30.0 V	
	huu			mhuuuu	nul	
	Loa	Min <u>M</u> ax	Dam	pen	More	
LUY		On	On		Choices	
					aks55s.br	

Figure 42. Min Max Screen

86

www.GlobalTestSupply.com

#### Documenting Process Calibrator The Calculator

#### Run a Preloaded Task

Push the **More Choices** softkey until the **Tasks** softkey is shown, then push **Tasks** to see the list of tasks (procedures) downloaded from a host computer. Tasks are Product configurations, kept with a procedure name, for example the type and manufacturer of a specific transmitter. A task configures the Product for transmitter calibration with all the calibration parameters (source and measure functions, 0% and 100% levels, test strategy) predefined.

While the task controls the Product, the **Continue** softkey becomes **Continue Task**.

#### **Clear the Memory**

In Setup mode, highlight the **Clear Memory** choice and push **EXTER** to erase the memory:

- Results that have been kept
- Min Max data
- Log data sets

A confirmation message is shown so that the memory is not accidently erased.

#### The Calculator

For mathematical equations that involve the Product's source or measured value, use the Product's built-in calculator. The current measure and source values and units, are always available to be put into an equation with one keystroke. The Product measures and sources during calculator operation.

Push the **Calc** softkey to start the calculator from the SOURCE, MEASURE, or MEASURE/SOURCE mode. Push the **More Choices** softkey to see the **Calc** softkey if necessary.

After you push **Calc**, the display, number keys, and keys with calculator functions  $(\widehat{\bullet}, \widehat{\bullet}, \textcircled{\bullet}, \rule{\bullet}, \rule{\bullet$ 

Push the **Done** softkey to start normal Product operation.

Users Manual

#### Save to and Recall from the Registers

When the Product is in calculator mode, the top half of the display shows three register names and their contents:

- **MEASURE** (the present measured value)
- **SOURCE** (the present sourced value)

• **REGISTER** (temporary storage for your use) Push the **Recall** softkey and then the softkey for the applicable register to insert the contents of any register into a calculation.

Push **Store** to copy the number from the calculator display (lower half) into **REGISTER** to temporarily save the number for later use, or into **SOURCE**.

#### Use the Calculator to Set the Source Value

When you store to **SOURCE**, the Product shows a selection of unit multipliers when necessary (for example, mV or V), then starts sourcing that value. The Product will not keep out-of-range values to **SOURCE**.

#### **Quick Guide to Applications**

The subsequent figures show test lead connections and which Product functions to use for many different applications.

88

# Documenting Process Calibrator Quick Guide to Applications



89

Find Quality Products Online at:

www.GlobalTestSupply.com

**753/754** Users Manual



Figure 45. Monitor AC Line Voltage and Frequency

90

# Documenting Process Calibrator Quick Guide to Applications



Figure 46. Current-to-Pressure (I/P) Transmitter Calibration

**Find Quality Products Online at:** 

**753/754** Users Manual



Figure 47. Output Current of a Transmitter Measurement

92

Find Quality Products Online at:

www.GlobalTestSupply.com

# Documenting Process Calibrator Quick Guide to Applications



93

**Find Quality Products Online at:** 

www.GlobalTestSupply.com

**753/754** Users Manual



Figure 50. Checking a Switch

Figure 51. Tachometer Examination

94

# Documenting Process Calibrator Quick Guide to Applications



Figure 52. Analog and HART Pressure Transmitter Connection

95

**Find Quality Products Online at:** 

**753/754** Users Manual



Figure 53. mV to Current Transmitter Calibration

96

Find Quality Products Online at:

www.GlobalTestSupply.com
## Documenting Process Calibrator Quick Guide to Applications



Figure 54. Vortex Shedding Flowmeter Check

97

Find Quality Products Online at:





Figure 55. HART and Analog RTD Transmitter Connections

98

Find Quality Products Online at:

## Documenting Process Calibrator Quick Guide to Applications



Figure 56. Analog and HART Thermocouple Transmitter Connections

99

Find Quality Products Online at:

**753/754** Users Manual



Figure 57. Transmitter HART- Comm Only

100

Find Quality Products Online at:

# **Documenting Process Calibrator**

Communication with a PC

#### Communication with a PC

Procedures and results that you have kept can be uploaded from and downloaded to a PC. A PC, Microsoft Windows, USB cable (supplied), and Fluke DPCTrack2' application software, or a qualified Fluke partner's software are required. See the DPCTrack2 Users Manual for further instructions.

#### Maintenance

#### ∧ ∧ Warning

To prevent possible electrical shock, fire, or personal injury:

- Have an approved technician repair the Product.
- Do not operate the Product with covers removed or the case open. Hazardous voltage exposure is possible.
- Remove the input signals before you clean the Product.
- Use only specified replacement parts.

#### Note

Additional maintenance instructions, including a calibration procedure and a list of replaceable parts is available in the 75X Series Calibration Manual available from the Fluke website.

#### Battery Replacement

Replace the battery when it no longer holds a charge for the rated interval. The battery normally lasts for up to 300 charge/discharge cycles. To order a replacement battery, see "Contacting Fluke" and "User-Replaceable Parts".

#### Note

Spent batteries should be disposed of by a qualified recycler or hazardous materials handler. Contact an authorized Fluke Service Center for recycling information.

#### Clean the Product

Clean the Product and pressure modules with a soft cloth dampened with water or water and mild soap.

#### **∧**Caution

To prevent possible damage to the Product, do not use solvents or abrasive cleansers.

101

#### **Calibration Data**

The date of the last calibration and verification shows on the calibration sticker and on the calibration screen in Setup mode. The CAL. STATUS number on the sticker should always match the Calibration Status number in the calibration screen. Calibration of the Product is to be done by qualified personnel. See the 75X Series Calibration Manual available at the Fluke website.

#### In Case of Difficulty

#### <u>∧</u>∧Warning

To avoid possible electric shock or personal injury, do not use the Product if it operates abnormally. Protection may be impaired. When in doubt, have the Product serviced.

If the display is blank or unreadable, but the beeper works when the Product is turned on, make sure the brightness is correctly adjusted. To adjust the Intensity, see "Display Intensity".

If the Product will not turn on, make sure the battery is not dead or disconnected from the battery charger. If the Product receives power, the power button should be lit. If the button is lit, but the Product does not power up, have the Product serviced. See "How to Contact Fluke".

#### Service Center Calibration or Repair

Calibration, repairs, or servicing not included in this manual must be done only by qualified service personnel. If the Product fails, examine the battery pack first, and replace it if necessary.

Make sure that you operate the Product in accordance with the instructions in this manual. If the Product is faulty, send a description of the failure with the Product. Pressure modules do not need to accompany the Product unless the module is faulty also. Be sure to pack the Product securely, using the original shipping container if it is available. See "How to Contact Fluke" and the Warranty Statement.

#### **User-Replaceable Parts**

Table 12 lists the Fluke part number of each userreplaceable part for the Product. See "Standard Equipment" and "Accessories" for model or part numbers of standard and optional equipment.

102

#### **Documenting Process Calibrator** User-Replaceable Parts

**Fluke Part Number** ltem Adjustable Quick-Release Strap 3889532 Input/Output Jack Decal 3405856 Tilt Stand 3404790 BP7240 Battery 4022220 **USB** Cable 1671807 BC7240 Power Supply/Battery Charger 4022655 Lens Cover 3609579 Alligator Clip Set-Extended Tooth 3765923 754HCC HART Communication Cable Assembly 3829410 AC280 Suregrip Hook Clip Set 1610115 TC Cap 4073631 Note: See "Standard Equipment" and "Accessories" for model or part numbers for most replaceable equipment.

#### **Table 12. Replacement Parts**

103

**Find Quality Products Online at:** 

www.GlobalTestSupply.com

#### 753/754

Users Manual

#### **Accessories**

The Fluke accessories listed below are compatible with the Product. For more information about these accessories and their prices, contact a Fluke representative.

- 700-IV Current Shunt
- DPCTrack2 software
- C799 Soft Carry Case
- BC7240 Replacement Battery Charger/Universal Power Supply
- HART Drywell Cable Accessory (PN 2111088)
- 12-V Car Battery Charger
- Fluke-700PCK Pressure Module Calibration Kit (requires pressure calibration equipment and a PC compatible computer)
- 700PTP-1 Pneumatic test pump
- 700HTP-1 Hydraulic test pump
- Fluke-700TC1 TC miniplug kit
- Fluke-700TC2 TC miniplug kit
- C781 Soft Carrying Case

- C700 Hard Carrying Case
- BP7240 Li-Ion Battery
- TL series test leads
- AC series test lead clips
- TP series test lead probes
- 80PK series thermocouples
- Pressure Modules Fluke model numbers listed below. (Differential models also operate in gage mode.) Contact a Fluke representative about pressure modules not listed here.
  - FLUKE-700P00 1 in. H2O/0.001
  - FLUKE-700P01 10 in. H2O/0.01
  - FLUKE-700P02 1 psi/0.0001
  - FLUKE-700P22 1 psi/0.0001
  - FLUKE-700P03 5 psi/0.0001
  - FLUKE-700P23 5 psi/0.0001
  - FLUKE-700P04 15 psi/0.001
  - FLUKE-700P24 15 psi/0.001
  - FLUKE-700P05 30 psi/0.001
  - FLUKE-700P06 100 psi/0.01

104

www.GlobalTestSupply.com

#### Documenting Process Calibrator Accessories

- FLUKE-700P27 300 psi / 0.01
- FLUKE-700P07 500 psi/0.01
- FLUKE-700P08 1000 psi/0.1
- FLUKE-700P09 1500 psi/0.1
- FLUKE-700PA3 5 psi/0.0001
- FLUKE-700PA4 15 psi/0.001
- FLUKE-700PA5 30 psi/0.001
- FLUKE-700PA6 100 psi/0.01
- FLUKE-700PV3 -5 psi/0.0001
- FLUKE-700PV4 -15 psi/0.001
- FLUKE-700PD2 ±1 psi/0.0001
- FLUKE-700PD3 ±5 psi/0.0001
- FLUKE-700PD4 ±15 psi/0.001
- FLUKE-700PD5 -15/30 psi/0.001
- FLUKE-700PD6 -15/100 psi/0.01
- FLUKE-700PD7 -15/200 psi/0.01
- FLUKE-700P29 3000 psi/0.1
- FLUKE-700P30 5000 psi/0.1
- FLUKE-700P31 10000 psi/1

105

### **Find Quality Products Online at:**

# www.GlobalTestSupply.com

## **Specifications**

### **General Specifications**

All specifications apply from +18 °C to +28 °C unless stated otherwise.

All specifications assume a 5-minute warmup period.

Measurement specifications are valid only when Damping is turned on. When damping is turned off, or when the  $\neg\psi$  annunciator is shown, floor specifications are multiplied by 3. Floor specifications are the second part of the specifications. The measure pressure, temperature, and frequency functions are specified only with damping on.

Specifications are valid to 110 % of range. The following exceptions are valid to 100 % of range: 300 V dc, 300 V ac, 22 mA source and simulate, 15 V dc source, and temperature measure and source.

To achieve the best noise rejection, use battery power.

Size (H x W x L)	Height = 63.35 mm (2.49 inches) x Width = 136.37 mm (5.37 inches) x Length = 244.96 mm (9.65 inches)
Weight	1.23 kg (2.71 lb) (Batteries included)
Display	480 by 272 pixel graphic LCD, 95 x 54 mm
Power	Internal battery pack: Lithium Ion, 7.2 V dc, 30 Wh

#### **Environmental Specifications**

Operating Altitude	3000 m (9842 ft)
Storage Altitude	13000 m (42650 ft)
Operating Temperature	10 to 50 °C
Storage Temperature	20 to 60 °C
Relative Humidity (Maximum, non-condensing)	90 % to 35 °C
	75 % to 40 °C
	45 % to 50 °C

Standards and Agency Approval Specifications

106

**Find Quality Products Online at:** 

# Documenting Process Calibrator Detailed Specifications

Double Insulation Creepage and ClearancePer IEC 61010-1			
Installation Category	. 300 V CAT II		
Design Standards and Compliance	EN/IEC 61010-1:2010, CAN/CSA C22.2 No. 61010-1-04, ANSI/UL 61010- 1:2004		
EMI, RFI, EMC	.EN 61326-1:2006		
RF Fields	Accuracy for all functions is not specified in RF fields >3 V/m		

### **Detailed Specifications**

Specifications valid after a 5-minute warmup.

Specifications are valid to 110 % of Range with the following exceptions: 300 V dc measure, 300 V ac measure, 50 kHz measure and source, 22 mA source and simulate, 15 V dc source, and temperature measure and source which are valid to 100 % of range.

#### **DC mV Measurement**

Banga	Becelution	% of Reading + Floor		
Kange	Resolution	1 Year	2 Year	
±100.000 mV	0.001 mV	0.02 % + 0.005 mV	0.03 % + 0.005 mV	
Input Impedance: >5 MΩ Maximum Input Voltage: 300 V, IEC 61010 300 V CAT II				
Temperature coefficient: (0.001 % of reading + 0.001% of range) / °C (<18 °C or >28 °C)				

**Find Quality Products Online at:** 

www.GlobalTestSupply.com

#### 753/754

Users Manual

#### **DC Voltage Measurement**

Denre Depolytion	Peopletian	% of Reading + Floor		
Range	Resolution	1 Year	2 Year	
±3.00000 V	0.00001 V	0.02 % + 0.00005 V	0.03 % + 0.00005 V	
±30.0000 V	0.0001 V	0.02 % + 0.0005 V	0.03 % + 0.0005 V	
±300.00 V	0.01 V	0.05 % + 0.05 V	0.07 % + 0.05 V	
Input Impedance: >4 MΩ Maximum Input Voltage: 300 V, IEC 61010 300V CAT II				

Temperature coefficient: (0.001 % of reading + 0.0002 % of range) /  $^{\circ}C$  (<18  $^{\circ}C$  or >28  $^{\circ}C$ )

Normal mode rejection: >100 dB at 50 or 60 Hz nominal

#### AC Voltage Measurement

Range	Deschution	% of Reading + Floor		
40 Hz – 500 Hz	Resolution	1 Year	2 Year	
3.000 V	0.001 V	0.5 % + 0.002 V	1.0 % + 0.004 V	
30.00 V	0.01 V	0.5 % + 0.02 V	1.0 % + 0.04 V	
300.0 V	0.1 V	0.5 % + 0.2 V	1.0 % + 0.2 V	
Input Impedance: >4 M Ω and <100 pF Input Coupling: AC Maximum Input Voltage: 300 V, IEC 61010 300V CAT II Temperature coefficient: 5 % of specified accuracy / °C (<18 °C or >28 °C)				

Specifications apply for 9 % to 100 % of voltage range.

108

Find Quality Products Online at:

# Documenting Process Calibrator Detailed Specifications

#### **DC Current Measurement**

Range	Resolution	% of Reading + Floor		
		1 Year	2 Year	
±30.000 mA	1 μΑ	0.01 % + 5 μA	0.015 % + 7 μA	
±100.00 mA	10 μA	0.01 % + 20 µA	0.015 % + 30 μA	
Maximum Input: 110 mA Maximum Burden Voltage: 420 mV at 22 mA				
Temperature coefficient: 3 % of specified accuracy / °C (<18 °C or >28 °C)				
No Fuse				
Normal mode rejection: 90 dB at 50 or 60 Hz nominal, and 60 dB at 1200 Hz and 2200 Hz nominal (HART signals)				

#### **Resistance Measurement**

Banga Baselution		% of Read	Source	
Range	Resolution	1 Year	2 Year	Current
10.000 Ω	0.001 Ω	0.05 % + 0.050 Ω	0.07 % + 0.070 Ω	3 mA
100. 00 Ω	0.01 Ω	0.05 % + 0.05 Ω	0.07 % + 0.07 Ω	1 mA
1.0000 kΩ	0.1 Ω	0.05 % + 0.0005 kΩ	0.07 % + 0.0007 kΩ	500 μA
10.000 kΩ	1 Ω	0.10 % + 0.010 kΩ	0.15 % + 0.015 kΩ	50 μA
Open-circuit voltage: 5 V nominal				

Temperature coefficient: 3 % of specified accuracy / °C (<18 °C or >28 °C)

### **Continuity Testing**

Tone	Resistance
Continuous tone	<25 Ω
May or may not get tone	25 to 400 Ω
No tone	>400 Ω

Find Quality Products Online at:

#### 753/754

Users Manual

#### **Frequency Measurement**

Ranges	Resolution	2 Year		
1.00 Hz to 110.00 Hz <sup>[1]</sup>	0.01 Hz	0.05 Hz		
110.1 Hz to 1100.0 Hz	0.1 Hz	0.5 Hz		
1.101 kHz to 11.000 kHz	0.001 kHz	0.005 kHz		
11.01 kHz to 50.00 kHz	0.01 kHz	0.05 kHz		
Coupling: AC Minimum Amplitude for Frequency Measurement (square wave): <1 kHz: 300 mV p-p 1 kHz to 30 kHz: 1.4 V p-p >30 kHz: 2.8 V p-p Maximum input:				
<1 kHz: 300 V rms >1 kHz: 30 V rms Input Impedance: >4 MΩ [1] For frequency measurement less than 110.00 Hz, specifications apply for signals with a slew rate >5 volt/millisecond.				

# **±DC** Voltage Output

Danga	Resolution	% of Output + Floor		
Kange		1 Year	2 Year	
±100.000 mV	1 μV	0.01 % + 0.005 mV	0.015 % + 0.005 mV	
±1.00000 V	10 μV	0.01 % + 0.00005 V	0.015 % + 0.00005 V	
±15.0000 V	100 μV	0.01 % + 0.0005 V	0.015 % + 0.0005 V	
Maximum Output Current: 10 mA, In the 100 mV range add 0.010 mV to specification when sourcing >1 mA.				
For sourcing dc voltages <110.000 mV, accuracy is not specified in RF fields >1 V/m, 80 MHz to 700 MHz.				
Temperature Coefficient: 0.001 % of output + 0.001 % of range / °C (<18 °C or >28 °C)				

110

Find Quality Products Online at:

# **Documenting Process Calibrator**

Detailed Specifications

#### +DC Current Source

Bango/Mada	Resolution	% of Output + Floor			
Range/Mode		1 Year	2 Year		
0.100 to 22.000 mA	1 μΑ	0.01 % + 3 μA	0.02 % + 3 μA		
Temperature Coefficient: 3 % of specified accuracy / °C (<18 °C or >28 °C)					
Source mA Compliance Voltage: 18 V maximum					
Source mA Open Circuit Voltage: 30 V maximum					

#### +DC Current Simulate (External Loop Power)

Bango/Modo	Posolution	% of Output + Floor			
Range/Mode	Resolution	1 Year	2 Year		
0.100 to 22.000 mA (Current Sink)	1 μΑ	0.02 % + 7 μA	0.04 % + 7 μA		
Simulate mA Input Voltage: 15 to 50 V dc, add 300 µA to floor when >25 V is present on the loop					

Temperature Coefficient: 3 % of specified accuracy / °C (<18 °C or >28 °C)

#### **Resistance Sourcing**

Banga	Pasalution	% of Output + Floor		Allowable Excitation	
Kange	Resolution	1 Year	2 Year	Current	
10.000 Ω	0.001 Ω	0.01 % + 0.010 Ω	0.015 % + 0.015 Ω	0.1 mA to 10 mA	
100.00 Ω <sup>[1]</sup>	0.01 Ω	0.01 % + 0.02 Ω	0.015 % + 0.03 Ω	0.1 mA to 10 mA	
1.0000 kΩ <sup>[2]</sup>	0.1 Ω	0.02 % + 0.0002 kΩ	0.03 % + 0.0003 kΩ	0.01 mA to 1.0 mA	
10.000 kΩ	1Ω	0.02 % + 0.003 kΩ	0.03 % + 0.005 kΩ	0.01 mA to 1.0 mA	
Temperature Coefficient: (0.01 % of output +0.02 % of range / °C (<18 °C or >28 °C). When connected to mains, accuracy is not specified with conducted RF >1V, 8 to 15 MHz. [1] Add 0.01 $\Omega$ when the excitation current is <1 mA.					

[2] Add 0.0015 k $\Omega$  when the excitation current is <0.1 mA.

**Find Quality Products Online at:** 

### 753/754

Users Manual

### Frequency Sourcing

Damma	Specification	
Kange	2 Year	
Sine Wave: 0.1 Hz to 10.99 Hz	0.01 Hz	
Square Wave: 0.01 Hz to 10.99 Hz	0.01 Hz	
Sine and Square Wave: 11.00 Hz to 109.99 Hz	0.1 Hz	
Sine and Square Wave: 110.0 Hz to 1099.9 Hz	0.1 Hz	
Sine and Square Wave: 1.100 kHz to 21.999 kHz	0.002 kHz	
Sine and Square Wave: 22.000 kHz to 50.000 kHz	0.005 kHz	
Waveform Choices: Zero-symmetric sine wave or positive 50 % duty-or	cycle square wave	
Square Wave Amplitude: 0.1 to 15 V p-p		
Square Wave Amplitude Accuracy, 0.01 to 1 kHz: 3 % p-p output + 75 mV, 1 kHz to 50 kHz: 10 % p-p output + 75 mV typical.		
Sine Wave Amplitude: 0.1 to 30 V p-p		
Sine Wave Amplitude Accuracy, 0.1 to 1 kHz: 3 % p-p output + 75 mV	/, 1 kHz to 50 kHz: 10 % p-p output + 75 mV typical.	
Frequency specifications are valid when averaged ≥100 ms		

112

Find Quality Products Online at:

www.GlobalTestSupply.com

## Documenting Process Calibrator Detailed Specifications

Turne	B	Meas	sure °C	Sou	Irce °C
туре	Range °C	1 Year	2 Year	1 Year	2 Year
E	-250 to -200	1.3	2.0	0.6	0.9
	-200 to -100	0.5	0.8	0.3	0.4
	-100 to 600	0.3	0.4	0.3	0.4
	600 to 1000	0.4	0.6	0.2	0.3
Ν	-200 to -100	1.0	1.5	0.6	0.9
	-100 to 900	0.5	0.8	0.5	0.8
	900 to 1300	0.6	0.9	0.3	0.4
J	-210 to -100	0.6	0.9	0.3	0.4
	-100 to 800	0.3	0.4	0.2	0.3
	800 to 1200	0.5	0.8	0.3	0.3
К	-200 to -100	0.7	1.0	0.4	0.6
	-100 to 400	0.3	0.4	0.3	0.4
	400 to 1200	0.5	0.8	0.3	0.4
	1200 to 1372	0.7	1.0	0.3	0.4
Т	-250 to -200	1.7	2.5	0.9	1.4
	-200 to 0	0.6	0.9	0.4	0.6
	0 to 400	0.3	0.4	0.3	0.4
В	600 to 800	1.3	2.0	1.0	1.5
	800 to 1000	1.0	1.5	0.8	1.2
	1000 to 1820	0.9	1.3	0.8	1.2

### Temperature, Thermocouples

113

Find Quality Products Online at:

# www.GlobalTestSupply.com

### **753/754** Users Manual

Toma	Banna 00	Mea	sure °C	So	urce °C
гуре	Range °C	1 Year	2 Year	1 Year	2 Year
R	-20 to 0	2.3	2.8	1.2	1.8
	0 to 100	1.5	2.2	1.1	1.7
	100 to 1767	1.0	1.5	0.9	1.4
S	-20 to 0	2.3	2.8	1.2	1.8
	0 to 200	1.5	2.1	1.1	1.7
	200 to 1400	0.9	1.4	0.9	1.4
	1400 to 1767	1.1	1.7	1.0	1.5
C (W5Re/W26Re)	0 to 800	0.6	0.9	0.6	0.9
	800 to 1200	0.8	1.2	0.7	1.0
	1200 to 1800	1.1	1.6	0.9	1.4
	1800 to 2316	2.0	3.0	1.3	2.0
L	-200 to -100	0.6	0.9	0.3	0.4
	-100 to 800	0.3	0.4	0.2	0.3
	800 to 900	0.5	0.8	0.2	0.3
U	-200 to 0	0.6	0.9	0.4	0.6
	0 to 600	0.3	0.4	0.3	0.4
BP	0 to 1000	1.0	1.5	0.4	0.6
	1000 to 2000	1.6	2.4	0.6	0.9
	2000 to 2500	2.0	3.0	0.8	1.2

114

Find Quality Products Online at:

# Documenting Process Calibrator Detailed Specifications

Turna	Banga %C	Meas	sure °C	Sou	Irce °C	
туре	Range	1 Year	2 Year	1 Year	2 Year	
ХК	-200 to 300	0.2	0.3	0.2	0.5	
	300 to 800	0.4	0.6	0.3	0.6	
Sensor inaccu	racies not included.					
Accuracy with	external cold junction; for intern	al junction add 0.2 °C				
Resolution: 0.1	1 °C					
Temperature S	Scale: ITS-90 or IPTS-68, select	able (90 is default)				
Compensation 8.585-2001 (R	: ITS-90 per NIST Monograph 1 ussia) for BP and XK, ASTM ES	75 for B,R,S,E,J,K,N,T; IPT 988-96 for C (W5Re/W26Re	S-68 per IEC 584-1 for B,R,S )	,E,J,K,T; IPTS-68 per DIN	43710 for L,U. GOST P	
Temperature C	Coefficient: 0.05 °C/ °C (<18 °C	or >28 °C)				
	0.07 °C/ °C for C ty	pe >1800 °C and for BP type	e >2000 °C			
Instrument Op	erating Temperature: 0 to 50 °C	for C and BP type thermoco	ouples / -10 to 50 °C for all ot	her types		
Normal Mode	Rejection: 65 dB at 50 Hz or 60	Hz nominal				
For sourcing the	For sourcing thermocouple voltages, accuracy is not specified in RF fields >1 V/m, 80 MHz to 700 MHz.					

115

Find Quality Products Online at:

www.GlobalTestSupply.com

#### 753/754

Users Manual

#### Temperature, Resistance Temperature Detectors

Temperature, RTDs Degrees or % of Reading <sup>[1]</sup>							
		N	leasure °C [2]		Source	e °C	Allowable
Туре (α)	Range °C	1 Year	2 Year	Source Current	1 Year	2 Year	Excitation Current <sup>[3]</sup>
100 Ω	-200 to 100	0.07 °C	0.14 °C	1 m A	0.05 °C	0.10 °C	0 1 to 10 mA
Pt(385)	100 to 800	0.02 % + 0.05 °C	0.04 % + 0.10 °C	TIIIA	0.0125 % + 0.04 °C	0.025 % + 0.08 °C	0.1 to 10 mA
200 Ω	-200 to 100	0.07 °C	0.14 °C	F00 A	0.10 °C	0.20 °C	0.1 to 1 mA
Pt(385)	100 to 630	0.02 % + 0.05 °C	0.04 % + 0.10 °C	500 µA	0.017 % + 0.09 °C	0.034 % + 0.18 °C	
500 Ω	-200 to 100	0.07 °C	0.14 °C	250 4	0.08 °C	0.16 °C	0.1 to 1 mA
Pt(385)	100 to 630	0.02 % + 0.05 °C	0.04 % + 0.10 °C	250 µA	0.017 % + 0.06 °C	0.034 % + 0.12 °C	
1000 Ω	-200 to 100	0.07 °C	0.14 °C	150 μA	0.06 °C	0.12 °C	0 1 to 1 mA
Pt(385)	100 to 630	0.02 % + 0.05 °C	0.04 % + 0.10 °C		0.017 % + 0.05 °C	0.034 % + 0.10 °C	0.1 to 1 mA
100 Ω	-200 to 100	0.07 °C	0.14 °C	1 m 1	0.05 °C	0.10 °C	0.1 to 10 m
Pt(3916)	100 to 630	0.02 % + 0.05 °C	0.04 % + 0.10 °C	TIIIA	0.0125 % + 0.04 °C	0.025 % + 0.08 °C	0.1 to 10 mA
100 Ω	-200 to 100	0.08 °C	0.16 °C	1 m (	0.05 °C	0.10 °C	0.1 to 10 mA
Pt(3926)	100 to 630	0.02 % + 0.06 °C	0.04 % + 0.12 °C	T IIIA	0.0125 % + 0.04 °C	0.025 % + 0.08 °C	0.1 to 10 IIIA

116

Find Quality Products Online at:

# Documenting Process Calibrator Detailed Specifications

	Temperature, RTDs						
Measure °C         Source °C							Allowable
Type (α)	Range °C	1 Year	2 Year	Source Current	1 Year	2 Year	Excitation Current <sup>[3]</sup>
10 Ω Cu(427)	-100 to 260	0.2 °C	0.4 °C	3 mA	0.2 °C	0.4 °C	1 to 10 mA
120 Ω Ni(672)	-80 to 260	0.1 °C	0.2 °C	1 mA	0.04 °C	0.08 °C	0.1 to 10 mA
<ul> <li>[1] Speci Sensi</li> <li>[2] For tv Reso Temp</li> <li>[3] Supp RTD</li> <li>Pt(38</li> <li>Pt(39</li> <li>Pt(39)</li> </ul>	fications are valid or inaccuracies no vo and three-wire lution: 0.01 °C ex perature Coefficier orts pulsed transm Reference: 5): IEC 60751, 20 16): JIS C 1604, 7 26), Cu(427), Ni(6	to k=3 ot included RTD measurements, a cept 0.1 °C for 10 Ω Cu nt: 0.01 °C/°C for meas nitters and PLCs with p 108 1981 572): Minco Application	dd 0.4 °C to the specifi (427) ure, 0.02 °C/°C (<18 °C ulse times as short as ´ Aid #18	cations. : or >28 °C) fo 1 ms	r source		
Loop Po	wer						

Open Circuit	Loaded Circuit
26 V ±10 %	18 V minimum at 22 mA
Short circuit protected to 25 mA	
Output Resistance: 250 $\Omega$ nominal	

117

Find Quality Products Online at:

**FLUKE**®

# **DPCTrack2**<sup>™</sup>

Calibration Management Software

**Users Manual** 

August 2011 © 2011 Fluke Corporation. All rights reserved. All product names are trademarks of their respective companies.

Find Quality Products Online at:

www.GlobalTestSupply.com

#### License Agreement

This software and accompanying documentation are protected by United States copyright law and also International Treaty provisions. Any use of this software in violation of copyright law or the terms of this agreement will be prosecuted fully.

DPCTrack2 is copyright © 2011 by the Fluke Corporation, all rights reserved.

Fluke authorizes you to make archival copies of this software for the sole purpose of backing up and protecting your investment from loss. Under no circumstances may you copy this software or documentation for the purposes of distribution to others. Under no conditions may you remove the copyright notices made part of the software documentation.

Fluke warrants that the software will function as described in this document or in the online help for a period of 60 days from receipt. If you encounter a bug or deficiency, we will require a problem report detailed enough to allow us to find and fix the problem. If you properly notify us of such a software problem within the warranty period, Fluke will update the defective software at no cost to you.

Fluke assumes no liability for the use of DPCTrack2 beyond the original purchase price of the software. In no event will Fluke be liable to you for additional damages, including any lost profits, lost savings, or other incidental or consequential damages arising out of the use of or inability to use these programs, even if Fluke has been advised of the possibility of such damages.

By using this software you agree to the terms of this section. If you do not agree, you should immediately return the entire DPCTrack2 package.

All Fluke product names are trademarks or registered trademarks of the Fluke Corporation. Other brand and product names are trademarks or registered trademarks of their respective holders.

# **Table of Contents**

Chapter		Title	Page
1 Intro	oduction		1-1
	1.1 Intro	oduction	1-3
2 Inst	alling	DPCTrack2	2-1
	2.1 DPC	Track2 Installation	2-3
	2.2 S	ystem Requirements	2-3
	2.3 Pi	rocedures	2-3
	2.4 L	icensing	2-3
3 Gett	ting	Started	3-1
	3.1 Start	ting the Program	3-3
	3.2 Log	ging onto the System	3-3
	3.3 Secu	rity	3-3
	3.4 Pred	efined User Groups, User IDs and Passwords	3-4
	3.5 Abo	ut the Sample Records	3-4
	3.6 Impo	ort DPCTrack Data	3-4
	3.7 Com	mon Usage Scenario	3-5
	3.7.1	Instrument Record Creation / Revision / Retirement	3-5
	3.7.2	Test Instrument Record Creation / Revision / Retirement	3-5
	3.7.3	Use of your Company's Calibration Program	3-5
	3.7.4	Upload/Download	3-5
	3.7.5	Reports	3-6
4 Hon	ne s	Screen	4-1
	4.1 Usin	g the Home Screen	4-3
	4.2 Men	u Toolbar	4-3
	4.2.1	File Menu	4-3
	4.2.2	Tools Menu	4-5
	4.2.3	Records Menu	4-8
	4.2.4	Reports Menu	4-8
	4.2.5	Lists Menu	4-8
	4.2.6	Help Menu	4-8
	4.3 Main	n Toolbar	4-9

www.GlobalTestSupply.com

i

	4.4 Navigation Toolbar	4-9
	4.5 Work Area	4-9
5	Overview of Standard Screens	5-1
	5.1 Standard Screens	
	5.2 Overview of Buttons	5-4
	5.2.1 Add New Record	5-4
	5.2.2 Save Record	5-4
	5.2.3 Copy Current Record	5-4
	5.2.4 Find Record	5-4
	5.2.5 List Records	5-4
	5.2.6 Cancel Changes	5-4
	5.2.7 Print Master Report	5-4
	5.2.8 Preview Master Report	5-4
	5.2.9 Show Work History	5-4
	5.2.10 Close Form	5-4
	5.2.11 Help	5-4
	5.3 Data Fields/Lists Menu	5-4
	5.4 File Menu	5-5
	5.5 Edit Menu	5-5
	5.6 Reports Menu	5-5
6	User Administration and Levels of Access	6-1
	6 1 Employee Record Screen	6-3
	6.1.1 General Info Tab	
	6.1.3 Force Log Off User	6-5
	6.2 User Groups Screen	6-5
	6.2.1 Group Type	6-5
	6.2.2 Members Tab	6-6
	6.2.3 Access Levels Tab	6-6
	6.2.4 Reminder Options Tab	6-7
	6.3 User Administration Screen	6-8
7 Syst	tem Options	7-1
	7.1 System Ontions	7-3
	7.1.1 Database Name	7-3
	7.2 System Settings Tab	7-4
	7.2 System Settings Tab	7-4
	7.2.1 Last Date The System Database Was Backed Up	7-4
	7.2.2 Number Of Days Between Backup Warnings	7-4
	7.2.3 Number Of Days Before User's Password Expires	7-4
	7.2.4 Number of Logons Before Disabling ("0" = Never Disable)	7-4
	7.2.5 Minimum Password Length	7-4
	7.2.6 Number Of Passwords To Remember	7-4
	7.2.7 Minimum Password Age To Allow Change (Days)	7-5
	7.2.8 Number Of Minutes Before Time-Out	7-5
	7.2.9 System Date Format	7-5
	7.2.10 System Decimal Number Format	7-5
	7.2.11 Default Skin	7-5
	7.2.12 Allow User Skin Override	7-5
	7.2.15 Warn On Overdue Test Instruments During Cal Entry	7-6

Find Quality Products Online at:

# www.GlobalTestSupply.com

ii

8	User Defined Labels	8-1
	8.1 User Defined Labels	8-3
	8.2 Column Descriptions	8-3
	8.3 Modifying Field Labels	8-4
•	Company Record Corean	0.1
9	Company Record Screen	
	9.1 Company Records	9-3
	9.2 Tabbed Notebook Section	
	9.2.1 General Info Tab.	
	9.2.1.1 Address Lines 1 & 2, City, State, Zip & Country	
	9.2.1.2 Contact, Phone & Email	
	9.2.2 Other Addresses Tab	
	9.2.3 Options Tab	
	9.2.4 Default Reports 1 ab	
	9.3 Change Company Name	9-/
10	User Defined Variables and User Defined Lists	10-1
	10.1 User Defined Options & Required Fields	
	10.2 Adding User Defined Variables	
	10.2.1 Selecting a File Type	
	10.2.2 Entering the Variable Name	
	10.2.3 Selecting the Field Data Type	
	10.2.4 Deleting a User Defined Variable	
	10.2.5 Reordering User Defined Variables	
	10.3 User Defined Lists	
	10.3.1 Creating a New List Type	
	10.3.2 Creating List Entries for New List Types	10-6
	10.4 Configuring Required Fields	10-7
11 R	eminders	11-1
	11.1 Domindara	11.2
	11.1 Reminders	11-3
	11.2 Plinting Reininders	11-4
12 St	tandard Lists	12-1
	12.1 Standard Lists	12-3
	12.2 List Screens	
	12.2.1 Calibration Frequency	
	12.2.2 Status	12-4
	12.2.3 Signal Type	
	12.2.5 Locations	12-5
	12.2.6 Department	12-5
	12.2.7 Vendors	12-6
	12.2.8 Instrument Type	12-6
	12.2.9 Responsible Technician	12-6
	12.2.10 Calibration Type	12-7
	12.2.11 Classification	12-7
	12.2.12 Document Type	12-7
	12.2.13 Equipment Type	12-8

Find Quality Products Online at:

# www.GlobalTestSupply.com

iii

13	Document Records Screen	13-1
	13.1 Document Records	.13-3
	13.2 Tabbed Notebook Section	.13-4
	13.2.1 General Info Tab	.13-4
	13.2.2 Signatures Tab	.13-5
	13.2.3 Procedure Tab	.13-5
	13.3 File Menu Options	.13-5
	13.3.1 New Record[Ctrl + N]	.13-5
	13.3.2 Save Record[Ctrl + S]	.13-5
	13.3.3 Find Record[Ctrl + F]	.13-5
	13.3.4 Print Record[ $C(r1 + P]$	12 5
	13.3.5 FIIII Fleview]	12-5
	13.3.7 Delete Record	13-5
	13.3.8 Close Form	13-6
	13.3.9 Exit DPCTrack2	.13-6
14	Equipment Record Screen	14-1
	14.1 Equipment Records	.14-3
	14.2 Tabbed Notebook Section	.14-3
	14.2.1 General Info Tab	.14-3
	14.2.2 Additional Into Tab	.14-4
	14.2.3 Instruments/Loops 1 ab	.14-4
	14.2.4 User Defined 1ab	.14-4
	14.2.5 Notes Tab.	14-5
	14.3.1 New Record[Ctrl + N]	14-5
	14.3.2 Save Record[Ctr] + S]	14-5
	14 3 3 Find Record[Ctrl + F]	14-5
	14.3.4 List Records	.14-5
	14.3.5 Delete Record	.14-5
	14.3.6 Close Form	.14-6
	14.3.7 Exit DPCTrack2	.14-6
15	Instrument Record Screen	15-1
	15.1 Instrument Records	.15-3
	15.2 Tabbed Notebook Section	.15-3
	15.2.1 General Info Tab	.15-3
	15.2.2 Calibration Points Tab	.15-5
	15.2.3 Additional Into Tab	.15-16
	15.2.4 User Defined 1ab	.15-17
	15.2.5 Notes Tab	15 17
	15.5 File Menu Opuolis	15 17
	15.5.1 New Record [Ctrl + N] $15.3.2$ Conv Record [Ctrl + N]	15 17
	15.3.2 Copy Record [Ctrl + 1]	15 - 17
	15.3.4 Find Record [Ctr] + F]	15-17
	15 3 5 List Records [Ctrl + L]	15-17
	15.3.6 Show Work History [Ctrl + K]	.15-17
	15.3.7 Delete Record	.15-17
	15.3.8 Close Form	.15-18
	15.3.9 Exit DPCTrack2	.15-18
	15.3.7 Delete Record 15.3.8 Close Form	.15-17 .15-18
	15.5.9 EXIT DPUTrack2	.13-18

iv

16	Loop Record Screen	16-1
	16.1 Loop Records	16-3
	16.2 Tabbed Notebook Section	16-3
	16.2.1 General Info Tab	16-4
	16.2.2 Calibration Points Tab	16-5
	16.2.3 Additional Info Tab	.16-5
	16.2.4 User Defined Tab	.16-6
	16.2.5 Notes Tab	.16-6
	16.3 File Menu Options	.16-6
	16.3.1 New Record[Ctrl + N]	.16-6
	16.3.2  Copy Record[Ctrl + Y]	.16-6
	16.3.3 Save Record [Ctrl + S]	.16-7
	16.3.4 Find Record Ctrl + F	.16-7
	16.3.5 List Records $\begin{bmatrix} Ctrl + L \end{bmatrix}$	.16-7
	16.3.6 Show Work History Ctrl + K]	.16-7
	16.3.7 Delete Record	.16-7
	16.3.8 Close Form	.16-7
	16.3.9 Exit DPCTrack2	.16-7
17	Test Instrument Record Screen	17-1
	17.1 Test Instrument Records	17-3
	17.2 Tabbed Notebook Section	17-3
	17.2 Tubbed Rolebook Beetion	17-3
	17.2.1 Celibration Points Tab	17-5
	17.2.2 Confidential Info Tab	17-5
	17.2.5 Additional line rue	17-5
	17.2.5 Notes Tab	17-5
	17 3 File Menu Options	17-5
	17 3 1 New Record[Ctrl + N]	17-5
	17.3.2 Copy Record[Ctrl + Y]	17-5
	17 3 3 Save Record[Ctrl + S]	17-5
	17.34 Find Record[Ctrl + F]	17-5
	17.3.5 List Records [Ctrl + L]	.17-6
	17.3.6 Show Work History[Ctr] + K]	.17-6
	17.3.7 Delete Record	.17-6
	17.3.8 Close Form	.17-6
	17.3.9 Exit DPCTrack2	.17-6
18 Up	load/Do wnload Screen	18-1
	18.1 Getting Started	.18-3
	18.2 File Menu Options	.18-4
	18.2.1 Initiate Download/Upload	.18-4
	18.2.2 Close Form	.18-4
	18.2.3 Exit DPCTrack2	.18-4
	18.3 Features	.18-4
	18.3.1 Clear Calibrator Memory	.18-4
	18.3.2 Set Calibrator Date/Time to Current Date/Time	.18-5
	18.3.3 View Number of Test Results	.18-5
	18.3.4 View/Edit Session Log	.18-5
	18.4 Lists	.18-5
	18.5 Help	.18-5
	18.6 Options	.18-5
	18.6.1 Download Options	.18-5
	18.6.2 Upload Options	.18-7

v

	18.7 Downloading Calibration Items as Tasks1	8-7
	18.7.1 Download By1	8-7
	18.7.2 Tag List Operations	8-9
	18.7.3 Tag List Edit Functions1	8-10
	18.7.4 Tag List Information Functions1	8-10
	18.7.5 Adding to the Tag List1	8-11
	18.7.6 Removing Items from the Tag List	8-11
	18.7.7 Tag Construction	8-11
	18.8 Uploading Results as Calibrations	8-12
	18.8.1 Assign Technician to Calibrations	8-12
	18.8.2 Default Calibration Type for Unloaded Calibrations	8-13
	18.8.3 Default Test Instrument Warning Ontions	8-13
	18.8.4 Initiate Unload	8-13
	18.9 Test Instrument Recognition	8-16
10.0-		0 1
19 68		9-1
	19.1 Calibration Records	9-3
	19.2 Tabbed Notebook Section	9-3
	19.2.1 Header Fields1	9-3
	19.2.2 Item Info (As of Calibration Record Entry Date)1	9-4
	19.2.3 General Calibration Info1	9-4
	19.3 Test Results Tab1	9-5
	19.3.1 Test Point Groups1	9-5
	19.3.2 Separate As Found/As Left Inputs1	9-6
	19.3.3 Modifying Calibration Specifications1	9-6
	19.3.4 Classifying the Result of a Calibration1	9-7
	19.3.5 Automatic Warnings and Messages1	9-8
	19.3.6 Warnings and Messages That May Appear as a Result of	
	Options and Default Settings1	9-9
	19.3.7 Entering Calibrations in Multi-Mode1	9-10
	19.4 Test Instruments Tab1	9-11
	19.4.1 How Instrument Types Affect the Available Test Instrument List1	9-12
	19.4.2 Show All	9-12
	19.5 SOP Tab1	9-12
	19.6 User Defined Tab1	9-12
	19.7 Notes Tab1	9-13
20	Import DPCTrack Data	20-1
	20.1 Import DPCTrack Data	20-3
	20.1.1 Field Mapping2	20-4
	20.1.2 Frequency Mapping2	20-4
	20.2 Possible Errors/Warnings	20-5
	20.3 Compatibility Limitations	20-5
	20.3.1 Limitations For Instrument Imports2	20-5
	20.3.2 Limitations For History Imports	20-5
21 Ac	vanced Queries2	21-1
	21.1 Advanced Oueries	21-3
	21.1.1 Running Previously Saved Advanced Oueries	21-3
	21.1.2 Creating New Advanced Queries and Modifying Existing Oueries	21-3
	21.1.3 Action Button Sets	21-9
	21.1.4 Navigating Between Records Included in an Advanced Ouery List 7	21-10
	21.1.5 Printing Lists and Saving Them to External Files	21-11
	21.1.6 Using Advanced Queries in Other Parts of the Program	21-11
	vi	

22 D	PCTrack	Explorer	22-1
	22 1 DPC	Track Explorer	22-3
	22.1.1	Grouping	22-4
	22.1	1.2 Pop-up Menu Options	
	22.1.3	Status Indicator Icons	
	22.1.4	Resetting the Tree	
	22.1.5	Displaying Additional Information	
23 R	eporting	System	23-1
	23.1 Rep	orts	23-3
	23.1.1	Report Parameters Tab	
	23.1.2	Advanced Selection Tab	
	23.2 Othe	er Options Available on the Reports Menu	
	23.2.1	Set Report Directory	
	23.2.2	Report Maintenance	23-6
	23.3 P	rinting	
	23.4 Setti	ing Up New Reports	
	23.4.1	Custom Reports	23-6
	23.4.2	Report Maintenance	23-7
	23.5 Add	ing New Reports from Scripts	23-9
	23.6 Dele	eting Reports	
24	The Log	ged Data Screen	
	24.1 Wha	at is Logged Data?	
	24.2 Uplo	bading Logged Data	
	24.2.1	Selecting Port	
	24.2.2	Upload Logs Button	
	24.2.3	Show Logged Data Button	24-6
	24.2.4	Log Record	
	24.3 Viev	wing Log Records	
	24.3.1	Listing Log Records	
	24.3.2 24.4 View	Navigating Log Records	
	24.4 VIEV	wing Logged Data Report	24-10
25	Backing	J Up and Restoring Data	25-1
	25.1 Bacl	king Up	25-3
	25.2 Rest	tore From Backup	
26 T	roublesho	oting	26-1
	26.1 Trou	ubleshooting - Downloading Instruments as Tasks	
	26.2 Trou	ubleshooting - Device Communication	
	26.3 Trou	ubleshooting - Uploading Results	
Арр	endix A Re	port Descriptions Listed by Groups	A-1
	Alert Gro	pup	A-1
	Calibra	ation Alert Report	A-1
	Failed	Calibrations Report	A-1
	Calibratio	on Group	A-1
	Calibra	ation Bar Code Label	A-1
	Calibra Instruction	alloll Ladel	A-1
	Instrur	nem Calibration Report (Spec Summary)	A-1 A 1
	msuu	nem Canoration Report (Spees/ 16st 10mit)	

Instrument Test Point Analysis	A-2
Instrument Test Point Trend	A-2
Loop Calibration Report (Spec Summary)	A-2
Loop Calibration Report (Specs/Test Point)	A-2
Loop Test Point Analysis	A-2
Loop Test Point Trend	A-2
Test Instrument Calibration (Spec Summary)	A-2
Test Instrument Calibration (Specs/Test Point)	A-2
Test Instrument Test Point Analysis	A-3
Test Instrument Test Point Trend	A-3
Company Group	A-3
Events Due (This Company)	A-3
Document Group	A-3
Document Report	A-3
Documents Due Report	A-3
Equipment Group	A-3
Equipment Bar Code Label	A-3
Instrument Group	A-3
Instrument Bar Code Label	A-3
Instrument Master (Snec Summary)	A-3
Instrument Master (Spece Summary)	Δ_3
Instrument Worksheet (Spees/Test Foint)	Δ_Λ
Instrument Worksheet (Spec Summary)	Δ_Λ
Instrument Due Report	Λ Λ
Inventory Group	Λ Λ
Instrument Inventory	Λ Λ
L oon Inventory	A-4
Toot Instrument Inscentory	
Legged Date Crown	A-4
Dete Lee Demot	
Lean Crown	A-4
Loop Group	
Loop Bar Code Label	
Loop Master (Spec Summary)	A-4
Loop Master (Spec/Test Point)	A-3
Loop Worksheet (Spec Summary)	A-3
Loop Worksheet (Specs/Test Point)	A-5
Loops Due Report	A-5
Test Instrument Group	A-5
Test Instrument Bar Code Label	A-5
Test Instrument Master (Spec Summary)	A-5
Test Instrument Master (Specs/Test Point)	A-5
Test Instrument Reverse Traceability	A-5
Test Instrument Worksheet (Spec Summary)	A-5
Test Instrument Worksheet (Specs/Test Point)	A-5
Test Instrument Due Report	A-6
User Group	A-6
Active Users Report	A-6
Security Log Report	A-6
Appendix B Frequently Asked Questions	B-1
Frequently Asked Questions List	B-1

viii

# Chapter 1 Introduction

	Title	Page
1.1	Introduction	1-3

# **1.1 Introduction**

This manual has been designed to fit the way users say they work. It is set up logically, focusing on different areas of the program in the order that they will most likely be used. The emphasis is on getting the job done in the easiest and most efficient way possible. This manual was also written under the assumption that the DPCTrack2 program being used is a **full** program, including all calibration and system security features. In addition, it is assumed that the reader has been given access to all areas of the program, however, this may not be the case. If you notice that the company name, menu items, speed buttons, screen options, etc. are grayed out, either the program you purchased did not include those features or your User ID has not been granted access to those areas of the program.

The initial content of this manual will provide you with an overview of how to get started with the software installation instructions, logon procedures and standard screen features. All screens have a uniform look with similar speed buttons and menus, making it easy for you to adapt to the system quickly.

Each subsequent chapter individually addresses one of the program's screens or major functions. In each of these chapters you will find a full description and explanation of the screens features, as well as detailed, hands-on operating instructions.

The online help system included with DPCTrack2 is full of useful information, similar to that provided in this manual. It is available at all times when using the program, either by accessing the Help menu, left-clicking the speed buttons labeled as such, or by pressing the "F1" key.

# Chapter 2 Installing DPCTrack2

### Title

# Page

2.1	DPCTrack2 Installation	
2.2	System Requirements	
2.3	Procedures	
2.4	Licensing	
	6	

# 2.1 DPCTrack2 Installation

### 2.2 System Requirements

To use the DPCTrack2, it is recommended that you have the following hardware and software:

- A Pentium class 667 MHz or higher computer with a minimum of 256 MB of RAM (512 MB or more recommended)
- Windows XP or later operating system versions
- A hard disk with at least 500 MB of free space

### 2.3 Procedures

Single-User License:

• Insert the DPCTrack2 CD into your computer's CD-ROM drive. If the program does not autostart, Run "setup.exe". Follow the prompts on your screen to complete installation.

### 2.4 Licensing

The first time you run DPCTrack2 you will see the "DPCTrack2 Licensing" screen with three options. See Figure 2.1 below.

**Start Trial**: This will allow you to enter DPCTrack2 for the first 60 days of use without further action. After 60 days, all features of the DPCtrack2 System except those to Upload, Download & View the Logs will be restricted. Your trial program comes pre-configured with sample data organized under a company called "Fluke Customer". If you wish to change this default name you may do so when you start your trial. See Figure 2.2

**Register:** Registering the trial will enable you to receive sales support during the evaluation process. Customers are given the option to register at the following times:

- During the 1<sup>st</sup> run when they select to run a Trial (instead of Activate)
- Every time a Trial expiration warning is shown (if they have not already registered)
- Through a menu option Help $\rightarrow$  Register Now (if they have not already registered)

The registration process is identical, regardless of when the option is selected. The customer is prompted to enter their basic information – Company, First Name, Last Name, email & Phone

Activate: Upon selecting Activate you will be prompted for a POP # and other information for verification. This data is sent for confirmation and used to generate an Activation Code which will be sent to you for entry it into the DPCTrack2 System.



Figure 2.1

DPCTrack 2.0 Licensing			
Your trial program comes pre-configured with samp "Fluke Customer". If you wish to change this defa If you choose not to update the name now it can to Tools Menu> Change Company Name. Note: The Company Name change does not take a Fluke Customer	ole data organize ult name you ma be done at any ti affect until after	d under a Comp y enter a new v me from: login,	pany called value below,
	Back	Finish	X Cancel

Figure 2.2

2-4

# www.GlobalTestSupply.com
Notes

• The installation directory [INSTALLDIR] defaults to: "C:\DPCTrack2". This can be overridden during the installation

process.

• The data directory [DATADIR] defaults to:

"C:\DPCTrack2\Data". This can also be overridden during the installation process. The data directory can be on a shared network storage device but only this version of DPCTrack2 that is currently being installed will be able to access it.

# Chapter 3 Getting Started

## Title

## Page

3.1	Starting the Program	3-3
3.2	Logging Onto the System	3-3
3.3	Security	3-3
3.4	Predefined User Groups, User IDs and Passwords	3-4
3.5	About the Sample Records	3-4
3.6	Import DPC/Track Data	3-4
3.7	Common Usage Scenario	3-5
3.7.1	Instrument Record Creation / Revision / Retirement	3-5
3.7.1.1	Creating Instrument Records in DPCTrack2	3-5
3.7.1.2	Revising a Master Record	3-5
3.7.1.3	Retiring an Instrument	3-5
3.7.2	Test Instrument Record Creation / Revision / Retirement	3-5
3.7.3.	Use of your Company's Calibration Program	3-5
3.7.4	Upload/Download	3-5
3.7.4.1	Downloading Tasks	3-6
3.7.4.2	Uploading Results	3-6
3.7.5	Reports	3-6

## 3.1 Starting the Program

To start DPCTRACK2, double-click on the **DPCTrack2** icon located in the **DPCTrack2** Group. (Multiple instances of DPCTrack2 may not be run concurrently on the same machine.)

## 3.2 Logging onto the System

Upon starting DPCTrack2, you will receive a login screen. Login the first time using the default Admin credentials given below in the Admin user group description section. The first time you log on, you will be prompted to change the default password to one of your own choosing.

DPCTrack2 is password protected, so every time you want to use the system, you will have to enter your "User ID" and "Password". Both the User ID and Password may be any combination of letters or numbers, although there may be a minimum password length required, depending on your System settings. (See Chapter 7 SYSTEM OPTIONS, for details regarding minimum password length.) Also both the User ID and Passwords are **not** Case Sensitive. Figure 3.1 shown below, is the screen you will see every time you log onto DPCTrack2.

×
-
-1
cel

Figure 3.1

## 3.3 Security

As a measure to prevent unauthorized individuals from gaining access to your records, DPCTrack2 offers a security feature whereby the administrator may set the number of times an unsuccessful logon can occur before disabling a User ID. This value is set in the SYSTEM OPTIONS screen which is available from the **File** menu at the top left of your HOME screen (see Chapter 7 for details). An unsuccessful logon occurs when a user enters an incorrect password for their User ID. When the maximum number of unsuccessful logons is reached, DPCTrack2 will automatically disable the user, thus denying them access to the system. When this occurs, only a User that is a member of the "ADMIN" group can re-enable the User ID. See Chapter 6 for more information on how to re-enable a user.

## www.GlobalTestSupply.com

## sales@GlobalTestSupply.com

## 3.4 Predefined User Groups, User IDs and Passwords

DPCTRACK2 includes three (3) predefined User Access Groups with Users assigned to them and one (1) Technician Group with one Technician assigned. The predefined User Groups are: ADMIN, USER, and READONLY. The Technician Group is TECH. All DPC/Track users must be assigned to one of the predefined User Access Groups.

The following is a list of the pre-defined User Groups and their descriptions:

Admin

The Admin (Administrator) has full access to all areas of DPCTrack2. Most notably, the Admin has the ability to perform administrative responsibilities, such as modifying system options, backing up data, adding technicians and other users, adding user defined variables, deleting data, among other tasks. Typically, only one person should serve as the Admin of the DPCTrack2 program. The User ID and default password for the Admin User group is *Admin/Admin*.

User

The access rights of the User differ from those of the Admin in that a User cannot perform administrative tasks. The User has the ability to approve changes, add or modify records, download and upload tasks to the calibrator and view logged data. The User ID and default password for the User User Group is User/User.

#### Read Only

The access rights of the READONLY user are further restricted than those of the User in that existing data may only be read. However, READONLY user may download and upload tasks to the calibrator for the purpose of generating Test Results records. The User ID and default password for READONLY User Group is READONLY/READONLY.

Technician

There are no access rights for the Technician. The Technician is there for display purposes only e.g. for *Who Calibrated* or *Responsible Technician*. There is no User ID or password for the Technician.

## 3.5 About the Sample Records

DPCTrack2 includes a number of sample records intended to help you learn the operations and features of the program. After becoming familiar with DPCTrack2, you may want to delete the sample records so as not to interfere with your "real" data. (The sample records could potentially be included within your reports and data analysis.)

## 3.6 Import DPC/Track Data

This will allow users to Import DPC/Track data (Instruments, History and Procedures) into the database. See Chapter 04 Home screen, subsection 4.2.2 Tools Menu.

3-4

## 3.7 Common Usage Scenario

This scenario applies to the activities performed by personnel supporting the DPCTrack2 database such as for instrument calibrations maintained in the DPCTrack2 database and/or instrument creation/revision/retirement.

## 3.7.1 Instrument Record Creation / Revision / Retirement

Instrument Records may be created or revised in DPCTrack2 for an instrument when it is determined that its calibration information will be maintained in the DPCTrack2 database. For existing DPC/Track clients you may move your DPC/Track data to the new DPCTrack2 database. See Chapter 20 of the User Manuals for information about importing your data.

## 3.7.1.1 Creating Instrument Records in DPCTrack2

The Administrator or User will select the "Instruments" button and open the "Instrument Record" screen, and select "Add New Record" icon to create a new Instrument Record in DPCTrack2 and "Approve" the record. When setting up the calibration points for an instrument, select the "Show DPC Settings" to allow you to configure your Source Mode and Measure Mode. This provides the compatibility between the signal type and the Source Mode and Measure Mode

## 3.7.1.2 Revising a Master Record

To revise a Master record, , the Administrator or User will access the Master Record Data Instrument Record, Loop Record, and/or Test Instrument Record), edit and save the master record data.

### 3.7.1.3 Retiring an Instrument

To retire an instrument, the Administrator or User or will access the Instrument Record; change the status to your Company's retired status and save the master instrument record data.

## 3.7.2 Test Instrument Record Creation / Revision / Retirement

DPCTrack2 stores data for Test Instruments separately. The Administrator or User will select the "Test Instruments" button and open the "Test Instrument Record" screen, and select "Add New Record" icon to create a new Test Instrument Record in DPCTrack2 and "Approve" the record. Test Instrument records may be associated with a calibration record for certification and verification purposes. Calibration records will always retain the Test Instrument assigned regardless of the Test Instrument's status, therefore it is recommended that you do not delete Test Instrument records.

## 3.7.3. Use of your Company's Calibration Program

The Administrator or User will select "Reports" "Company" "Events Due (This Company)" from the Home screen to generate an Events Due Report from DPCTrack2 to determine the monthly list of instruments due for calibration for the upcoming month.

### 3.7.4 Upload/Download

The Upload/Download screen is used for calibrator communication. The Administrator or User will select the "Upload/Download" button to open the "Upload/Download" screen. Tasks can be downloaded to the calibrator and Test Results can be uploaded from the calibrator to the DPCTrack2 database. During any Download or Upload operation, the Options screen allows default values to be set for tasks or results created.

Additionally, calibration records are created when results are uploaded and authorized. DPCTrack2 also associates the calibration record with the appropriate instrument record. See Chapter 18 for more Upload/Download details.

## **Find Quality Products Online at:**

## www.GlobalTestSupply.com

## sales@GlobalTestSupply.com

3-5

## 3.7.4.1 Downloading Tasks

There are several methods to choose from to generate a list of Tags to download. Before initiating the download, connect the calibrator to the serial port and turn the calibrator on. Your calibrator information should display in the "Calibrator Info" section of the Upload/Download screen. If the information is not displayed, click the Refresh button. See Figure 3.2. Select the tags you wish to download and then select the "Initiate Download" button. After the download process is complete, perform the test with the calibrator.



### 3.7.4.2 Uploading Results

To Upload results to DPCTrack2, make sure the calibrator is connected and powered on, then select the "Initiate Upload" button. You will be required to authorize the results before they will be added to DPCTrack2.

## 3.7.5 Reports

After uploading the test results, you can then view your results within DPCTrack2. To review your results, select the Reports menu in the Home Screen or view the Calibration record for the instrument by selecting the Calibration button and selecting the instrument you wish to preview.

www.GlobalTestSupply.com

sales@GlobalTestSupply.com

# Chapter 4 Home Screen

## Title

## Page

4.1	Using the Home Screen	4-3
4.2	Menu Toolbar	
4.2.1	File Menu	
4.2.1.1	User Logon	
4.2.1.1	User Logoff	
4.2.1.2	Change Password	
4.2.1.3	Change User	
4.2.1.4	User Administration	
4.2.1.5	Employee Records	
4.2.1.6	Group Records	
4.2.1.7	System Options	
4.2.1.8	Exit DPCTrack2	
4.2.2	Tools Menu	
4.2.2.1	Backup Database	
4.2.2.2	User Defined Variables	
4.2.2.3	User Defined Labels	
4.2.2.4	User Defined Lists	
4.2.2.5	Required Fields	
4.2.2.6	Change Company Name	
4.2.2.7	Import DPCTrack Data	
4.2.3	Records Menu	
4.2.4	Reports Menu	
4.2.5	Lists Menu	
4.2.6	Help Menu	
4.3	Main Toolbar	
4.4	Navigation Toolbar	
4.5	Work Area	

## 4.1 Using the Home Screen

Figure 4.1 below, is the system's HOME SCREEN. This is the main screen you work from when you are using DPCTrack2. It has the buttons and menu items used to activate every other branch and/or function of the system. Keep in mind that the buttons and menu items that are available to a user at any given time are strictly dependent upon the level of system access that they have been granted. An overview of this screen's sections is provided below. However, for more detailed information on any of the items mentioned, please refer to the pages dedicated to those topics in the other sections of this manual.



Figure 4.1

## 4.2 Menu Toolbar

The menu toolbar contains six (6) menus, File, Tools, Records, Reports, Lists, and Help, each of which enables you to perform a number of different actions or functions related to the system.

### 4.2.1 File Menu

Opening the **File** menu when the HOME SCREEN is displayed provides you with the following options: (See Figure 4.2 below)

## 4.2.1.1 User Logon

This option will be grayed out unless there is not a User logged on. If there is no User logged on this option and Exit DPCTrack2 will be the only accessible choices. Selecting this option with no User logged on, will bring up the DPCTrack2 logon screen.

### 4.2.1.1 User Logoff

This will logoff the current user but will not close DPCTrack2

## 4.2.1.2 Change Password

This will open a new screen requiring the current user to change their password

### 4.2.1.3 Change User

This will logoff the current user but will not close DPCTrack2

## 4.2.1.4 User Administration

This screen allows the user to add Employees, Copy an employee record, View a selected Group or Employee record, (This is covered in depth in Chapter 6)

### 4.2.1.5 Employee Records

This screen allows the user to view, add or change employee records. (This is covered in depth in Chapter 6)

## 4.2.1.6 Group Records

This screen allows the user to add/delete members for groups, the levels of access for each group and reminder options. (This is covered in depth in Chapter 6)

## 4.2.1.7 System Options

This screen allows the user to change or modify options that are system wide. (This is covered in depth in Chapter 7)

## 4.2.1.8 Exit DPCTrack2

This will logoff the current user and close DPCTrack2



4-4

# www.GlobalTestSupply.com

## sales@GlobalTestSupply.com

## 4.2.2 Tools Menu

The Tools menu (See Figure 4.3 above) provides a drop down with the following:

## 4.2.2.1 Backup Database

This is a shortcut to the Backup utility (See Chapter 25)

### 4.2.2.2 User Defined Variables

This screen allows users to create, modify and delete fields that will be displayed in the appropriate User Defined tabs on the Item screens (See Chapter 10)

## 4.2.2.3 User Defined Labels

This is a shortcut to the User Labels Definition screen where users can view and edit Labels (See Chapter 8)

#### 4.2.2.4 User Defined Lists

This screen allows the user to add, modify and delete User Defined Lists (See Chapter 10)

## 4.2.2.5 Required Fields

This screen allows you to set Fields that must be filled in before a Record can be Approved or a Calibration can be Finalized.

#### 4.2.2.6 Change Company Name

This screen allows users that are in the "ADMIN" Group to change the Company name.

## 4.2.2.7 Import DPCTrack Data

This will allow users to Import DPC/Track data (Instruments, History and Procedures) into the database.

E DPC Track Legacy Data Import	-BX
History File Location	
	🕞 Find
Instrument File Location	
	🕒 Find
Procedure File Location	
	- Finu
Migration Log File Location	
C:\DPCTrack2\Logs\Conversion_Log_31MAY2011_130039.log	Change
Field Mapping	
Set Instruments "Status" to Map "Hesponsible" to Active Besponsible Technician	
Map "I costice" to Map "Area" to	
Location Building	
Interval Unit Interval Value Resultant Frequency	
Click Here to	
Retrieve Frequencies	
and Attempt	
? Help     ✓ Validate Files     ✓ Initiate Import	

Figure 4.4

## 4.2.2.7.1 File Location

Before you start the Import process, it is recommended that you perform a Backup of your DPCTrack2 database, (refer to Section 4.2.2.1 above) and an Export of your Instruments, History & Procedures in DPC/Track to make sure that you have the most up to date records. Refer to the DPC/Track User Manual for more information. If you know the location for the files you can type the path or select the "Find" button. Select the following files:

History – hist_out.asc	Instrument – inst_out.asc	Procedure – proc_out.asc

You may also change the location of the Log file, (it will default to the same location that the executable resides.)

# www.GlobalTestSupply.com

**Find Quality Products Online at:** 

#### 4.2.2.7.2 Field Mapping

The "Field Mapping" section allows you to set the "Status". The dropdown will contain a list of existing Statuses in the system.

The screen allows you to map the Location, Responsible & Area fields of DPC/Track to new or different fields in DPCTrack2. The "Frequency Mapping" section allows you to attempt to map your frequencies from DPC/Track format to DPCTrack2 format.

#### 4.2.2.7.3 Validate Files

The "Validate Files" button will check that the files have the right extension.

#### 4.2.2.7.4 Initiate Import

After you have mapped all areas and validated the file extensions, you can then select the "Initiate Import" button. You will receive a confirm message first. The "Field Mapping" section will be replaced with a "Results" section. See figure 4.5 below.

🝰 DPC Track Legacy Data Import	_ PX
History File Location	
C:\DPCTRACK\DATA\hist_out.asc	🗁 Find
Instrument File Location	
C:\DPCTRACK\DATA\inst_out.asc	🗁 Find
Procedure File Location	
C:\DPCTRACK\DATA\proc_out.asc	🗁 Find
Migration Log File Logation	
C:\Program Files\Fluke\DPCTrack 2.0\Conversion_Log_07APR2011_094150.log	🗁 Change
Energy Conversion Started on 07-Apr-2011 09:40:32	~
Las File: C/Researce File/El/the/DBCTrack 2.0/Conversion Las 07ABB2011_09EC14 las	
Log File. C. YFIOgrafin Files YFIOKENDE'C Hack 2.0 (Conversion_Log_0/AFN2011_060614.log	
Migrating History from Source file: C:\DPCTRACK\DATA\hist_out.asc	
ERROR: Instrument SAMPLETAG1 does not exist in your database. Cannot migrate History.	
Conversion Completed on 07-Apr-2011 09:40:32	
Summary	
1 Total Records Processed	
	<u>×</u>
Processing 0 of 1 History Rec	ords
Inst12345	
7 <u>H</u> elp   ✓ Validate Files   ✓ Initiate Import	Close

Figure 4.5

# www.GlobalTestSupply.com

## sales@GlobalTestSupply.com

## 4.2.3 Records Menu

The **Records** menu provides you with access to the main screens that also may be accessed through the Records Toolbar. See Figure 4.6 below.

	Reports Lists Help	Lists Help	
	Report Maintenance	Refresh Reminders	
	Set Report Directory	Calibration Frequency	
		Status	
Records Reports Lists He	Alert	Signal Type	
Company	Calibration	Manufacturer	
Instruments	Company 🕨	Locations	
Leene	Document 🕨	Department	
Loops	Equipment 🕨	Vendors	
Equipment	Instrument	Instrument Type	Help
lest Instruments	Inventory •	Responsible Technician	Contents
Calibrations	Loop	Calibration Type	About
Documents	Loop	Classification	Register Trial
Upload/Download	Test Instrument	Document Type	Ashively Deserves
Logged Data	User	Equipment Type	Activate Program



Figure 4.7

Figure 4.8

Figure 4.9

## 4.2.4 Reports Menu

The **Reports** menu (See Figure 4.7) provides you with access to all areas of the program's Reporting System, including all standard reports and the REPORT MAINTENANCE SCREEN, which is used to add new reports to the system. The Set Report Directory allows the user to change which directory to retrieve the reports from (See Chapter 23).

### 4.2.5 Lists Menu

The Lists Menu (See Figure 4.8) allows the user to add, modify and delete the user defined lists. (See Chapter 10) The Refresh Reminders tab is a shortcut to the reminders screen and will refresh the reminder screen (See Chapter 11)

## 4.2.6 Help Menu

The **Help** menu activates the program's online help system or displays the "About" box, which will give you specific details regarding the DPCTrack2 system you are working with. (Note: Online Help can also be accessed by pressing the "F1" key on your keyboard.) See Figure 4.9

4-8

## 4.3 Main Toolbar

The Main Toolbar, found at the top of your HOME SCREEN contains the company. This toolbar also contains two (2) action buttons, which provide quick access to View Reminders or the DPCTrack Explorer.

- View Reminders Selecting this button will open the Reminders screen. The information provided, depends on your group associations and the reminder options selected for each group. For more information on Reminders see Chapter 11.
- DPCTrack Explorer The DPCTrack Explorer adds a pane to the side of the HOME SCREEN that enables you to quickly view all of the company's records, as well as their relationships to one another. See Chapter 22 for more on the DPCTrack Explorer.

## 4.4 Navigation Toolbar

The Record Toolbar, found at the left of your HOME SCREEN, contains eight (8) buttons, which provide quick access to the various screens in the system. Each button gives you access to one of the following screens:

- Company Record: For a more detailed explanation see Chapter 9
- Master Instrument Record: For a more detailed explanation see Chapter 15
- Loop Record: For a more detailed explanation see Chapter 16
- Equipment Record: For a more detailed explanation see Chapter 14
- Test Instrument Record: For a more detailed explanation see Chapter 17
- Calibrations: For a more detailed explanation see Chapter 19
- Document Records: For a more detailed explanation see Chapter 13
- Upload/Download: For a more detailed explanation see Chapter 18
- Logged Data: For a more detailed explanation see Chapter 24

Right-clicking anywhere on this toolbar allows you to Show or Hide the button captions to allow more room in the Work Area, and also gives you access to change the "Skin" or appearance of the application.

See Chapter 7 for more information on options involved in setting application skins.

## 4.5 Work Area

This is the large section of the HOME SCREEN with the DPCTrack2 background (see Figure 4.1 on the first page of this section). When you invoke any of the screens by clicking the appropriate speed button, it will be displayed in this area. Since DPCTrack2 is a Windows® based program, you can open more than one screen at a time and minimize or maximize them according to your needs. This part of the HOME SCREEN also displays the name and User ID of the program's current user. You may change the background or logo image on your DPCTrack2 clients by replacing the "background.jpg" located in your DPCTrack2 installation directory.

## www.GlobalTestSupply.com

## sales@GlobalTestSupply.com

# Chapter 5 Overview of Standard Screens

## Title

## Page

5.1	Standard Screens	5-3
5.2	Overview of Buttons	5-4
5.2.1	Add New Record	5-4
5.2.2	Save Record	5-4
5.2.3	Copy Current Record	5-4
5.2.4	Find Record	5-4
5.2.5	List Records	5-4
5.2.6	Cancel Changes	5-4
5.2.7	Print Master Report	5-4
5.2.8	Preview Master Report	5-4
5.2.9	Show Work History	5-4
5.2.10	Close Form	5-4
5.2.11	Help	5-4
5.3	Data Fields/Lists Menu	5-4
5.4	File Menu	5-5
5.5	Edit Menu	5-5
5.6	Reports Menu	5-5

## 5.1 Standard Screens

Each of the eight (8) screens available from the HOME SCREEN'S Navigation **Toolbar** has similar features. This enables you to quickly become familiar with DPCTrack2. With a single click of the mouse, you can easily move in and out of different records, preview reports, print reports, save records, add new ones and access the program's help system. The screen shown below is the MASTER INSTRUMENT RECORD. It is typical of every other standard screen.

This screen's sub-category **Toolbar** contains fifteen (15) different action buttons, although some screens in the program may not contain all of these if they are not applicable. In addition, the **Toolbar** also has an *Advanced Query Name* field with buttons providing quick access to the ADVANCED QUERY SCREEN and queries that have been saved in the system. You may view each button's function by slowly moving the mouse along the **Toolbar**. As you do this, each button's function will be displayed in a yellow hint box. To use an action button, click it with your mouse. Each button and its function are illustrated in Figure 5.1 shown below. The Master Instrument Record screen is used for this demonstration.

All screens that have Listing and/or Querying capabilities will have a **Status Bar** added to the form to display various information about the selection and positioning in the List. Screens with List capability will include a **Status Bar** item with a ticker showing record N of M where M is the number of records in the current list and N is the current records position. Screens with Advanced Query capabilities will include a **Status Bar** item with the name of the current Query. If the current Query is not named then the Selection Criteria will be displayed.



Figure 5.1

# www.GlobalTestSupply.com

## sales@GlobalTestSupply.com

## 5.2 Overview of Buttons

## 5.2.1 Add New Record

This button will create a new Record. If you have made any changes, you will be prompted to save your work.

#### 5.2.2 Save Record

This button will Save any changes you have made to the record.

#### 5.2.3 Copy Current Record

This button will create a Copy of the current record. All fields will be copied except: ID, Serial Number, First & Last Cal dates, Approved by, Notes and any User Defined Signatures

#### 5.2.4 Find Record

This button will invoke a new screen where the user can find a record by either entering the ID or Serial Number. The user can either enter the full value or a partial value. If a partial value is entered, a list of possible matches will be displayed and the Current Query will reflect the value entered into the search.

### 5.2.5 List Records

This button will list all master records for that item type. Right clicking on the list will give the user options to export or print.

#### 5.2.6 Cancel Changes

This button will Cancel all changes made to the record since the last save.

#### 5.2.7 Print Master Report

This button will print the master report.

#### 5.2.8 Preview Master Report

This button will create a preview of the master report.

## 5.2.9 Show Work History

This button will open a new screen that will display all the work history (if the record has no history, the screen will not open). Double clicking on a listed record will open that record.

## 5.2.10 Close Form

This button will close the current screen. If you have unsaved changes, you will be prompted to save them.

#### 5.2.11 Help

This button will open the Help screen.

## 5.3 Data Fields/Lists Menu

If a data field has a drop-down list located to its right, then the selections available for that field must be chosen from that list. All of the drop-down lists may be populated by entering information for those fields in the **Lists** menu at the top of the screen. Throughout the program, if a field has a <u>New</u> button next to it, you may add new entries to its drop-down list just by clicking the button with your mouse. Data fields that do not have a corresponding drop-down list are text fields into which anything may be typed.

#### Note

DPCTrack2 offers a "quick-typing" feature that enables you to insert a selection from a drop-down list by typing the first few letters. Using this feature is a convenient way to save time when entering data.

## 5.4 File Menu

When a standard screen is open, the **File** menu changes to offer you similar options to that of the sub-category **Toolbar** shown in Figure 5.1 on the previous page. For example, from the **File** menu on the Instrument screen you may select from the following choices: "New Record", "Copy Record", "Save Record", "Find Record", "List Records", "Show Work History", "Delete Record", "Close Form" and "Exit DPCTrack2.

(Depending on the user's access level, some options will be grayed out and not accessible)

## 5.5 Edit Menu

When a standard screen is open, the **Edit** menu provides you with "Cut", "Copy" and "Paste" functions to be used either within the same record or between records. In addition, this menu gives you the ability to modify the field labels on the particular screen that is open (see Chapter 8 for details regarding "User Defined Labels"). There is an option to "Check Requirements", this will show any fields that still need to be populated before the record can be Approved. This menu also contains two commands titled "Insert Before Current Test Point" and "Delete Current Test Point". Both of these are for use within the *Calibration Points* tab of any screen that allows for entry of calibration specifications. These will be discussed in more detail later in this manual. **Note:** If the item has no calibration points these selections will be grayed out and not available. The menu contains commands titled "Copy Current Test Point Group" which is available only if the current record is currently displaying a test point group in the Calibration Points tab. Finally, the "Load Test Point Group From Item" command gives another method of adding a test point group. These final four items will be discussed in more detail later in this manual.

## 5.6 Reports Menu

When a standard screen is open, the Reports menu provides you with the ability to print and/or preview several different reports applicable to the particular record you are currently working in. See Chapter 24 for more information.

# Chapter 6 User Administration and Levels of Access

## Title

## Page

6.1	Employee Record Screen	
6.1.1	General Info Tab	
6.1.1.1	Password Activation/Expiry	
6.1.1.2	Additional Info	
6.1.1.3	Administration Privileges	
6.1.2	Group Membership Tab	
6.1.3	Force Log Off User	
6.2	User Groups Screen	
6.2.1	Group Type	
6.2.2	Members Tab	
6.2.3	Access Levels Tab	
6.2.3.1	Customized Record Access	
6.2.4	Reminder Options Tab	
6.3	User Administration Screen	

## 6.1 Employee Record Screen

DPCTrack2 is equipped to handle multiple users. The EMPLOYEE RECORD screen is accessed from the **File** menu at the top left corner of the Home Screen. This screen (Figure 6.1 below) is used to create employee records for users of the system. Once an employee record has been established, it may then be assigned to one or more User Groups. Access to the database is controlled at the Group level. Therefore, a user's level of access is dependent upon the User Group(s) that he/she has been assigned to.

There is no limit to the number of employee records that may be added to the system

Note

\_ B X Employee Record 🗅 🖶 🔎 🕒 🗙 📳 🕐 General Info Group Membership Employee Number Name Administrato User ID Activation Date Expiration Date ADMIN 01/21/2011 02/20/2013 🔇 Reset Password 🕀 Disable User Associated Vendor Title • Phone Fax Emai Entered Bu Modified Bu Administrator Administrator Last Modified Date Entered

DPCTrack2 does not allow for the addition of User Groups.

Figure 6.1

## 6.1.1 General Info Tab

This tab is used to record general information about the employee. The *Name* and *User ID* are required fields. Every individual using the system must have their own unique ID since it is required as part of the logon procedure. A user's ID may be any combination of letters or numbers. The user's full name should also be entered in the appropriate field, as it is used in tracking modification history and approvals throughout the system. There is a limit of 50 characters for each of these fields.

When a new employee record is added, the person entering the record must assign the user a password that the user will be forced to change when they log on for the first time. The initial password must be entered into both the *New password* and *New password* confirmation fields on this screen. There is a limit of 20 characters for each of these fields.

## 6.1.1.1 Password Activation/Expiry

The *Activation Date* is the date a user's current password became effective and the *Password Expires On* field shows the date that the user's password will expire. This date is determined by the system in accordance with the value entered into the field for *Number Of Days Before User's Password Expires* in the SYSTEM OPTIONS screen. (See Chapter 7) However, the password expiration date may be manually set if it should differ from the default expiration date. When a user's password has expired, they will be informed of this the next time they log onto the system, at which time they will be prompted to create a new password.

You can force a user to change their password at any time by left-clicking the <u>Reset</u> <u>Password</u> button on their employee record. Performing this action will result in the two password fields appearing on the screen again so that an, initial, one-time use, logon password can be assigned.

Left-clicking the <u>Disable/Enable User</u> button allows you to disable or enable users at any time. Disabling a user restricts them from logging on to the system. The system may also disable a user if they have exceeded the allowed number of unsuccessful logons. (The # *of Logons Before Disabling* value is set in the SYSTEM OPTIONS screen, Chapter 7) If a user's ID has been disabled then the button on this screen will read <u>Enable User</u>. If a user's ID is currently enabled, the button will read <u>Disable User</u>.

### 6.1.1.2 Additional Info

The *Title, Phone, Fax* and *Email Address* fields are available so that you may record additional information about the employee. There is a limit of 50 characters for each of these fields. They are not required fields, but this information can be useful when working in other areas of the program. In addition, you may associate an employee with a vendor by making a selection from the *Associated Vendor* drop-down list. The vendor names that appear on this list will be all vendors that have already been added to the system through the "Vendors" option on the **Lists** menu. See Chapter 12 for more information.

### 6.1.1.3 Administration Privileges

Finally, users of DPCTrack2 can be considered "System Administrators". Any Employee that is a member of the ADMIN Group will have System Administrators rights.

6-4

#### 6.1.2 Group Membership Tab

This tab (shown in Figure 6.2) is used to assign the employee to one or more user groups that have already been established. You may move groups back and forth between the two boxes by using the center arrow buttons. All of the groups that currently exist in the system will be listed by their group ID and description in the *Available Groups* box. You may assign the employee to a group, by highlighting the desired group(s) and clicking the <u>Move Selected</u> button. This will move the selected group(s) to the *Groups This Person Is A Member Of* box, creating the assignment.

🕶 Employee Record	_ øx
General Info Group Membership	
Available Groups	Groups this Person is a member of
User : User Group Read Only : Read Only Group Tech : Technician Group	ADMIN : Default administrator group

Figure 6.2

#### 6.1.3 Force Log Off User

There may be instances when you will need to force another user's ID off the system. This can be accomplished by performing the following actions. (Keep in mind however, that you may only log off another user if you are in the ADMIN Group.)

While in the Home Screen, select "Employee Records" from **File** menu. Once you are in the EMPLOYEE RECORD screen, open the record of the employee whose ID needs to be logged off and select "Force Log Off User" from the **File** menu. A message will appear on the screen confirming that the user has been successfully logged off the system.

## 6.2 User Groups Screen

Access to DPCTrack2 is controlled via User Groups which individuals are assigned to. The USER GROUPS screen may be accessed by selecting "Group Record" from the **File** menu while the Home Screen is open.

#### 6.2.1 Group Type

User groups must be one of two types- "User Access" or "Technician". If you are viewing the *Technician* Group, the *Access Levels* and *Reminder Options* tabs disappear from the screen, thus limiting you to only selecting members for the group. Assigning an employee to a "Technician" group does not give them any access to DPCTrack2. It

## Find Quality Products Online at:

means that their name will appear on drop-down lists for fields like *Who Calibrated* and *Responsible Technician* found on various screens throughout the program. For an employee to have the ability to log onto DPCTrack2, they must also be assigned to at least one "User Access" group.

If you are viewing one of the *User Access* Groups, the *Access Levels* and *Reminder Options* tabs will remain on the screen, enabling you to variably set the group's access to records, system options, etc. All employees who have been assigned to a "User Access" group will have access to the program.

#### 6.2.2 Members Tab

On the *Members* tab on the USER GROUPS screen you will find the names of all employees who have records in the system and will be listed in the *Available Users* box. You may move employee names back and forth between the two boxes by using the center arrow buttons. For example, to assign employees to the group, highlight them with your mouse and click the <u>Move Selected</u> button (>). To assign all employees at once, click the <u>Move All</u> button (>>).

### 6.2.3 Access Levels Tab

This tab (shown in Figure 6.4) is used to configure the user group's level of access to many different system functions, options and record types. Check marks may be placed in the boxes for those items that the group should have access to. When a user's group is not allowed access to particular areas of the program, then all buttons, menu items and/or screen items directly associated with those areas will be grayed out and inaccessible to the users who belong to that group.

### 6.2.3.1 Customized Record Access

The *Customized Record Access* section of the screen contains drop-down lists for every record type in the program. See figure 6.4. You may determine the group's access to all record types by making selections from the drop-down lists.

- No Access- Means that the entire screen will be inaccessible to the users.
- **Read Only-** Will allow users to view the data, but they will not be able to manipulate it in any way.
- Add/Modify- Will allow the group's members to add and modify records of that type.
- Delete- Will allow them to add, modify and delete records of that type.
- **Modify Finalized-** Will allow the user to modify calibration records that have been finalized.
- **Delete Finalized-** Will allow the user to delete calibration records that have been finalized.

6-6



Figure 6.4

## 6.2.4 Reminder Options Tab

This tab (shown in Figure 6.5) is used to determine when and what reminders will appear on the screen when a member of the current group is logged onto the system. Place check marks in the boxes that you which to receive reminders for. You can configure the REMINDERS screen to automatically appear *At Startup*. To select this option, place a check mark in the box.



Figure 6.5

# www.GlobalTestSupply.com

## sales@GlobalTestSupply.com

DPCTrack2 also gives you the ability to view reminders for calibrations that are coming due within a specified time period. To turn on this feature place a check in the box and select an amount of days and save.

## 6.3 User Administration Screen

The USER ADMINISTRATION screen (Figure 6.6) may be used as a quick-reference screen for all employee and group records.

The **File** menu and sub-category toolbar in the USER ADMINISTRATION screen provide you with several different options and buttons regarding employee and group records. The "Add New Employee" option will open the EMPLOYEE RECORD screen, allowing you to quickly enter new records.

If you would like to copy an employee record, highlight it with your mouse and select "Copy Employee" from the **File** menu or click the <u>Copy Employee</u> button. You may view any of the employee or group records listed, by highlighting them and selecting "View User/Group Record". Finally, you may "List All Logged On Users" and then "Logoff Selected User". Highlight the user, then select this menu option or click the <u>Logoff Selected User</u> button to log the user off the system.

-	User Administration				_ #×	
	S 100 100 100 100 100 100 100 100 100 10					
FE	mployees —					
	Person ID	User ID	Name	Activation Date		
	1	ADMIN	Administrator	01/21/2011		
	13	С	Christopher Salembier	01/21/2011		
	14	JCAL	Jimmy Calibrator	02/11/2011		
	2	MPM	Mike McClain	02/11/2011		
	12	READONLY	Read Only	01/05/2011		
	15	ROCK	Rocco	04/21/2011		
	10	TECH	Technician	01/05/2011		
	11	USER	User	01/05/2011		
Groups-						
	Group ID	Group Descriptio	n		<u> </u>	
Þ	ADMIN	Default administr	ator group			
	Read Only	Read Only Group	0			
	Tech	Technician Grou	P			
	User	User Group				

Figure 6.6

# Chapter 7 System Options

## Title

## Page

7.1	System Options	7-3
7.1.1	Database Name	7-3
7.2	System Settings Tab	7-4
7.2	System Settings Tab	7-4
7.2.1	Last Date The System Database Was Backed Up	7-4
7.2.2	Number Of Days Between Backup Warnings	7-4
7.2.3	Number Of Days Before User's Password Expires	7-4
7.2.4	Number of Logons Before Disabling ("0" = Never Disable)	7-4
7.2.5	Minimum Password Length	7-4
7.2.6	Number Of Passwords To Remember	7-4
7.2.7	Minimum Password Age To Allow Change (Days)	7-5
7.2.8	Number Of Minutes Before Time-Out	7-5
7.2.9	System Date Format	7-5
7.2.10	System Decimal Number Format	7-5
7.2.11	Default Skin	7-5
7.2.12	Allow User Skin Override	7-5
7.2.1.13	Explorer Display Format	7-5
7.2.14	Load DPCTrack Explorer on Startup	7-6
7.2.15	Warn On Overdue Test Instruments During Cal Entry	7-6

## 7.1 System Options

The SYSTEM OPTIONS screen is accessed from the **File** menu at the top left corner of the Home Screen. When performing the initial setup of DPCTrack2, it is recommended that you begin by setting the "System Settings". The SYSTEM OPTIONS screen is used to establish various settings that will affect the entire system as a whole. Only users whose groups have been given access to "System Options" can modify these settings.

Choosing the "System Options" command from the **File** menu, located on the top left corner of your HOME SCREEN will invoke the SYSTEM OPTIONS screen. See Figure 7.1 below.

stem options	
Database Name	
vstem Settings	
Last Date The System Database Was Backed Up	01/01/2999
Number Of Days Between Backup Warnings	0
Number Of Days Before User's Password Expires	30
# Of Logins Before Disabling (0 = Never Disable)	0.
Minimum Password Length	1
Number Of Passwords To Remember	0
Minimum Password Age To Allow Change (Days)	0
Number Of Minutes Before Time-out	0
System Date Format	mm/dd/yyyy 💽 Current Date: 03/03/2011
System Decimal Number Format	US - 1,000.01
Default Skin	MacMetal
	✓ Allow User Skin Override
Explorer Display Format	Item ID
	Load DPC/Track Explorer on Startup

Figure 7.1

## 7.1.1 Database Name

This field is used to record the name of your DPCTrack2 database. The default database name is *Walltrack*.

## 7.2 System Settings Tab

This page (Figure 7.1) is used to establish many different settings, all of which affect the entire system as a whole.

## 7.2.1 Last Date The System Database Was Backed Up

This field is used to record the last date that your DPCTrack2 database was backed up. While running an Access version of DPCTrack2, it is very important for your program administrator to backup your database files on a regular basis. This is a way of preventing any loss of information in the case of a system or machine malfunction. The date shown in this field is automatically updated every time a backup is performed. For more information about how to backup your database, see Chapter 25.

## 7.2.2 Number Of Days Between Backup Warnings

This field allows you to enter the number of days you want to pass before you get a reminder to backup your database files. Any numeric value may be entered into this field up to 9,999 days. The system uses the date shown in the field previously mentioned, to calculate when the reminder should appear on the screen. When it comes time for the backup reminder to appear, you will see it as you try to exit the system. At this time you may then proceed with the backup and the date shown in the previous field will be updated to the current date. If, at this time, you inform the system that the files have already been backed up, then you will be asked if you want the backup date reset. Otherwise, you may choose to ignore the reminder, in which case it will continue to come up every time you exit the system or until the backup date is manually reset. If the number of days is set to 0, then you will not be reminded.

## 7.2.3 Number Of Days Before User's Password Expires

This field is used to set the amount of days to pass before a user's password expires. Any numeric value may be entered into this field up to 9,999 days. When a user's password has expired, he/she is instructed by the system to enter a new one at the time of logon. (Note: The date shown in the *Expiration Date* field on the Employee Record screen will override this setting. For example, if you have set the *Number Of Days Before User's Password Expires* field to "30", but the *Expiration Date* on a user's employee record is not until 6 months from now, then they will not be forced to change their password every 30 days. The user's password will not expire until the *Expiration Date* on their employee record is reached.)

#### 7.2.4 Number of Logons Before Disabling ("0" = Never Disable)

This field is used to set the number of unsuccessful logon attempts that are allowed before a user's ID is disabled. When a user is disabled, only another user whose group has access to employee records can re-enable them. Any numeric value may be entered into this field with a maximum of 99. Entering "0" will prevent the system from ever disabling a user, despite the number of unsuccessful tries. Refer to Chapter 6 for more details about unsuccessful logon tries and re-enabling users if the system has disabled them.

### 7.2.5 Minimum Password Length

This field is used to set the minimum length that a user's password must be. Any numeric value may be entered into this field with a maximum character of 20. Once a value is established, if a user attempts to enter a new password that does not contain at least the required amount of characters, then it will not be accepted and the user will be forced to enter a new password that does meet the minimum character requirement.

## 7.2.6 Number Of Passwords To Remember

This field is used to set the number of passwords that the system will remember for each user ID in the system. Any numeric value may be entered into this field with a maximum

of 99. Entering a value greater than zero prevents users from continually using the same password over and over. The higher the number used, the greater your system security will be. For example, if you enter "1", then when a user's password expires, the system will remember the last password the individual used, and force them to enter a different password before they can use their original one again.

## 7.2.7 Minimum Password Age To Allow Change (Days)

Depending upon the setup of the system, users may be forced to change their password when it expires. However, DPCTrack2 also allows for a user to manually change their password at their discretion by typing a new password into the *New Password* and *New password confirmation* fields during a logon. Therefore, this system option is used to establish the minimum age in days that a user's password must be before they may manually change it. Any numeric value may be entered into this field up to a value of 999, so once a value has been set, users will be restricted from changing their password unless it has met the minimum age requirement established.

Note

*The Number of Days Before User's Password Expires must be greater than Minimum Password Age.* 

#### 7.2.8 Number Of Minutes Before Time-Out

This field is used to set the number of minutes that are allowed to pass before a user's workstation times-out due to inactivity. Any numeric value may be entered into this field up to a value of 99,999 minutes. When the workstation times-out, a logon screen titled "Session Locked" will appear. You must then enter your password in order to unlock the program and continue working. Any unsaved data or records that you were working with prior to the session time-out will be available after logging back onto the program.

#### 7.2.9 System Date Format

This field is used to set the system date format that you would like to see throughout the program. You may select one of the three options that are available on the field's dropdown list. Once you have made your selection and saved the setting, the data format selected will be seen in every area of the program where a date field exists.

#### 7.2.10 System Decimal Number Format

This field is used to set the decimal number format that you would like to see throughout the program. You may select one of the two options that are available on the field's dropdown list. Once you have made your selection and saved the setting, the decimal number format selected will be seen in every area of the program where a number field exists.

### 7.2.11 Default Skin

This field is used to define the default skin that DPCTrack2 will use the first time a user logs in.

### 7.2.12 Allow User Skin Override

This field is used to control whether or not users have the option of setting the application skin. When this option is turned off the Skins submenu will not appear when the user right-clicks on the Record Toolbar.

### 7.2.1.13 Explorer Display Format

This setting allows you to define how the DPCTrack Explorer will be displayed:

- Item ID
- Item ID : Description
- Description : Item ID

7-5

**Find Quality Products Online at:** 

### 7.2.14 Load DPCTrack Explorer on Startup

If this is checked, DPCTrack Explorer will load during startup. If this option is unchecked DPC/Track Explorer will not load on startup, allowing for the system to load quicker. The User will still be able to select the DPCTrack Explorer button and navigate as usual. Customers with large databases may wish to check this option, so DPCTrack2 will load quicker.

## 7.2.15 Warn On Overdue Test Instruments During Cal Entry

The *Warnings* section of this tab contains one check box labeled, *Warn On Overdue Test Instruments during Cal Entry*. Marking this box will instruct the system to warn you when you have assigned a test standard to a calibration record that was overdue for calibration at the time. This setting will affect the entire system as a whole and is not modifiable at any other level in the system.

# Chapter 8 User Defined Labels

## Title

## Page

8.1	User Defined Labels	8-3
8.2	Column Descriptions	8-3
8.3	Modifying Field Labels	8-4

## 8.1 User Defined Labels

The USER DEFINED LABELS DEFINITION screen can be accessed by selecting the "User Defined Labels" option on the Tools menu located on the top left of your Home Screen. DPCTrack2 gives you the ability to customize the program in many ways. One of the easiest ways to configure your system to meet your needs is to change field label names. For example, you may prefer to call the *Instrument ID* field "Asset Number" or the *Current Company* field "Current Department". This screen (Figure 8.1) has six different columns, while each row is dedicated to one individual field in the program.

File Help						
	-					
DB Field Name	Table Name	Default Label	Default Short Label	Durrent Label	Short Label	
ACKNOWLEDGED	Maintrequest, Ponotfications	Acknowledged		Acknowledged		Current
ACKNOWLEDGEDBY	Penotifications	Acknowledged By		Acknowledged		abel and
ACKNOWLEDGEDBYID	Penolifications	Acknowledged By ID		Acknowledged		Short
ACKNOWLEDGMENTNOTE	Penotifications	Acknowledgment Note		Acknowledgme		Label
ACTIONTAKEN	General	Action Taken		Action Taken	4	Columns
ACTIVE	Potesttypes, Trainingcourse	Active		Active	2	
ACTIVEPOLICY	Approvalpolicies	Active Policy		Active Policy		(Used to
ACTIVESOP	Sop	Active Document		Active Document		make field
ACTUALMANHOURS	Maintresult	Act Man Hrs		Act Man Hits		label
ADDEDBY	Systemcomponent	Added By		Added By		changes.
ADDRESS1	Company, Manufacturer, Ve	Address Line 1		Address Line 1		
ADDRESS2	Company, Manufacturer, Ve	Address Line 2		Address Line 2		
ADJUSTTOIMPROVE.	Calibration	Adjusted To Improve		Adjusted To Im.	.*	



## 8.2 Column Descriptions

The DB Field Name column shows the fields' actual database names. The Table Name column shows all of the areas of the program where the fields exist. The Default Label column shows the label that each field in the program defaulted to upon installation. The Default Short Label column shows the label that certain fields appearing on reports and in grids throughout the program defaulted to upon installation. These first four columns are locked and cannot be modified.

"Short Labels" are those that will appear in grids throughout the program on reports where there is limited room. In the case of standard reports, all user defined field label names are automatically transferred to the program's standard reports. Therefore, certain fields require a shorter label to be declared because there is limited room for them on the reports. These fields are those that often appear in reports' calibration specification sections. For all of these types of fields, a short label must be established. Any fields that do not have a Default Short Label do not require that one be entered.

## 8.3 Modifying Field Labels

The *Current Label* and *Short Label* columns, which are the only ones that contain modifiable text, show the current labels of all fields both in the program and on reports. These are the columns actually used to make changes. To modify any field label, page down to the field whose label you want to change, delete the current name, type in the new label name and tab off the cell. To save your changes, click the <u>Save</u> button on the screen's toolbar. You are limited to 50 characters on the Current Label, and 20 on the Short Label.

The USER LABELS DEFINITION screen may also be accessed while working in many of the individual screens in the program. Select "Labels" from the Edit menu while the screen is open. This is often a more convenient way to modify field label names because the only fields listed in the USER LABELS DEFINITION screen are those that exist in the currently opened screen. Selecting "User Defined Labels" from the Tools menu from the Home Screen brings up all of the fields in the program at once.

Note

Changing a label through an individual screen will also change the label in all areas where the label exists.

Finally, the grid in the USER LABELS DEFINITION screen may be exported at any time by right-clicking anywhere on it with your mouse. This action will invoke an option box providing you with the ability to save the grid to an Excel spreadsheet.

# Chapter 9 Company Record Screen

## Title

## Page

9.1	Company Records	9-3
9.2	Tabbed Notebook Section	9-3
9.2.1	General Info Tab	9-3
9.2.1.1	Address Lines 1 & 2, City, State, Zip & Country	9-3
9.2.1.2	Contact, Phone & Email	9-3
9.2.2	Other Addresses Tab	9-4
9.2.3	Options Tab	9-4
9.2.3.1	Force Calibration Failure	9-4
9.2.3.2	Users Cannot Finalize Calibrations They Entered	9-4
9.2.3.3	Prevent Duplicate IDs Across All Record Types	9-4
9.2.3.4	[Allow, Warn, or Restrict] If Calibrated Item Is Not Approved	9-5
9.2.3.5	Allow The User To Finalize Incomplete Calibrations	9-5
9.2.3.6	Prevent Accuracy Modifications During Calibration	9-5
9.2.3.7	Require Reason For Failure On A Failed Calibration	9-5
9.2.3.8	Only Show Active Test Instruments	9-5
9.2.3.9	[Allow, Warn, or Restrict] On Use Of An Unapproved	
	Test Instrument	9-5
9.2.3.10	) Font Colors	9-5
9.2.3.11	Default Values	9-6
9.2.3.12	2 Statuses	9-6
9.2.4	Default Reports Tab	9-7
9.3	Change Company Name	9-7

## 9.1 Company Records

DPCTrack2 has the ability to store and track data for one company in the system. Your company's record must be established before you can enter any device information. You will be required to enter a Company name during installation. To view or modify an existing company record, select the speed button labeled **"Company"** from the Record Toolbar, this action will invoke the COMPANY RECORD screen shown in Figure 9.1 below.

## 9.2 Tabbed Notebook Section

The tabbed notebook section of the COMPANY RECORD screen contains four (4) different sub-screens or "pages" available for data entry. These pages are logically grouped on the tabs of the notebook. Each page and its associated fields are described below. To open a page, click its tab with your mouse.

E Company				ð×
Company Name				
Fluke Customer				
General Info Other Add	resses Options Default Reports			
Address Line 1				
Address Line 2				
City	State	Zip	Country	
Cardinal Cardinal	Dhave			
	Phone			
	,		,	
Modified By	Last Modified	Entered By	Date Entered	
Administrator	06/01/2011 12:25:44 PM	Administrator	04/25/2005 10:05:00 AM	

Figure 9.1

## 9.2.1 General Info Tab

This tab page (Figure 9.1) may be used to enter all of the general information about a company. In the fields provided you may type the company's full name, address, phone number, contact person and e-mail address.

## 9.2.1.1 Address Lines 1 & 2, City, State, Zip & Country

These are alpha/numeric fields, each of these fields are limited to 255 characters.

### 9.2.1.2 Contact, Phone & Email

These are alpha/numeric fields, each of these fields are limited to 50 characters.

## Find Quality Products Online at:

#### 9.2.2 Other Addresses Tab

This tab page is used to document additional addresses for the company such as *Shipping Address* and *Billing Address*. For your convenience, this screen contains "Copy" buttons that may be used when all or some of the company's addresses are the same. To copy addresses from another section, click the appropriate button with your mouse.

## 9.2.3 Options Tab

This tab (Figure 9.2) contains some important data entry options that will affect master records.

_a×
Allow The User To Finalize Incomplete Calibrations
F Prevent Accuracy Modifications During Calibration
🔲 Require Reason For Failure On A Failed Calibration
Only Show Active Test Instruments
Allow 💌 On Use Of An Unapproved Test Instrument
Font Colors
Spec Limit Exceeded
Statuses
Calibration Passed Status
New New
Calibration Failed Status
▼ New

Figure 9.2

#### 9.2.3.1 Force Calibration Failure

This is a setting that when selected will not allow a failed calibration (one with at least one as-left value that is outside of the acceptable limits) to be saved as a passed calibration.

#### 9.2.3.2 Users Cannot Finalize Calibrations They Entered

This is a setting that when selected restricts users from finalizing calibration records that they entered into the system requiring another user to logon and finalize the calibration.

#### 9.2.3.3 Prevent Duplicate IDs Across All Record Types

This option, if checked, will prevent the duplication of an ID across different record types. So, if there is an Instrument ID "123" you will not be able enter a Loop ID of "123". This option is not allowed if there are already duplicate IDs existing in the database.

## Find Quality Products Online at: www.GlobalTestSupply.com
#### 9.2.3.4 [Allow, Warn, or Restrict] If Calibrated Item Is Not Approved

This setting is used to manage the entry of calibration records for approved and unapproved item Master Records (Master Records for Instruments, Loops and Test Instruments).

Selecting "Allow" for this field, will enable users to enter calibration records for items whose Master Records have not been approved yet, while selecting "Restrict" for this field will keep users from entering calibration records for items whose Master Records are not approved yet. Finally, if "Warn" is selected, then when a user attempts to enter a calibration record for an unapproved record, a message will appear on the screen warning them of this.

#### 9.2.3.5 Allow The User To Finalize Incomplete Calibrations

This is a setting that when selected will allow users to finalize calibration records that are "Incomplete" (have the *Incomplete* radio button checked). If this option is not selected, then users will be restricted from finalizing incomplete calibrations.

#### 9.2.3.6 Prevent Accuracy Modifications During Calibration

This is a setting that when selected will not allow you to modify any accuracy information for an item such as its *Stated Accuracy*, *Resolution*, etc. when you enter a calibration record for it.

#### 9.2.3.7 Require Reason For Failure On A Failed Calibration

This is an option that when selected will not allow you to save a failed calibration record unless an entry has been made in the *Reason For Failure* field.

#### 9.2.3.8 Only Show Active Test Instruments

This is an option that when selected will restrict the display of Test Instruments in the CALIBRATION screen to only those Test Instruments that are currently assigned an active status (on whose record has the *Indicates an Active Status* box marked). All Test Instruments in the system for the company that are not assigned an active status will not be displayed on the screen and therefore will not be available for assignment to a calibration record.

#### 9.2.3.9 [Allow, Warn, or Restrict] On Use Of An Unapproved Test Instrument

This is a setting that is used to manage the selection of approved and unapproved Test Instruments in the CALIBRATION screen. Selecting "Allow" for this field will enable users to assign unapproved Test Instruments to calibration records, while selecting "Restrict" for this field will prevent users from selecting unapproved Test Instruments. In fact, if "Restrict" is selected than any unapproved Test Instruments entered for the current company will not even be listed in the *Available Test Instruments* box, regardless of their current status. Finally, if "Warn" is selected, than when a user attempts to select an unapproved Test Instrument to be moved to the *Test Instruments Used in Calibration* box, a message will appear on the screen warning them that they have chosen a currently unapproved test standard.

#### 9.2.3.10 Font Colors

The Font Colors option allows the user to assign a font color to data in Calibration Records when the *Spec Limit is Exceeded*. This allows the user to easily see Calibration Data that exceeds limits.

## www.GlobalTestSupply.com

#### 9.2.3.11 Default Values

#### 9.2.3.11.1 Stay On Schedule

This default value affects Instrument, Loop and Test Instrument records. Even though you may activate this feature here, the check box also exists (Labeled *Keep On Schedule*) in the MASTER INSTRUMENT, LOOP and TEST INSTRUMENT screens. Therefore, you can override it as needed, in those areas of the program. For more information see Chapter 15.

#### 9.2.3.11.2 Default Input Resolution

This is a default value that determines the number of decimal places that will automatically appear on the *Calibration Points* tab for **input** values on new Instrument, Loop and Test Instrument records within this Company. You may select any value from the field's drop-down list. Of course, not all of your Instrumentation will require the same number of decimal places for their input values, but if a large portion of your items require 3 decimal places (.001), then it makes sense to make this a company default for all records input values, this will save you keystrokes later.

Once this default value has been entered and saved on this screen, it will affect all new entries made to the company from that point on. Records entered prior to the establishment of this default value will not be affected by the change. This field also exists in the MASTER INSTRUMENT, LOOP and TEST INSTRUMENT screens, therefore, you may override the default on an individual item basis.

#### 9.2.3.11.3 Default Spec Resolution

This is a default value that determines the number of decimal places that will automatically appear in the calibration specification grids for Instrument, Loop, and Test Instrument records. You may delete or change it by typing over the existing value. For example, selecting "0.001" in this box will instruct the system to round all numeric values (input, output values, etc.) to ".001". (8 is the maximum number of decimal places DPCTrack2 is capable of.) Keep in mind, however that this field also exists in the MASTER INSTRUMENT, LOOP and TEST INSTRUMENT screens, therefore, you may override the default on an individual item basis.

#### 9.2.3.12 Statuses

Statuses in DPCTrack2 serve a very important function in managing work flow and tagging items or work that is pending, completed, or failed. The *Statuses*, when utilized, assist the system in determining when items or work should appear in the REMINDERS screen or on scheduling reports like "Events Due" or "Calibration Worksheets". In addition, when the *Calibration Passed Status* and *Calibration Failed Status* are used, the system can automatically change an item's status to match its calibration result, which in turn may generate an alert.

Statuses may be added to each field's drop-down list by either selecting "Status" from the **Lists** menu or clicking the <u>New</u> button next to any of the status fields. When you enter a new status into the system you must decide whether the status will be an *Active* status or not.

**Find Quality Products Online at:** 

9-6

#### 9.2.3.12.1 Calibration Passed Status

This field is used to declare the status that an item (Instrument, Loop or Test Instrument) should change to if it passes calibration. When the passed calibration is entered, upon saving, a message will appear asking if you would like the system to automatically update the item's status. A few examples of statuses that would make sense for this field are "In Service" or "Active".

#### 9.2.3.12.2 Calibration Failed Status

This field is used to declare the status that an item (Instrument, Loop or Test Instrument) should change to if it fails calibration. When the failed calibration is entered, upon saving, a message will appear asking if you would like the system to automatically update the item's status. A few examples of statuses that would make sense for this field are "Out of Service" or "Needs Repair".

#### 9.2.4 Default Reports Tab

This tab page provides the fields in which to assign default reports to this company that will be used when printing directly from a particular screen in the program.

## 9.3 Change Company Name

DPCTrack2 gives you the opportunity to change the Company name. From the HOME screen select TOOLS  $\rightarrow$  "Change Company Name". You must be a member of the ADMIN group to access this feature.

# www.GlobalTestSupply.com

# Chapter 10 User Defined Variables and User Defined Lists

#### Title

### Page

10.1 Use	er Defined Options & Required Fields	10-3
10.2 Ad	ding User Defined Variables	10-3
10.2.1	Selecting a File Type	10-3
10.2.2	Entering the Variable Name	10-4
10.2.3	Selecting the Field Data Type	10-4
10.2.3.1	Text	10-4
10.2.3.2	Decimal	10-4
10.2.3.3	Integer	10-4
10.2.3.4	Date	10-4
10.2.3.5	List	10-4
10.2.3.6	File	10-4
10.2.3.7	Signature	10-4
10.2.4 I	Deleting a User Defined Variable	10-5
10.2.5 I	Reordering User Defined Variables	10-5
10.3 Use	er Defined Lists	10-6
10.3.1	Creating a New List Type	10-6
10.3.2	Creating List Entries for New List Types	10-6
10.4 Con	nfiguring Required Fields	10-7

## 10.1 User Defined Options & Required Fields

Because DPCTrack2 is used in such a wide variety of industries, it is impossible to create a program that will accommodate individual needs and requirements. Therefore, DPCTrack2 enables you to add an unlimited amount of user defined variables (or new fields) to the program. In addition, you may specify what kind of data your users must enter into the new fields. All user defined variables added to the system will become a part of the *User Defined* tab on the screen to which they are defined. The screen that you use to create user defined variables is the USER VARIABLE DEFINITION screen (shown in Figure 10.1). It can be accessed by selecting "User Defined Variables" from the Tools menu while the Home Screen is open.



Figure 10.1

## 10.2 Adding User Defined Variables

### 10.2.1 Selecting a File Type

When adding a new user defined variable to the system, you must first decide in which screen it should reside. From the File Type drop-down list, you may select from one of the following: "Calibration", "Equipment" "Instrument", "Loop" and "Test Instrument". As you select different file types from the drop-down list, the screen will change to show only those user defined variables that have already been entered for the currently selected file. Figure 10.1 above shows seven user defined variables that were entered for the CALIBRATION screen.

Find Quality Products Online at:

# www.GlobalTestSupply.com

#### 10.2.2 Entering the Variable Name

Once you have selected the file type that you would like to work with, you may proceed to add the fields. To begin, you must click the <u>Add New Variable</u> button. You will see a new row appear on the screen. You can enter the title of the new field in the *Name* field. This is alpha/numeric text field with a field length of thirty five characters.

#### 10.2.3 Selecting the Field Data Type

As mentioned on the previous page, you may specify the kind of data that your users will be required to enter into the new fields. Once you have entered the field name, you may then select the data type from the *Type* drop-down list. This drop-down list is illustrated in Figure 10.1 on the previous page.

#### 10.2.3.1 Text

Selecting the "Text" data type will allow users to enter data in any format that they choose.

#### 10.2.3.2 Decimal

Selecting the "Decimal" data type will require users to enter a numeric value with decimal points.

#### 10.2.3.3 Integer

Selecting the "Integer" data type will require users to enter a numeric value with no decimal points.

#### 10.2.3.4 Date

Selecting the "Date" data type will require users to enter a date value into the field. The format of the date will depend upon the date format that was selected in the SYSTEM OPTIONS screen. See Chapter 7 for more information.

#### 10.2.3.5 List

Selecting the "List" data type will require users to make a selection from a drop-down list that is also user defined. Any user defined lists that have already been added to the system will be listed on the drop-down list in the *User Defined List Type* field on the USER VARIABLE DEFINITION SCREEN. If you need to add a new list type, you may do it directly from this screen by selecting "Add List Type" from the File menu. In addition, user defined list types may be used at the same time for many user defined variables throughout the system. (User defined lists will be discussed in further detail later in this chapter.)

#### 10.2.3.6 File

Selecting the "File" data type will allow users to insert a file name or URL into the user defined variable on whichever screen it is located. The file name can only be inserted into the field by clicking the (...) button and locating the file on your workstation or server. For a URL, you must select "Enter URL" from the (...) button and type the entry into the field provided. Once a valid file or URL name is in the field, you may then open it directly from that screen by double-clicking it or selecting "Open Link" from the menu invoked by the (...) button.

#### 10.2.3.7 Signature

Selecting the "Signature" data type allows you to add an additional level of electronic signature to your records. When this type of user defined variable is added to a screen, it will appear with a check box. To record the electronic signature in the field, check the box and save the record. The full name of the user who saved the record and the date and time of the save will be recorded in the field.

**Find Quality Products Online at:** 

## www.GlobalTestSupply.com

Once you have completed all of the steps required for creating the new field, you may click the <u>Save Variable</u> button to move onto another file type or click the <u>Add New</u> <u>Variable</u> button again to add another field to the file type currently displayed.

#### 10.2.4 Deleting a User Defined Variable

To delete a user defined variable, highlight its name in the USER VARIABLE DEFINITION SCREEN and hit the "Delete" or "Backspace" key on your keyboard, then click the <u>Save Variable</u> speed button. If data has already been entered into this field elsewhere in the program, a warning message will appear confirming your intention to delete the field. **Please note that when a user defined variable is deleted, all data entered into that field is deleted as well.** 

#### 10.2.5 Reordering User Defined Variables

If you have more than one user defined variable on a screen, you may reorder their appearance at any time. To do this you must first select the *File Type* whose fields you would like to rearrange. Once the screen's user defined variables are displayed, select "Reorder Variables…" from the File menu. This will invoke the REORDER USER-DEFINED VARIABLES screen shown in Figure 10.2.

Name         Type         Reor der User-Defined Variables           Reason for Incomplete Calibration         LIST         Reason for Incomplete Calibration           Technician Phone Number         TEXT         Reason for Incomplete Calibration           Reviewer         SIGNATURE         Reviewer           Calibration Certificate         FILE         Repaired?		File Type Calibration				
Reason for Incomplete Calibration         LIST           Technician Phone Number         TEXT         Reason for Incomplete Calibration Technician Phone Number           Reviewer         SIGNATURE         Reviewer           Calibration Certificate         FILE         Calibration Certificate		Reorder User-Defined Variable	Туре	Name		
Technician Phone Number         TEXT         Reason for Incomplete Calibration Technician Phone Number           Reviewer         SIGNATURE         Reviewer           Calibration Certificate         FILE         Calibration Certificate			LIST	Reason for Incomplete Calibration		
Reviewer         SIGNATURE         Reviewer           Calibration Certificate         FILE         Calibration Certificate	-	Reason for Incomplete Calibration	TEXT	Technician Phone Number		
Calibration Certificate FILE Calibration Certificate Repaired?	1	Reviewer	SIGNATURE	Reviewer		
The second s	1	Calibration Certificate	FILE	Calibration Certificate		
Repaired? LIST Materials Lost		Materials Cost	LIST	Repaired?		
Materials Cost DECIMAL Condition of Device		Londition of Device	DECIMAL	Materials Cost		
Condition of Device LIST			LIST	Condition of Device		
	i					

Figure 10.2

To reorder the fields select a field name and click the <u>Move Selected Variable Up</u> or <u>Move Selected Variable Down</u> button as desired. Once you have rearranged the fields as necessary, click the <u>OK</u> button. As soon as you are returned to the USER VARIABLE DEFINITION screen you will see the fields listed in the order you configured. This is the same order that the variables will appear on the screen in which they reside

#### **Find Quality Products Online at:**

## www.GlobalTestSupply.com

## 10.3 User Defined Lists

#### 10.3.1 Creating a New List Type

DPCTrack2 already comes equipped with many standard lists that may have entries added to them via the Lists menu or <u>New</u> buttons found throughout the program. However, the program also gives you the ability to create your own lists that may be applied to the user defined variables that you have created. To do this, from the **Tools** menu while the Home Screen is open, you must first select "User Defined Lists", "Edit List Types". This will invoke the USER-DEFINED LIST TYPES screen shown in Figure 10.3.

You may enter the name of the new list type into the *User Defined List Types* field and click the <u>Save</u> button. You are limited to 50 characters. Every list type that is entered through this screen will also become available from the Tools menu under the "User Defined Lists" option. In this screen you may click the <u>List button to view all list types</u> currently entered into the system and if you need to delete a list type that has not been used, select it from the list, click <u>OK</u>, then click the <u>Delete</u> button. The list and all of its entries will be removed from the system. If however, entries from the list type have already been used elsewhere in the program, you will not be allowed to delete it.

Jser-Defined List Types	
User-Defined List Types	
Yes/No	

Figure 10.3

#### 10.3.2 Creating List Entries for New List Types

Once you have created new list types, you will need to populate them with entries. To do this, select "User Defined Lists" from the Tools menu and choose the name of the list type you would like to make entries for. When you choose a list type from the menu, the screen will look exactly like that in Figure 10.4 except for its title, which will match the name of the list type selected.



Figure 10.4 above, shows the screen for a new list type called "Yes/No". It works in the same way as the USER DEFINED LIST TYPES screen. You may enter the name of the new entry into the field and click the <u>Save</u> button. You can enter up to 50 characters in the field. You may click the <u>List</u> button to view all entries that have been added for the list type and if you need to delete an entry that has not been used, select it from the list,

## Find Quality Products Online at: www

# www.GlobalTestSupply.com

click <u>OK</u>, then click the <u>Delete</u> button. The list entry will be removed from the system and will no longer appear on the drop-down lists of any fields that are using its list type. If however, the selection has already been used somewhere, you will not be allowed to delete it.

## 10.4 Configuring Required Fields

DPCTrack2 also gives you the ability to require completion of standard and user defined fields in each of five (5) different screens in the program in order to save, approve or finalize a record. Completion of most fields in the MASTER INSTRUMENT RECORD, LOOP RECORD and TEST INSTRUMENT RECORD screens, can be required in order to approve a record of any of these types. Additionally, completion of fields in the CALIBRATION screen can be required in order to finalize a record, while completion of fields in the EQUIPMENT RECORD screen can be required in order to save a record.

The establishment of required fields is done through the REQUIRED FIELDS screen, which is accessed by selecting "Required Fields" from the **Tools** menu in the Home Screen. When you select this menu option an additional selection box will appear with each of the five (5) different record types, "Instrument", "Loop", "Test Instrument", "Equipment" and "Calibration" for which fields may be made required. To select a screen or record type to configure required fields for, left-click the one desired in the selection box. The configuring of required fields for each record type must be done on an individual basis.

Required Fields (Modified)		. ax
Eile		
Item Type		- 7
Instrument	1	
Database Fields		
Available	Required	
Model Number Serial Number Calibration Frequency Last Cal Date Next Cal Date Warranty Exp Date Decriment ID	Description     Location     <	
User Defined Variables		
Available	Required	
File	S neviewei	
1		
	-	
1		

Figure 10.5

Regardless of the record type that you select, the *Required Fields* screen will appear (see Figure 10.5). The name of the item or record type selected will be shown in the screen's *Item Type* field, which is inaccessible. Additionally, the standard fields whose completion can be required will be listed in the *Database Fields* section's *Available* box, while all user defined fields currently existent in the selected screen will be listed in the *User Defined Variables* section's *Available* box.

To make fields required, just highlight them in each of their *Available* boxes and use the center arrow buttons as applicable to move them to the *Required* boxes. If any fields shown in either of the *Required* boxes need to be removed, use the arrow buttons as applicable again, to move them back to the appropriate *Available* box. The removal of a

#### **Find Quality Products Online at:**

field name from a *Required* box eliminates completion of that field as a requirement for save, approval or finalization of a record in the screen in which it resides.

Note User defined variables that are of an "Integer" or "Decimal" type cannot be required for a record since a value of "0" may denote a real or null value. Therefore any user defined variables of these types will not be listed in Required Fields screen.

Once you have completed selection of required fields for a particular record type, click the <u>Save</u> button. You may then close the *Required Fields* screen and move onto establishing required fields for a different record type by selecting a different record type from the "Required Fields" option on the Home Screen's **Tools** menu.

Instrument ID 1-11	Description		1	Last Cal Date	Next Cal Date 04/05/2011
eneral Info Calibration Points Additi	onal Info   Use	r Defined   Notes			
Fluke Model Number 700P100 Serial Number 21787-YGQ-998 Status Active Status Modification Date 04/05/2011 3:33:45 PM	Vew	Lab New Classification NIST Equipment ID Instrumer Pressure Need the following values to Appr Documer IOK	Calibration Freque Annual Last Cal Date / / www.international pove: Description	ncy First C Next Call 04/05/20	al Date Date D11
Associated Loops		-	Approved By	y	

Figure 10.6

When required fields have been set for a particular screen or record type you will be restricted from performing certain actions, as applicable, for the screen you are working in when those required fields have not been completed. For example, Figure 10.6 displays the typical message that will appear in the MASTER INSTRUMENT RECORD screen when the required fields have not been filled in and a user attempts to approve a record. If you are uncertain of the field requirements for a particular record type, this information is available by selecting "Check Requirements" from the screen's Edit menu. This will display a message box detailing the fields that still need to be completed within the screen in order to approve the record (Instruments, Loops, and Test Instruments), finalize the record (Calibrations) or just save the record (Equipment).

10-8

www.GlobalTestSupply.com

# Chapter 11 **Reminders**

### Title

### Page

11.1	Reminders	11-3
11.2	Printing Reminders	11-4

## 11.1 Reminders

DPCTrack2 comes equipped with a reminder system, whereby overdue calibrations and alerts will appear on the REMINDERS screen. There are many different types of reminders that may appear in this screen ranging from *Late Calibrations* to *Show Incomplete Calibrations*. The REMINDERS screen may be invoked manually by selecting "View Reminders" from the Main Toolbar when the Home Screen is open. However, depending on your User Group Reminder Options, it is more likely that the REMINDERS screen will automatically appear at program start-up.



Figure 11.1

Access to the REMINDERS screen and what appears in that screen is determined at the user group level (see Chapter 6). Some users may only see items awaiting approval or finalization, while others will only see late calibrations. Basically, what appears in the screen depends upon the user group(s) that you belong to and the Reminder Options of those groups.

The REMINDERS screen can be seen in Figure 11.1. It contains a tree view of the company and their reminder items, separated by the departments to which the reminders' master records are currently associated with. Any reminder items whose master records are not associated with a department will appear under the "N/A" group.

Within the tree, you may expand and collapse each reminder as needed. To view the details of all of the reminders listed, click the <u>Expand All</u> button. To condense the list, click the <u>Collapse All</u> button. To see the details of only one reminder at a time, click the plus (+) sign to the left of the lines. To collapse the reminders, click the minus (-) sign. You may also access the master record for each reminder, for example the master instrument record for an overdue instrument calibration by double-clicking it on the screen.

## 11.2 Printing Reminders

Not only may records shown in the REMINDERS screen be accessed by double clicking them one at a time with your mouse, but you may also print the entire list in any format that you choose. To customize your printer setup, click the <u>Print Setup</u> button. Your screen will look like that shown in Figure 11.2.

nt	Headings	Available	Displayed
ype: Courier New	Type: Courier New	Title Printed By	
ize: 12	Size: 12	Date/Time	
olor:	Color:		FI
tyle:	Style: Bold		-
		- Footer	Displayed
Edit Font	Edit Font	Title	Displayed
		Printed By	
w Indent	Heading	Other	
	Data		2
	2.0		

Figure 11.2

In the PRINT SETUP screen you can change the size, style and color of the report's fonts including its headers in both the report's header and footer. To do this, click the <u>Edit Font</u> buttons in those sections of the screen. The reminders, when printed, will appear exactly as they do in the REMINDERS screen, but with the entire tree expanded so that all details can be seen. Therefore, you may decide to indent rows so that the information is easier to read. Select a different number from the *Row Indent* section's drop-down list. As you select different numbers, *Heading* and *Date* on the screen will change positions to illustrate how the report will look when printed.

You may also select additional data to be included in the report's header and/or footer. Highlight any of the items listed in the *Available* boxes and use the center arrow keys to move them to the desired *Displayed* boxes. Selecting "Other" will invoke the INPUT FORM screen in which you may type an additional item to be shown in the header or footer. For example, Figure 11.2 above shows that when a reminder report is printed with this setup, that a title, the name of the person who printed it and the date and time at which it was printed will appear in the report's header. In the report's footer an additional field called "Date Distributed" will be shown. With this printed on the report, the user could then write in the date that the report was sent out to those requiring it.

To save your print settings, click the <u>Set as Defaults</u> button, then click <u>OK</u>. Once you are back in the REMINDERS screen, click the <u>Print</u> button and proceed as you normally would when printing a document from your computer. Your print settings will remain as you arranged unless you modify them again.

11-4

Find Quality Products Online at:

# Chapter 12 Standard Lists

#### Title

### Page

12.1	Standard Lists	
12.2	List Screens	
12.2.1	Calibration Frequency	
12.2.1.1	Frequencies Based on "Months" or "Years"	
12.2.1.2	2 Frequencies Based on "Weeks"	
12.2.2	Status	
12.2.3	Signal Type	
12.2.4	Manufacturer	
12.2.5	Locations	
12.2.6	Department	
12.2.7	Vendors	
12.2.8	Instrument Type	
12.2.9	Responsible Technician	
12.2.10	Calibration Type	
12.2.11	Classification	
12.2.12	Document Type	
12.2.13	Equipment Type	

## **12.1 Standard Lists**

Many of the standard fields in DPCTrack2 have drop-down lists that are user defined. This gives you the ability to customize many areas of the program to meet your needs. All of the standard user defined lists can be accessed from the **Lists** menu at the top of the HOME SCREEN.

You will find thirteen (13) list screen options on the **Lists** menu: "Calibration Frequency", "Status", "Signal Type", "Manufacturer", "Locations", "Department", "Vendors", "Instrument Type", "Responsible Technician", "Calibration Type", "Classification", "Document Type", and "Equipment Type". Each of these screens allows you to enter selections that will appear on those fields' drop-down lists throughout the program.

## 12.2 List Screens

To enter list information, click each option with your mouse. Every list type has its own screen in which you may add, modify or delete entries on its drop-down list. (If a list screen does not contain a <u>Delete</u> button, then go to the **File** menu while the screen is open and select "Delete Record".)

Once a list entry has been assigned to a record in the system, it cannot be deleted. For example, if you have created a status called "In Service" and it has been assigned to at least one Instrument, Loop, Equipment or Test Instrument record you will not be able to delete it from your database.

Refresh Reminders
Calibration Frequency
Status
Signal Type
Manufacturer
Locations
Department
Vendors
Instrument Type
Responsible Technician
Calibration Type
Classification
Document Type
Equipment Type

Figure 12.1

#### 12.2.1 Calibration Frequency

This list option allows you to define and set up specific frequencies that can be applied to all items that get calibrated. Calibration frequencies help the program calculate due dates for item calibrations. Common ones would be "Yearly", "Semi-annually", "Quarterly", etc. There are several options with regard to the setup of a frequency that are outlined and discussed in detail below. The Calibration Frequency title is limited to 40 characters.

#### Find Quality Products Online at:

# www.GlobalTestSupply.com

#### 12.2.1.1 Frequencies Based on "Months" or "Years"

For frequencies based upon "Months" or "Years" ("Months" or "Years" is selected from the screen's drop-down list), the *Keep On End of Month* box will be available. Checking the *Keep On End of Month* box for a calibration frequency will instruct the system, when calculating a due date based upon the frequency, to always use the last day of the month that the item will be due for calibration as its actual due date.

Additionally, the *Allow system to Roll Dates Forward if Actual Event Date is within* section provides you with two (2) options. Selection of the [#] *Days of Scheduled Event Date* circle allows you to declare exactly how many days before the due date, that a calibration can be successfully completed and still have the next due date automatically roll forward. Any numeric value may be entered into this field, and the number used can be different for every calibration frequency entered into the database. Selection of the *Calendar Month of Scheduled Event Date* circle will allow for the calibration to be completed up to one (1) calendar month before the due date, taking into consideration the actual number of days within the month. If this setting is selected, the *Days of Scheduled Event Date* circle will be grayed out and inaccessible since it is not applicable.

#### 12.2.1.2 Frequencies Based on "Weeks"

Frequencies based upon "Weeks" has similar setting options to those based on "Months" or "Years". For frequencies based upon "Weeks" ("Weeks" is selected from the screen's drop-down list), the *Keep On End of Week* box will be available. Checking the *Keep On End of Week* box for a calibration frequency will instruct the system, when calculating a due date based upon the frequency, to always use the last day of the week in which the item will be due for calibration as its actual due date.

Additionally, the *Allow system to Roll Dates Forward if Actual Event Date is within* section provides you with two (2) options. Selection of the [#] *Days of Scheduled Event Date* circle allows you to declare exactly how many days before the due date, that a calibration can be successfully completed and still have the next due date automatically roll forward. Any numeric value may be entered into this field, and the number used can be different for every calibration frequency entered into the database. Selection of the *Calendar Week of Scheduled Event Date* circle will allow for the calibration to be completed up to one (1) calendar week before the due date. If this setting is selected, the *Days of Scheduled Event Date* circle will be grayed out and inaccessible since it is not applicable. (Note: A calendar week in DPCTrack2 runs from Sunday through Saturday.)

Note

If the calibration is unsuccessful or fails, that no dates will be rolled forward.

#### 12.2.2 Status

This list option allows you to create statuses that may be applied to all types of items and records in the system. As mentioned in Chapter 9, statuses in DPCTrack2 serve a very important function in managing work flow and tagging items or work that is pending, have been completed or have failed. Examples of statuses that may be applicable to your records are "In Service", "Out of Service", "Decommissioned", "New Instrument" or "Storage", "Open Work", "Completed Work", "Assigned" and "Canceled".

## www.GlobalTestSupply.com

When entering a new status you must first decide if it is an active status, the *Indicates an Active Status* box is checked. Marking this box instructs the system to show items that have been given this status on calibration scheduling reports like "Events Due" and "Calibration Worksheets" and in the REMINDERS screen. For example, you would probably want to see items with a status of "In Service" on calibration scheduling reports and in the REMINDERS screen, but you would not want to see items that have a status of "Decommissioned". Therefore, on the status record for "Decommissioned" you would leave this check box blank. You are limited to 50 characters in this field.

You may add new statuses by using this menu option, or you can add them by clicking the <u>New</u> button next to the *Status* fields in various screens throughout the program.

#### 12.2.3 Signal Type

This list option allows you to create different units of measurement such as "psig" and "mA" which are pertinent to Instrument, Loop and Test Instrument calibrations. You may add these by using this menu option. You are limited to 50 characters in this field. (Note: If you choose to import symbols into this field, [examples; °,  $\mu$ ] the quick type feature will be disabled)

#### 12.2.4 Manufacturer

This list option allows you to enter the information about the person, group, or company that manufacturers the asset. The MANUFACTURER screen provides you with fields in which to enter a manufacturer's name, address, phone number, fax number and contact person, however the only information required to save a new record is the manufacturer's name. You may add manufacturers by using this menu option, or you can add them by clicking the <u>New</u> button next to the *Manufacturer* fields in various screens throughout the program. You are limited to 50 characters for the Manufacture. The Address Line 1 & 2, City, State, Zip and Country are limited to 255 characters. The Phone, Fax and Contact are limited to 50 characters.

#### 12.2.5 Locations

This list option allows you to enter another physical site for your company. This screen has two tabs, *General Info* and *Building Info*.

On the *General Info* tab you may enter the location's name and directions to the facility. The Location name is limited to 50 characters and the directions are limited to 3,996 characters.

On the *Building* tab you may enter any buildings that are located at that site. To enter a new building, type it into the small field on the right and click the <u>Add New</u> button. You are limited to 50 characters. You will see that the new building name is added to the *Building* box on the left. You may add as many Buildings to each location as needed. To delete a building from the location, highlight it in the "Building" box on the left and click the <u>Delete Selected</u> button. If the Building is in use, you will not be allowed to delete it.

New locations and buildings may be added by using this menu option, or you can add them by clicking the <u>New</u> button next to the *Location* and *Building* fields in various screens throughout the program.

#### 12.2.6 Department

This list option allows you to enter different areas for your company, which may then be assigned various record types throughout the system. You may add departments by using this menu option, or you can add them by clicking the <u>New</u> button next to the *Department* fields in various screens throughout the program. You are limited to 50 characters in this field.

## www.GlobalTestSupply.com

#### 12.2.7 Vendors

This list option allows you to enter the person or company that sells or services your instruments. The VENDOR screen provides you with fields in which to enter a vendor's name, address, phone number, fax number and contact person, however only the vendor's name is required to save a new record. You are limited to 50 characters in this field. You may add vendors by using this menu option, or you can add them by clicking the <u>New</u> button next to the "Vendor Name" fields in various screens throughout the program. Vendors can only be edited or deleted through this screen. A Vendor cannot be deleted if it is in use. The Address Line 1 & 2, City, State, Zip and Country are limited to 255 characters. The Phone, Fax and Contact are limited to 50 characters.

#### 12.2.8 Instrument Type

This list option allows you to create different device types such as "Transmitter", "Analyzer", "Pressure" or "Temperature". Instrument types are useful in tracking data as well as limiting the number of test instruments that can be used for particular calibrations. (See Chapter 17 for information about entering test instruments and their connection to instrument types.) You may add instrument types by using this menu option, or you can add them by clicking the <u>New</u> button next to the *Instrument Type* field in MASTER INSTRUMENT RECORD screen. You are limited to 50 characters in this field.

#### 12.2.9 Responsible Technician

This list option allows you to add names of technicians who perform your calibrations or are responsible for your equipment, once added they will be available in the drop-down lists for fields like *Who Calibrated* and *Responsible Technician*. This screen has several different sections.



Figure 12.2

#### Find Quality Products Online at:

# www.GlobalTestSupply.com

When the screen initially opens (see figure 12.2) the *Employees Not in this Group* box shows all employees that have been entered into the system and the *Current Members of this Group* box shows the names of all employees who belong to the "Technician" group in the system

If you need to add one or more existing employees to the current group, highlight the names in the *Employees Not in this Group* box and click the <u>Assign</u> button. The employees' names will be moved to the *New Members to be Added* box.

If you need to add a new employee to the group, type their *Name*, (*Title* and *Email* are optional) into the fields labeled as such and click the <u>Add and Assign</u> button. The employee's name will be moved to the *New Members to be Added* box. (This also adds a new EMPLOYEE record to the system for this person.) If you need to remove a new employee from the group, highlight the name in the *New Members to be Added* box and click the <u>Deassign</u> button.

Once you have made all of your changes, click the <u>Save</u> button, the names in the *New Members to be Added* will be automatically moved up to the *Current Members of this Group* section and the screen will close. You may add Technicians names to groups by using this menu option, or you can add them by clicking the <u>New</u> button next to the *Responsible Technician* or *Who Calibrated* fields in various screens throughout the program.

#### 12.2.10 Calibration Type

This list option allows you to create calibration types such as "Scheduled", "Repair" or "Initial Cal" that may be assigned to your calibration records. This screen allows you to Add or Delete calibration types. If the calibration type is in use it cannot be deleted. You are limited to 50 characters in this field.

#### 12.2.11 Classification

This list option allows you to create classifications such as "GMP Critical" or "Non-GMP" that may be assigned to an Instrument, Loop, Equipment and Test Instrument Records. You must add new classifications from this menu because there is no <u>New</u> button for it anywhere else in the system. You are limited to 50 characters in this field.

#### 12.2.12 Document Type

This list option allows you to define different document types such as "SOP", "Assay" or "Manufacturer's Specifications" that may be applied to document records that you store in your database. You are limited to 50 characters in this field. Placing a check mark in the *Make Available as a SOP* box allows documents of that type to be available on the *Document ID* drop down list found in many other screens in the program. The *Document ID* field can be found in the following screens: MASTER INSTRUMENT RECORD, LOOP RECORD and TEST INSTRUMENT RECORD. A document number that appears in a *Document ID* field elsewhere in the program is considered to be that item's SOP (Standard Operating Procedure) and will appear on the *SOP* tab of the CALIBRATION screen when a calibration record is entered for that item. Keep in mind that if none of the document IDs whose records have not been given a *Document Type* at all will be available for selection on the *Document ID* field throughout the program.

You may add document types by using this menu option, or you can add them by clicking the <u>New</u> button next to the *Document Type* field in the DOCUMENT RECORDS screen.

#### 12.2.13 Equipment Type

This list option allows you to create system types such as "Pump" or "Tank". Entries made in this screen will appear on the *Equipment Type* drop down list in the EQUIPMENT RECORD screen. You may add equipment types by using this menu option, or you can add them by clicking the <u>New</u> button next to the *Equipment Type* field on the EQUIPMENT RECORD screen. You are limited to 50 characters in this field.

Find Quality Products Online at:

# Chapter 13 Document Records Screen

#### Title

#### Page

13.1 Document Records	. 13-3
13.2 Tabbed Notebook Section	. 13-4
13.2.1 General Info Tab	. 13-4
13.2.1.1 Document Type	. 13-4
13.2.1.2 Effective Date, Expiration Date, Date Active, & Date Inactive	. 13-4
13.2.1.3 Location & Building	. 13-4
13.2.1.4 Active	. 13-4
13.2.1.5 Physical Location	. 13-4
13.2.1.6 SOP Type	. 13-4
13.2.1.7 Linked File	. 13-4
13.2.1.8 Review Frequency, Review Date, Last Review Date, Next	
Review Date	. 13-5
13.2.2 Signatures Tab	. 13-5
13.2.3 Procedure Tab	. 13-5
13.3 File Menu Options	. 13-5
13.3.1 New Record[Ctrl + N]	. 13-5
13.3.2 Save Record[Ctrl + S]	. 13-5
13.3.3 Find Record[Ctrl + F]	. 13-5
13.3.4 Print Record[Ctrl + P]	. 13-5
13.3.5 Print Preview]	. 13-5
13.3.6 List Records	. 13-5
13.3.7 Delete Record	. 13-6
13.3.8 Close Form	. 13-6
13.3.9 Exit DPCTrack2	. 13-6

# www.GlobalTestSupply.com

## 13.1 Document Records

Document records are required for most quality assurance programs. The DOCUMENT RECORDS screen is accessed by clicking the speed button labeled "**Documents**" on the Record Toolbar. DPCTrack2 gives you the ability to create, manage and link many different types of documents to other types of records in the system.

The DOCUMENT RECORDS screen is used to add, display, modify and, if necessary, delete document records. All document numbers that are entered in this screen will appear on the *Documents* tab of other screens in the program so that they may be associated with records of that type. In addition, some document numbers may appear on the *Document ID* drop-down list that can also be found in other screens in the program. (Refer to the "Document Type" section in Chapter 12 for more information about making documents available on *Document ID* drop-down lists.) Keep in mind however, that once document number has been associated with another record in the program, it can no longer be deleted from the system.



Figure 13.1

**Find Quality Products Online at:** 

# www.GlobalTestSupply.com

## 13.2 Tabbed Notebook Section

The tabbed notebook section of the DOCUMENT RECORDS screen contains a total of three (3) different sub-screens or "pages" available for data entry. To open a page, click its tab with your mouse. Each page and its associated fields are described below.

#### 13.2.1 General Info Tab

The *General Info* tab (shown in Figure 13.1) allows you to enter general information about the document like its Type, Physical Location, Active Date, etc. In addition you may give the document a *Review Frequency* and *Review Dates* which may assist you in document management.

#### 13.2.1.1 Document Type

This field allows you to define the document type by selecting one from the drop down list or selecting "New" and creating one. You are limited to 50 characters in this field. If you choose a Document Type that does not have the check box "Make Available as an SOP" checked then it will not be displayed in the drop down fields for Instruments, Loops & Test Instruments.

#### 13.2.1.2 Effective Date, Expiration Date, Date Active, & Date Inactive

These date fields are optional unless you would like to receive a Reminder when the Document expires. (If no date is filled in for expiration date, no reminder will be generated).

#### 13.2.1.3 Location & Building

For more information on these fields see Chapter 12.

#### 13.2.1.4 Active

This check box must be checked in order to receive reminders. Only one revision can be checked as Active.

#### 13.2.1.5 Physical Location

This field may be populated with up to 100 characters.

#### 13.2.1.6 SOP Type

This field may be populated with up to 50 characters.

#### 13.2.1.7 Linked File

The *Linked File* field on this screen allows you to select an external file that may then be accessed directly from the screen. Additionally, you may also enter the name of URL link to be invoked directly from DPCTrack2. If a file is to be linked, then it must be inserted by clicking the (...) button and selecting from one of the following:

#### 13.2.1.7.1 Choose File

Selecting this option will open a new screen where you may choose a file that you have access to on your computer or network. Once the file has been chosen select Open and you will be returned to the Document Record screen with the file you chose filled in on the Linked File. To access and view the file, either double-click the file name in the field or by clicking the (...) button and selecting "Open Link".

#### 13.2.1.7.2 Enter URL

#### 13.2.1.7.3 Clear Link

Selecting this option will clear the Linked File.

#### 13.2.1.7.4 Open Link

This option will open the Link. You may also double click the link to open it.

#### 13.2.1.8 Review Frequency, Review Date, Last Review Date, Next Review Date

These fields are to help you manage your Document Records. The frequency and date fields have to be filled in manually. This is optional.

#### 13.2.2 Signatures Tab

This tab allows for users to signoff and Approve the document. Also listed is the Entered By and Modified By information.

#### 13.2.3 Procedure Tab

This tab may be used to type information regarding the document that will be available for review during a calibration event if the Document is assigned to the master record. There is a limit of 3,996 characters of text that can be entered.

## 13.3 File Menu Options

#### 13.3.1 New Record[Ctrl + N]

Selecting this option will open a blank Document Record screen. The Document ID and Revision Number must be entered before you can save the record.

#### 13.3.2 Save Record[Ctrl + S]

Selecting this option will save modifications made to the Document Record.

#### 13.3.3 Find Record[Ctrl + F]

Selecting this option will open the Find Document Record screen. The Document ID and Revision Number must be entered to find the Document Record.

#### 13.3.4 Print Record[Ctrl + P]

Selecting this option will print the Document Report for the current document open. In addition, the Page Setup screen will open allowing parameters to be defined by the user that help determine how a printed page will appear. The parameters include the size, source, page orientation, margins, and printer selection.

#### 13.3.5 Print Preview]

Selecting this option will allow you to view the Document Report for the current document open.

#### 13.3.6 List Records

This List option differs from the one on the Header Row as it will let you choose between 4 (four) different list options:

- List All Will list All records, Current Query remains "Default".
- List Active Will list all records with that have the Active checkbox checked, Current Query changes to (Active = "True").
- List Inactive Will list all records with that have the Active checkbox unchecked, Current Query changes to (Active = "False").
- List Approved Will list all records that have the Approved checkbox checked, Current Query changes to (Approved By <> "").

#### 13.3.7 Delete Record

Use this option to Delete a Document Record. In order to be able to Delete a Document you must be a member of a Group that has Delete access to Document records and the Document is not associated with any records.

#### 13.3.8 Close Form

Closes the Document screen.

#### 13.3.9 Exit DPCTrack2

Use this option to close DPCTrack2. You will be prompted to save any work before DPCTrack2 closes.

# Chapter 14 Equipment Record Screen

#### Title

#### Page

14.1 Equipment Records	
14.2 Tabbed Notebook Section	
14.2.1 General Info Tab	
14.2.1.1 Location, & Building	
14.2.1.2 Equipment Type	
14.2.1.3 Manufacture	
14.2.1.4 Model Number, & Serial Number	
14.2.1.5 Status	
14.2.2 A dditional Info Tab	
14.2.2.1 Department	
14.2.2.2 P+ID Number, & P+ID Revision Number	
14.2.3 Instruments/Loops Tab	
14.2.4 User Defined Tab	
14.2.5 Notes Tab	
14.3 File Menu Options	
14.3.1 New Record[Ctrl + N]	
14.3.2 Save $\operatorname{Record}[\operatorname{Ctrl} + S]$	
14.3.3 Find Record[Ctrl + F]	
14.3.4 List Records	
14.3.5 Delete Record	
14.3.6 Close Form	
14.3.7 Exit DPCTrack2	

Find Quality Products Online at:

## 14.1 Equipment Records

In DPCTrack2, "Equipment" is defined as a unit that does not get calibrated, but consists of one or more Instruments and/or Loops that do. Equipment may be control panels, vessels, machinery, etc. Although it is not necessary to create Equipment records or use this section of the program, associating Instruments and Loops with Equipment is a good way to create more detailed records. It also gives you the ability to run advanced queries that include Equipment IDs, allowing you to isolate your data and efficiently assign work. The IDs of all Equipment records entered in this screen will be added to the *Equipment ID* drop-down list in the MASTER INSTRUMENT and LOOP screens.

The EQUIPMENT RECORD screen shown below in Figure 14.1 is used to add, modify and if necessary, delete Equipment records. However, once an Equipment ID has been associated with another record it can no longer be deleted from the system.

	Company	Equipment Record (Add)								
Equipment Button	company			Advanced Query Name						
And the Designation	Instruments	Equipment ID	Foundated Description							
Equipment	2 Loops	EQP-001	Equipment							
Button	Equipment	Beneral Info Additional Info Instruments/Loops User Defined Notes								
	Test Instruments	Location		Building	-					
21	Calibrations	Equipment Type	· New	Status In Service	· New					
	P Documents	Manufacturer Asherott	· New	Classification	•					
	Upload/Download	Model Number 123A		Serial Number						
	Logged Data									
		New Current Query: Def	ault							

Figure 14.1

## 14.2 Tabbed Notebook Section

The tabbed notebook section of the EQUIPMENT RECORD screen contains five (5) different sub-screens or "pages" available for data entry. To open a page, click its tab. Each page and its associated fields are described below.

#### 14.2.1 General Info Tab

This tab page (displayed in Figure 14.1) contains the fields in which to enter the general information about the Equipment.

#### 14.2.1.1 Location, & Building

These fields may be filled in from the drop down lists. For more information see Chapter 12.

#### 14.2.1.2 Equipment Type

This field can be populated either be selecting from the drop down list or creating a new Equipment Type. For more information see Chapter 12.

#### 14.2.1.3 Manufacture

This field can be populated either be selecting from the drop down list or creating a new Manufacture. For more information see Chapter 12.

#### 14.2.1.4 Model Number, & Serial Number

These fields can be filled in as needed. Each field can contain up to 100 characters.

#### Find Quality Products Online at:

# www.GlobalTestSupply.com

#### 14.2.1.5 Status

This field can be populated either be selecting from the drop down list or creating a new Status. For more information see Chapter 1214.2.1.6 Classification.

This field may be filled in from the drop down list. For more information see Chapter 12.

#### 14.2.2 Additional Info Tab

The Additional Info tab contains three (3) additional fields. On this screen, you will also see the date, time and person(s) responsible for the entry of the record and for the most recent modification made.

#### 14.2.2.1 Department

This field can be populated either be selecting from the drop down list or creating a new Department. For more information see Chapter 12.

#### 14.2.2.2 P+ID Number, & P+ID Revision Number

These fields can be filled as needed. Each field can contain up to 50 characters.

#### 14.2.3 Instruments/Loops Tab

The *Instruments/Loops* tab on this screen (see Figure 14.2) lists all of the Instruments and Loops that have been associated with the Equipment record. None of the data shown on this tab is modifiable, nor can the Instrument or Loop records shown be accessed directly from this screen.

Description         Instruments/Loops         User Defined         Notes           Instrument ID         Description         Instrument Type         Manufacturer         Model Number         Serial Number           TT-001         Temperature Transmitter         Temperature Tra General         TT111549         1597342984TT           TS-01         Temperature Switch         General         TS100         449293093           TS-02         Temperature Switch 2         General         TS100         3334445555	_
Instrument ID         Description         Instrument Type Manufacturer         Model Number         Serial Number           TT-001         Temperature Transmitter         Temperature Tra General         TT111549         1597342984TT           TS-01         Temperature Switch         General         TS100         449293093           TS-02         Temperature Switch 2         General         TS100         333445555	
T1-001         Temperature Transmitter         Temperature Transmiter         Temperature Transmitter	
TS-01         Temperature Switch         General         TS 100         443233033           TS-02         Temperature Switch 2         General         TS100         3334445555	
T3-02 Temperature Switch 2 deneral T3100 3334443333	
Loop D Description Document ID Status Besponsible Technician	

Figure 14.2

#### 14.2.4 User Defined Tab

This tab page contains all user defined variables (fields) that have been set up for the EQUIPMENT RECORD screen. (See Chapter 10 for instructions about how to set up user defined variables.)

#### **Find Quality Products Online at:**

# www.GlobalTestSupply.com

#### 14.2.5 Notes Tab

This tab page is used to enter and/or view notes for the Equipment record. To enter a new note, click the <u>Add a Note</u> button. Type text into the field provided and click the <u>Save</u> <u>Record</u> button on the screen's toolbar. Once a note is entered and saved for the record it cannot be modified or deleted. As new notes are added, they will be inserted at the top of those listed (most recent notes first). As the record acquires multiple notes, you may change their order by clicking the <u>Sort Ascending/Descending</u> button.

## 14.3 File Menu Options

#### 14.3.1 New Record[Ctrl + N]

Selecting this option will open a blank Equipment Record screen. The Equipment ID must be entered before you can save the record.

#### 14.3.2 Save Record[Ctrl + S]

Selecting this option will save Equipment data.

#### 14.3.3 Find Record[Ctrl + F]

Selecting this option will open the Find Equipment screen allowing searches by Equipment ID or Serial Number.

#### 14.3.4 List Records

Selecting this button will open the list screen, where all records are listed. On this screen you have the option to scroll through the field or activate an Advanced Query.

#### 14.3.5 Delete Record

This option will allow you to Delete the Equipment Record. If the Equipment has any components (Instruments and/or Loops) you will not be able to Delete the record. (See Figure 14.3) If you do not have access to Delete Equipment Records, this option will be grayed out and not available.



Figure 14.3

# www.GlobalTestSupply.com

#### 14.3.6 Close Form

Closes the Equipment screen.

#### 14.3.7 Exit DPCTrack2

Use this option to close DPCTrack2. You will be prompted to save any work before DPCTrack2 closes.

**Find Quality Products Online at:** 

# Chapter 15 Instrument Record Screen

#### Title

#### Page

15.1 Ins	strument Records	15-3
15.2 Ta	bbed Notebook Section	15-3
15.2.1	General Info Tab	15-3
15.2.1.1	Manufacture	15-3
15.2.1.2	Model Number, & Serial Number	15-3
15.2.1.3	Status, & Status Modification Date	15-4
15.2.1.4	Department	15-4
15.2.1.5	Classification	15-4
15.2.1.6	Equipment ID	15-4
15.2.1.7	Instrument Type	15-4
15.2.1.8	Document ID	15-4
15.2.1.9	Calibration Frequency	15-4
15.2.1.10	First Cal Date, Last Cal Date, & Next Cal Date	15-4
15.2.1.11	Keep on Schedule	15-4
15.2.1.12	Approved By, & Approved On	15-5
15.2.1.13	Associated Loops	15-5
15.2.2	Calibration Points Tab	15-5
15.2.2.1	Test Type	15-6
15.2.2.2	# Cal Points	15-8
15.2.2.3	Show DPC Settings	15-9
15.2.2.4	Input Signal Information	15-11
15.2.2.5	Output Signal Information	15-12
15.2.2.6	Stated Accuracy	15-12
15.2.2.7	Entering Data and Calculating Limits in the Calibration	
	Specifications Grid	15-13
15.2.2.8	Modifying Data in the Calibration Specifications Grid	15-14
15.2.2.9	Test Point Groups	15-15
15.2.3	Additional Info Tab	15-16
15.2.3.1	Location & Building	15-16
15.2.3.2	Responsible Technician	15-16
15.2.3.3	Warranty Exp Date & Exp Man Hrs	15-16
15.2.3.4	P+ID Number & P+ID Revision Number	15-17
15.2.3.5	Vendors	15-17
15.2.4	User Defined Tab	15-17
15.2.5	Notes Tab	15-17
15.3 Fil	e Menu Options	15-17
15.3.1	New Record [Ctrl + N]	15-17
15.3.2	Copy Record $[Ctrl + Y]$	15-17

15.3.3	Save Record [Ctrl + S]	
15.3.4	Find Record [Ctrl + F]	
15.3.5	List Records $[Ctrl + L]$	
15.3.6	Show Work History [Ctrl + K]	
15.3.7	Delete Record	
15.3.8	Close Form	
15.3.9	Exit DPCTrack2	

Find Quality Products Online at:

www.GlobalTestSupply.com

## 15.1 Instrument Records

The INSTRUMENT RECORD screen is used to add, display, modify and, if necessary, delete Instrument records. This screen is where you enter all of the Instrument's information that will remain constant, such as model number and serial number. The Instrument records that you enter will act as the templates for creating calibration records for those Instruments. The INSTRUMENT RECORD screen is accessed by clicking the speed button labeled "Instruments" on the Record Toolbar.

To add an Instrument select New and enter an Instrument ID, this is limited to 32 characters. The Description field is optional and is limited to 100 characters.

Instrument Record Button	Ele Por Rebous ress Helb									
	Fluke Customer	View Reminders	III DP	CTrack Explorer						
	Company	E Instrument	and the second second							
			Advanced Query Name							
	Insuments	TagID Description				Last Cal Date Next Cal Date				
	Loops	E/AMI/P-TRANS	I to P Transd	ucer		11/15/2010	85/31/2011			
	© Equipment	General Info Calibration Points	Additional Info   Us	er Defined   Notes						
	Test Instruments	ABB	• New	Department	• New	in the second second				
	Calibrations	Model Number	_	Classification	-	Calibration Frequency First 1 Semi-Annual • 11/1	Cal Date 5/2010			
	Documents	Serial Number		Equipment ID		Last Cal Date Next Cal 11/15/2010 05/31/2	Date			
	Upload/Download	Status In Service	• New	Instrument Type I to P Transducer	· New	F Keep On Schedule				
	Logged Data	Status Modification Date		Document ID						
		Associated Loops			Approved By Administrator					

Figure 15.1

## 15.2 Tabbed Notebook Section

The tabbed notebook section of the INSTRUMENT RECORD screen contains five (5) different sub-screens or "pages" available for data entry. These pages are logically grouped on the tabs of the notebook. To open a tab page, click it with your mouse. Each page and its associated fields are described below.

Note

It is not necessary to fill in all empty fields. However, you must enter an Instrument ID to save a new record.

#### 15.2.1 General Info Tab

This tab (Figure 15.1) allows you to enter general information about the Instrument.

#### 15.2.1.1 Manufacture

This field may be populated by either selecting from the drop down menu or entering a new Manufacture. See Chapter 12 for more information.

#### 15.2.1.2 Model Number, & Serial Number

These fields can be filled in as needed. Each field can contain up to 100 characters.

15-3

### Find Quality Products Online at:

# www.GlobalTestSupply.com

#### 15.2.1.3 Status, & Status Modification Date

This field may be populated by either selecting from the drop down menu or entering a new Status. See Chapter 12 for more information. Upon saving the record the Status Modification Date field will be filled in. This field will also change if the Status is changed from the Calibration screen.

#### 15.2.1.4 Department

This field may be populated by either selecting from the drop down menu or entering a new Department. See Chapter 12 for more information.

#### 15.2.1.5 Classification

This field can be filled in from the drop down list. For more information see Chapter 12

#### 15.2.1.6 Equipment ID

This field can filled in from the drop down list. For more information see Chapter 14

#### 15.2.1.7 Instrument Type

This field may be populated by either selecting from the drop down menu or entering a new Instrument Type. See Chapter 12 for more information.

#### 15.2.1.8 Document ID

This field can be filled in from the drop down list. For more information see Chapter 13

#### 15.2.1.9 Calibration Frequency

This field can be filled in from the drop down list. For more information see Chapter 12

#### 15.2.1.10 First Cal Date, Last Cal Date, & Next Cal Date

These fields do not have to be filled in when entering a new Instrument. These fields will populate when a passing Calibration is entered. It is recommended to at least fill in the next Cal Date field, as this will generate reminders if the record has an Active status.

#### 15.2.1.11 Keep on Schedule

In addition to the check box here, this field may be selected at the Company level. (Chapter 9) If this field is already selected, then this field will already be checked. This can be overridden on an individual basis.

A checkmark in this box will instruct the system to maintain the exact calibration frequency and date you have specified for the Instrument, despite calibrations or work that may be performed on a date that does not exactly match the Instrument's due date. For example, imagine that you have an Instrument with a yearly calibration frequency that is due for calibration on June 1, 2003, but is calibrated early, on May 25, 2003. As long as the *Keep On Schedule* check box is marked for this item, DPCTrack2 will roll the calibrated Instrument's next due date forward to June 1, 2004 (maintaining June 1<sup>st</sup> as the date to be calibrated). However, if this box were not checked and the same situation occurred, the system would have rolled the next due date forward to May 25, 2004 (maintaining the yearly frequency, but changing the actual date to be calibrated). Please note that the *Keep On End Of Month* calibration frequency setting will override the *Keep On Schedule* setting. See Chapter 12 for more details about entering calibration frequencies.

15-4

#### 15.2.1.12 Approved By, & Approved On

When this box is checked and saved, the fields will be filled in with the user and a date & time when it was approved. (Please note that if you have not been granted approval power for Instruments, the *Approved by* box will be grayed out and inaccessible.)

#### 15.2.1.13 Associated Loops

If the Instrument has been associated with any Loops, then that information will also be displayed in the *Associated Loops* box. If this is the case, then those Loop records can be invoked directly from this screen by double-clicking their listings in the box.

#### 15.2.2 Calibration Points Tab

This page (Figure 15.2) contains fields in which to enter calibration information for the Instrument, such as # of cal points, stated accuracy, resolution, etc. This information is then used by the system to calculate the high and low spec and control limits for the Instrument's calibration. DPCTrack2 allows you to create test point groups, which may help you organize this information, especially if the Instrument requires a more complicated calibration. Not all Instruments will require the use of multiple test point groups, however an Instrument like a multimeter may require that it's high and low limits be calculated from multiple ranges so the use of several different test point groups would be imperative.

E Instrument											
				?	00	00		Advanced Que	ery Name		30
Tag ID         Description         Last Cal Date         Next Cal Date           EXAMINDICATOR         Temperature Indicator         04/28/2010         04/30/2011											
General Info Calibration Points Additional Info User Defined Notes											
Previous Group     Next Group	Test Poin Group Na Tempera	it Group 1 of 1 ame ature Indicato	r	Test	Туре			# Cal Pts ▼	3	Show DPC Se	ettings
Imput Signal       Input Signal       Input Type       In Res       In Low Range       In High Range       Correlation to Output         C       New       .01       0.00       100.00       Linear											
Input Specifications Accuracy Output Specifications Spec Limits											
In Val In Type	In Res	Std Accy	Rng %	Rdg %	+/-	Out Res	Out Val	Out Type	Low	High	
0.00 C	.01	Pct of Ra	0.500000	0.000	0.00	.01	0.00	С	-0.50	0.50	
50.00 C	.01	Pct of Ra	0.500000	0.000	0.00	.01	50.00	С	49.50	50.50	
100.00 C	.01	Pct of Ra	0.500000	0.000	0.00	.01	100.00	С	99.50	100.50	

Figure 15.2

# www.GlobalTestSupply.com

To begin adding this information, you must first click the <u>Add Group</u> button, which will bring up blank calibration specification fields and a blank grid. Your screen will look similar to that in Figure 15.2 just without any data. You may enter any *Group Name* you like (up to 50 characters) and continue through the rest of the fields. The information entered for each group will remain unique to that group. As you enter information into each field and hit the tab key, the values you have entered or the selections you have made will automatically be inserted into the calibration specifications grid below. The number of rows in the grid is determined by the number of test points you enter into the # of *Cal Pts* field.

#### 15.2.2.1 Test Type

For standard input-output tests, leave this field blank. Two additional test types are provided and are needed, described below.

#### 15.2.2.1.1 Manual Pass/Fail

After the Test Type Package is selected in the Test Type field on the Calibration Points tab of the instrument record, the screen refreshes to display the Manual Pass/Fail format as shown in Figure 15.3. This can be used to capture the Pass or Fail of any test without measurement data, either via Calibration record entry or via DPC download.

**Test Inputs:** The inputs can be set to default values to appear when entering a Calibration record, they can also be changed during a Calibration event.

- <u>As Found Result</u>
  - Pass Select Pass if there are no As Found out of tolerances.
  - Fail Select Fail if there are As Found out of tolerances.
  - o Unknown Select Unknown if As Found vales are not applicable.
  - **Blank** Leaving the field blank will default to "Not Entered" which will have the same result as "Unknown".

#### <u>As Left Result</u>

- **Pass** Select Pass if there are no As Left out of tolerances.
- Fail Select Fail if there are As Left out of tolerances.
- Unknown Select Unknown if As Left vales are not applicable.
- Not Entered Select Not Entered if As Left values were not recorded.
- o Blank leaving this field blank will result in the Pass/Fail logic to be
- determined by the As Found Result.
- <u>Test Performed</u>
  - No If this field is set to 'No' or is left Blank, no failure fields will be set regardless of other data entered for this Group. The Calibration can be saved as either Passed or Failed.
  - **Yes** If set to 'Yes' it will use the information in the As Found and As Left fields to determine the Pass/Fail results.
| E Instrument (Add)            |  |                               |                |                      | -BX            |
|-------------------------------|--|-------------------------------|----------------|----------------------|----------------|
|                               |  | • • • • • •                   | Advanced       | Query Name           | - C ()         |
| Tag ID<br>TT-001              | Description<br>Temperture Transr                                   | nitter                        |                | Last Cal Date<br>7 7 | Next Cal Date  |
| General Info Calibratio       | n Points Additional Info User De                                   | fined Notes                   |                |                      |                |
| Previous Group     Next Group | Test Point Group 1 of 1 Group Name Temperature Default Test Values | Test Type<br>Manual Pass/Fail | •              | Show                 | w DPC Settings |
| Add Group                     | As Found Result  | As Left Result                | Test Performed | Y                    |                |
| Move Group Down               | Ţ Setup Messages ( 0)  | ➡ Wrapup Messages (0)         |                |                      |                |
|                               |  |                               |                |                      |                |
|                               |  |                               |                |                      |                |
|                               |  |                               |                |                      |                |
|                               |  |                               |                |                      |                |
| New Current Query             | : Default  |                               |                |                      |                |

Figure 15.3

# 15.2.2.1.2 Fluke Switch Test

This Test Type allows users to perform a Switch test via the DPC or via manual entry on the Calibration screen with one or two set points and an optional reset point check. See Figure 15.4

Tag ID EXAMIVE_TRANS	Description I to P Transducer	Last Cal Date 111/15/2010	Next Cal Date 05/31/2011
eneral Info Calibration	Points Additional Info User Defined Notes   Test Point Group 1 of 1 Group Name Test Type [Transducer   Test Setup # of Set Points Input Type Resolution Trin Function	I B Sho	w DPC Settings
4 Move Group Up Move Group Dawn	One         ImA         Ima <td>Deadband Max 0 0.00</td> <td></td>	Deadband Max 0 0.00	
	Direction Set Point Set State Set Point Re 0.00 0 00 0.00	ange Deadband Rang DmA mA	ge

Figure 15.4

# www.GlobalTestSupply.com

# **Test Setup**

- # of Set Points Choice of One or Two.
- Input Type The list of Signal Types is available for selection. This is the engineering unit used to drive the switch to its Set or Reset State
- Resolution Select up to eight decimal places (0.0000001)
- Trip Function
  - o Trip Continuity
  - o Trip DCV
  - o Trip ACV
- Step Size To set the increment used with the up/down arrow keys on the DPC unit during a manual switch test execution.
- Set Point +/- Used to determine the Spec Limits for each Set Point
- Has Reset Point Checked, there will be "Deadband" fields
- Deadband Min & Deadband Max The deadband is the range through which an input can be changed without causing an observable response; these fields represent the Low and High pass/fail limits for the deadband, which is found when the Reset Point is detected

**Set Point Settings** – For each Set Point the user must configure the following settings. Each setting corresponds to a similar or equivalent setting:

- Direction
  - Low Set Point trips on a decreasing signal
  - High Set Point trips on an increasing signal
- Set Point the target Set Point value
- Set State
  - For Trip Continuity:
    - Short Set Point trips when the circuit is closed
    - Open Set Point trips when the circuit is opened
  - o For Trip DCV or ACV
    - Low Set Point trips at a low voltage reading
    - High Set Point trips at a high voltage reading
- Set Point Range and Deadband Range These read-only fields help the user by displaying the acceptable Set Point and Reset Point values for passing the test, assuming the Set Point is found to match the target set point exactly.

#### 15.2.2.2 # Cal Points

The number of rows in the grid is determined by the number of test points you enter into the # of Cal Pts field. You can enter a maximum of 999 calibration points for each group. You can increase the number of calibration points and they will be added to the end of the list. If you decrease the number of calibration points you will receive a warning upon tabbing off the field alerting the user that data will be lost. If you select "Yes" at the warning the points will be deleted from the bottom level(s). To add an additional calibration point in a specific placement, click any where on the grid below where you

**Find Quality Products Online at:** 

# www.GlobalTestSupply.com

would like a new point added and select "Edit" & "Insert Before Current Test Point". To delete a specific point, click anywhere on that line and select "Edit" & "Delete Current Test Point". You will NOT receive a warning. To undo your changes, click on the red X to cancel your changes.

# 15.2.2.3 Show DPC Settings

Clicking the <u>Show DPC Settings</u> button will allow you to configure your Source Mode and Measure Mode. This provides the compatibility between the signal type and the Source Mode and Measure Mode

# 15.2.2.3.1 Source Mode Options

Depending on the Source Mode that you select from the dropdown, different options will appear: (not all options will be available for all Source Modes)

The following options are available on all SOURCE MODE selections.

• Loop Power Source The calibrator supplies loop power at 28 V or 24 V DC

24V

28V NOTE: The 75x Series does not support 28V Loop Power, but attempts to download devices using 28V will automatically use 24V.

External (Off)

Use Default – The setting is controlled by the Options tab of the Upload/Download screen

- **Delay (sec)** If the process instrument needs more time to settle than the calibrator's normal settling time (about 2 seconds) at each new stimulus level, enter that time in seconds for **Delay**.
- Reading Method

Normal (UEV Off)

**UEV On(User Entered Value)** Enables technicians to record calibration results that were sourced and/or measured by other devices such as panel meters or readout-only devices.

**Use Default** – The setting is controlled by the Options tab of the Upload/Download screen

• Unit Type

**Custom Units** enable you to map one unit to another, such as mV to °C or °F. Allows you to use the Fluke 74x or 75x Series with millivolt output accessories such as the Fluke 80T-IR Temperature Probe, and to document tests using non-supported units such as parts per million or revolutions per minute.

**Normal** – No additional scaling is performed. **PCT Display** – lets you scale the output as a percentage in accordance with the input requirements.

• **Damping** - smoothing of the last several readings,

On

Off

# www.GlobalTestSupply.com

When the following SOURCE MODES are selected, these additional selections will be available:

#### Frequency

• Wave Form – for more information see your Fluke Documenting Process Calibrator Users Manual

Sine

Square

• Amplitude – Manually entered numeric value

**RTD** - Resistance Temperature Detectors

• Probe Type

RTD Cu 10, a =0.004270 RTD Ni 120, a=0.006720

- RTD Pt 100, a=0.003850
- RTD Pt 100, a=0.003916
- RTD Pt 100, a=0.003926 (IPTS-68)
- RTD Pt 1000, a=0.003850
- RTD Pt 200, a=0.003850
- RTD Pt 500, a=0.003850
- # of Wires The DPC can only handle 2 Wire RTD sourcing.
- TC Thermocouple
- **Probe Type** Type of Thermocouple

В	К	Т
BP	L	U
С	Ν	ХК
E	R	
J	S	

CJC Settings - reference (cold) junction temperature compensation

- External
- Internal

TC Linear mV When simulating temperature in As Found/As Left procedures, steps may be linear by mV potential.

- TC Linear 0%
- TC Linear 100%

# Find Quality Products Online at:

# www.GlobalTestSupply.com

# 15.2.2.3.1 Measure Mode Options

Depending on the Measure Mode that you select from the dropdown, different options will appear: (not all options will be available for all Measure Modes)

The following options are available on all MEASURE MODE selections.

- **Reading Method** same as SOURCE MODE setting
- Unit Type same as SOURCE MODE setting
- **Damping** same as SOURCE MODE setting
- Min/Max Disp This option activates or deactivates the corresponding front-panel option on your DPC for Min and Max display.

On

Off

When the following Measure Modes are selected, these additional selections will be available:

# RTD

- Probe Type- same as SOURCE MODE setting
- # of Wires The DPC can handle 2, 3 or 4 wires for measure

TC

- **Probe Type** same as SOURCE MODE setting
- CJC Mode same as SOURCE MODE setting
- **Digital PV** This Mode is used to capture HART PV values for the As Found and As Left readings. It is only used for Measure.

# 15.2.2.4 Input Signal Information

#### 15.2.2.4.1 Input Type

Selection of the *Input Type* can be made from that field's drop-down list, which contains the signal types that have been entered through the **Lists** menu. (See Chapter 12) If the signal type needed is not yet on the list, you can add it through the "Lists" menu. You may enter up to 50 characters in this field.

### 15.2.2.4.2 In Resolution

When adding a new test point group, the value shown in the *In Res* field will default to the same value set in the *Company Record* screen, see Chapter 9. To select a different input resolution, select it from the *In Res* field's drop-down list. As you select different resolutions, you will notice that the *In Low Range* and *In High Range* fields will adjust accordingly.

# 15.2.2.4.3 In Low Range & In High Range

The *In Low Range* and *In High Range* fields are used to record the Instrument's full *input* range. Any numeric value may be entered into each of these fields. Entering an Instrument's input range is important if you plan to allow the system to auto-assign the Instrument's input values into the calibration specifications grid.

# www.GlobalTestSupply.com

### 15.2.2.5 Output Signal Information

#### 15.2.2.5.1 Output Type

Entering the Instrument's *Output Type* is done in the same manner that you selected the *Input Type*. Both the *Input* and *Output Type* drop-down lists will contain the same selections. If the signal type needed is not yet on the list, you can add it through the "Lists" menu. You may enter up to 50 characters in this field.

#### 15.2.2.5.2 Out Resolution

When adding a new test point group, the value shown in the *Out Res* field will default to the same value set in the *Company Record* screen, see Chapter 9. To select a different output resolution, select it from the *Output Res* field's drop-down list. As you select different resolutions, you will notice that the *Out Low Range* and *Out High Range* fields will adjust accordingly.

# 15.2.2.5.3 Out Low Range & Out High Range

The *Out Low Range* and *Out High Range* fields are used to record the Instrument's full *output* range. Any numeric value may be entered into each of these fields. If the Instrument's stated accuracy uses "Percent of Range" in any way, it is very important that you enter the correct output range for the device since this is used in conjunction with the *Range Acc* % to calculate the item's low and high limits.

#### 15.2.2.6 Stated Accuracy

There are five stated accuracies that come standard with the system. The default value is Percent of Range

#### 15.2.2.6.1 Percent of Range

Selecting "Pct of Range" will instruct the system to calculate the high and low limits from a percent of the Instrument's full output range. For example, 1% of a range of 0-100 psig would make the limits plus or minus 1 psig at each test point. To use this stated accuracy, you **must** fill in the *Out Low Range* and *Out High Range* fields. (Note: This may also be used in conjunction with a *Plus/Minus* value.)

#### 15.2.2.6.2 Percent of Reading

Selecting "Pct of Reading" will instruct the system to calculate the high and low limits from a percent of each test point's output value. For example, 1% of a test point of 50 Deg C would make the limits for that test point plus or minus 0.5 Deg C. 1% of a test point of 75 Deg C would make the limits for that test point plus or minus 0.75 Deg C. (Note: This may also be used in conjunction with a *Plus/Minus* value.)

### 15.2.2.6.3 Percent of Reading Range

Selecting "Pct of Reading Range" will instruct the system to use a combination of the *Range Acc%* and the *Reading Acc%* to calculate the high and low limits. For example, imagine you have a test point of 10 GPM, with an output range of 0-100 GPM. With a *Range Accy%* of 1% and a *Reading Acc%* of 2%, the high and low limits would be plus or minus 1.2 GPM. (1% of 0-100 = 1 and 2% of 10 = 0.2. Therefore, 1 + 0.2 = 1.2 making the low limit 8.8 GPM and the high limit 11.2 GPM) to use this stated accuracy, you **must** fill in the *Out Low Range* and *Out High Range* fields. (Note: This may also be used in conjunction with a *Plus/Minus* value.)

# www.GlobalTestSupply.com

#### 15.2.2.6.4 Plus or Minus

Selecting "Plus/Minus" will instruct the system to calculate the high and low limits for each test point as plus or minus a discreet value. For example, +/- 3 mV at a test point of 100 mV would result in a low limit of 97 mV and a high limit of 103 mV.

### 15.2.2.6.5 Manual

Selecting "Manual" will result in the system not performing any calculations for you, even if you have entered values into the accuracy % or plus/minus fields. With this stated accuracy selected you must manually enter all input, output and limit values into the cells in the grid.

# 15.2.2.7 Entering Data and Calculating Limits in the Calibration Specifications Grid

# 15.2.2.7.1 Correlation to Output

Before input, output and low/high limit values are entered into the calibration specifications grid, you should set the *Correlation to Output* field. This is not to say that the correlation selected cannot be changed after the grid is populated, in fact DPCTrack2 will auto-update the grid if the correlation is changed any time after the grid is populated. However, the logical flow for entering data on this screen includes setting this field before entering input values and calculating limits. The default value is Linear.

The *Correlation to Output* field contains three (3) options on its drop-down list, "Linear", "Manual" and "Square Root". Selecting either "Linear" or "Square Root" for this field will enforce that type of correlation between the Instrument's input and output values. For example, if you select to enforce a "Linear" correlation, then with input values of 4.00, 12.00 and 20.00 mA (for an input range of 4-20 mA), the corresponding output values will automatically be calculated by the system as 0.00, 50.00 and 100.00 psig (for an output range of 0-100 psig). If you select a "Square Root" *Correlation to Output* then with the same input range and input values, the system would calculate the output values to be 0.00, 70.71 and 100.00 respectively. With either "Linear" or "Square Root" selected for the *Correlation to Output* field, you will be restricted from modifying any of the output values in the grid unless you reset the *Correlation to Output* field to "Manual" which allows for manual modification of the output values.

# 15.2.2.7.2 Linear or Square Root Correlation to Output

If the calibration you are going to perform on the Instrument is linear or square root and you have filled in all of the required fields in the gray section of the screen and selected the correct *Correlation to Output*, then you may click the <u>Calculate</u> button. Clicking this button will invoke a dialog box with two (2) options, "Auto-Assign Input" and "Calculate Limits". Selecting "Auto-Assign Input" will instruct the system to populate the *In Val* cells in the grid with the correct input values as calculated from the number of calibration points selected and the Instruments input range. In addition, the system will also automatically calculate and fill in the cells in the *Out Val* column reflecting the selected correlation. If you prefer to manually enter the Instrument's input values, then type those values into the appropriate cells in the grid. As you enter each input value, you will notice that the corresponding output value for each setpoint will still be automatically calculated by the system.

Once the input values have been entered into the grid either manually or by the system, then click the <u>Calculate</u> button again and select "Calculate Limits" to have the system automatically calculate the low and high spec and control limits (if applicable) for each setpoint. At this point if you elect to manually modify any of the input values then hitting the tab key after making the modification will trigger the system to recalculate that setpoint's output value and low/high limits.

Its is important to note that if you elect to enforce a linear or square root relationship between input and output values on an item's record, that you are electing to do so in any calibration records entered for the item as well. If "Linear" or "Square Root" is selected for the *Correlation to Output* field on the Instrument's record, then in the CALIBRATION screen when you enter a new calibration record for it, you will be able to modify any of the input values, but none of the output value cells in the grid will be editable. Additionally, if any of the input values are modified, the corresponding output values will automatically be recalculated to reflect the selected relationship.

# 15.2.2.7.3 Manual Correlation to Output

If you selected "Manual" for the *Correlation to Output* field, then clicking the <u>Calculate</u> button provides you with six different options, two of which are "Auto-Assign Inputs, calculate LINEAR outputs and limits" and "Auto-Assign Inputs, calculate SQUARE ROOT outputs and limits". Selecting either of these two options will fill in all of the input and output values for you and calculate the low and high spec and control limits (if applicable) all at the same time. Keep in mind that in order to utilize either of these two functions, you must have entered data into all input and output range fields.

If you would like to enter your input values manually, you may do this and then click the <u>Calculate</u> button to select "Calculate LINEAR outputs and limits" or "Calculate SQUARE ROOT outputs and limits". Selecting either of these two options will calculate the output and limit values for each test point based upon the input values you entered and the information entered into the fields in the gray area of the screen.

To have the system fill in only the grid's input values, click the <u>Calculate for this Group</u> button and select "Auto-Assign Inputs". Selecting this option will instruct the system to use a combination of the number of calibration points and the input range entered in the gray area of the screen to calculate the input values for the calibration. If you prefer to enter all input and output values manually, you may do this and then click the <u>Calculate</u> button to have the system just calculate the high and low limits.

Again, if you have elected not to enforce any specific relationship between the Instrument's input and output values by selecting "Manual" for the *Correlation to Output* field, then all of this information will be available for modification when entering a calibration record for the Instrument, as well.

# 15.2.2.8 Modifying Data in the Calibration Specifications Grid

Once the calibration specifications grid is populated, the data shown may be modified further. The *In Type, Std Accy, In Res, Out Res* and *Out Type* cells can only be modified by activating each cell's drop-down list. All other cells may be modified by typing over the current value.

To activate a cell's drop-down list, first click the cell to put it into focus, then click it a second time (towards its right side). When the drop-down arrow appears, a third click will drop the list down, allowing you to make another selection. You also have the ability to widen any or all of the columns with your mouse, to facilitate easier viewing.

If you have made changes to the grid that will affect any of the input, output and/or limit values, click the <u>Calculate</u> button again and choose the appropriate option to recalculate these.

If after making modifications to the data in the calibration specifications grid, you decide to change back to the default selections shown in the gray section of the screen, you may do this very easily by clicking the <u>Restore Defaults</u> button. Clicking the <u>Restore Defaults</u> button will invoke a box that gives you four different options, "Restore All", "Restore Input Signals to Defaults", "Restore Output Signals to Defaults". Select the appropriate option from the list.

# Find Quality Products Online at:

# www.GlobalTestSupply.com

### 15.2.2.9 Test Point Groups

To add additional test point groups to an Instrument record click the <u>Add Group</u> button for every new group needed. This will add a new group below the last one.

To delete a test point group from the record, display the group to be deleted by using the <u>Next Group</u> and <u>Previous Group</u> buttons as needed, then click the <u>Delete Group</u> button. This will remove the test point group entirely from the record and move those below it, up one.

To change the order of the test point groups in a record, display each group to be moved, one at a time, and click the <u>Move Group Up</u> and <u>Move Group Down</u> buttons as needed.

Other methods for adding new test point groups to the Instrument are located in the **Edit** menu. The "Copy Current Test Point Group" command will create a new group as a copy of the currently displayed group. This option is only available when the current record has a test point group, and if the record can be modified by the current user. The new group appears at the end of the test point group list, much like the <u>Add Group</u> function, but as a copy of the previously selected group. This feature is helpful in saving time spent performing repetitive data entry of similar groups of test points and similar ranges.

The "Load Test Point Group From Item" command opens a dialog for selecting a test point group from another item in the Company. The LOAD CALIBRATION SPECIFICATION screen is shown in Figure 15.5 below.

Load Calil	bration Spe	ecificati	ion									
Select Item Instrument Description	Туре	•	Select Inst CALIPER-	rument ID 001	•	nstrument	Load Spe Type	cs	🗸 04	<	🗶 Cance	el
	us Group	Test Poin Group Na Accurac	t Group 1 of 3 ame 9	3	Test	Туре			# Cal Pts	5	Show Group O	ptions
► Next	l Group	Input Sig Input Typ Inches	nal De	In Res	In L	ow Rang 0.0	e In Hij 00	gh Range 6.000	Correlation	n to Output		
↔ Move ( GMove Gr	Group Up roup Down	Output S Output T Inches	ignal ype	Out Res	Out	Low Ran 0.0	ge Outh 00	High Range 6.000			č.	) - ()
±¶ Delet	te Group	Stated A Plus / M	ccy inus	Range Acc	°% B/ 0% <b>+</b> [	eading Ac 0.000000	:c% PI D% <b>+</b> [	us/Minus 0.001			X nestore L	Peraduks
Inpu	t Specificatior	ns		Accu	racy			Output Sp	pecifications	Spe	c Limits	Desc🔺
ln Val	In Type	In Res	Std Accy	Rng %	Rdg %	+/-	Out Res	Out Val	Out Type	Low	High	
0.000	Inches	.001	Plus / Minus	0.000000	0.000	0.001	.001	0.000	Inches	-0.001	0.001	
1.500	Inches	.001	Plus / Minus	0.000000	0.000	0.001	.001	1.500	Inches	1.499	1.501	
3.000	Inches	.001	Plus / Minus	0.000000	0.000	0.001	.001	3.000	Inches	2.999	3.001	~
<									1			>

Figure 15.5

The screen opens with no item selected. First, select an Item Type, then an item ID (the label on this field will change according to the selected Item Type.) Selecting an item displays that item's Description and Instrument Type for Instrument records. Click Load Specs to bring in a read-only view of all the test point groups available on this item.

To copy one of these groups as a new group for the current Instrument record, navigate using the <u>Previous Group</u> and <u>Next Group</u> buttons on this form and click <u>OK</u> to select the group. The <u>Cancel</u> button can be used to cancel the addition of a new group.

# **Find Quality Products Online at:**

# www.GlobalTestSupply.com

You also have the ability within a single test point group to insert a test point or delete one from those shown. To insert a new test point, place your cursor somewhere within the row before which you would like the new test point to be placed, then select "Insert Before Current Test Point" from the **Edit** menu. To insert a new test point at the bottom of those shown, increase the "# of Cal Pts" to the number needed. A new row will be inserted at the bottom of the grid for every new test point added.

To delete a test point from the grid, place your cursor anywhere within the row of the test point to be deleted, and then select "Delete Current Test Point" from the **Edit** menu. This will remove the selected test point entirely from the test point group.

# 15.2.3 Additional Info Tab

This page (Figure 15.6) allows you to record additional information about the Instrument You can also see the date, time and person(s) responsible for the entry of the record and for the most recent modification made.

	X		0000			-
Instrument ID 230ATC1	Deso Con	ription troller		La J	ast Cal Date	Next Cal Date
ieneral Info Calibration Points	Additional	nfo User Defined   Note	25	-		
Location Concentration retour CIP 1 Building	• New	Warranty Exp Date				
Responsible Technician Guy Dominique Chanteux	New	P+ID Number	P+ID Revision Number	-		
-Vendors Available Vendors		Vendors Wł	iich Sell or Service This Instrume	nt		
Honeywell ITS, Inc. Transcat Prime Technologies, Inc. Instrumentation Technical Ser Precision Measurements, Inc.	rvices, Inc.	> < <<				
Entered By	Date E	ntered	Modified By	-	Last Modified	12.22.411

Figure 15.6

# 15.2.3.1 Location & Building

These fields can be populated by either selecting from the drop down list or selecting "New" and adding a new Location or Building. See Chapter 12 for more information.

# 15.2.3.2 Responsible Technician

This field can be populated by selecting from the drop down list or selecting "New" and adding a new technician. See Chapter 12 for more information.

# 15.2.3.3 Warranty Exp Date & Exp Man Hrs

These are optional fields.

15-16

# www.GlobalTestSupply.com

#### 15.2.3.4 P+ID Number & P+ID Revision Number

These fields are optional. Each field can hold up to 100 characters. (Process & Instrumentation Diagram or Piping & Instrumentation Diagram)

#### 15.2.3.5 Vendors

In this field you can also note the *Vendors Which Sell or Service* the Instrument. To do this highlight the vendor(s) desired, and click the appropriate arrow button between the two list boxes. (For more information on adding Vendors see Chapter 12)

### 15.2.4 User Defined Tab

This tab page contains all user defined variables (fields) that have been set up for the INSTRUMENT RECORD screen. (See Chapter 10 for instructions about how to set up user defined variables.)

#### 15.2.5 Notes Tab

This tab page is used to enter and/or view notes for the Instrument record. To enter a new note, click the <u>Add a Note</u> button. Type text into the field provided and click the <u>Save</u> <u>Record</u> button on the screen's toolbar. Once a note is entered and saved for the record it cannot be modified or deleted. As new notes are added, they will be inserted at the top of those listed (most recent notes first). As the record acquires multiple notes, you may change their order by clicking the <u>Sort Ascending/Descending</u> button.

# 15.3 File Menu Options

The following File Menu Options are for the Instrument Record.

# 15.3.1 New Record [Ctrl + N]

Selecting this option will open a blank Instrument Record screen. The Instrument ID must be entered before you can save the record.

# 15.3.2 Copy Record [Ctrl + Y]

This button will create a Copy of the current record. All fields will be copied except: ID, Serial Number, First & Last Cal dates, Approved by, Notes and any User Defined Signatures.

### 15.3.3 Save Record [Ctrl + S]

Selecting this option will save Instrument data.

# 15.3.4 Find Record [Ctrl + F]

Selecting this option will open the Find Instrument screen allowing searches by Instrument ID or Serial Number.

### 15.3.5 List Records [Ctrl + L]

Selecting this button will open the list screen, where all records are listed. On this screen you have the option to scroll through the field or activate an Advanced Query.

### 15.3.6 Show Work History [Ctrl + K]

This button will open a new screen that will display all the work history (if the record has no history, the screen will not open). Double clicking on a listed record will open that record.

# 15.3.7 Delete Record

This option will allow you to delete the Instrument Record. If the Instrument is a component of any Loop records, it will have to be removed from the Loop before the record can be deleted. If you do not have access to Delete Instrument Records, this option will be grayed out and not available.

# **Find Quality Products Online at:**

# www.GlobalTestSupply.com

# 15.3.8 Close Form

Closes the Instrument screen.

# 15.3.9 Exit DPCTrack2

This option will close DPCTrack2. If you have any unsaved work on any screens you will be prompted to Save before DPCTrack2 closes.

15-18

Find Quality Products Online at:

# Chapter 16 Loop Record Screen

# Title

# Page

16.1 Loop Records	
16.2 Tabbed Notebook Section	
16.2.1 General Info Tab	
16.2.1.1 Location & Building	
16.2.1.2 Responsible Technician	
16.2.1.3 Status	
16.2.1.4 Department	
16.2.1.5 Classification	
16.2.1.6 Equipment ID	
16.2.1.7 Document ID	
16.2.1.8 Calibration Frequency	
16.2.1.9 First Cal Date, Last Cal Date & Next Cal Date	
16.2.1.10 Keep On Schedule	
16.2.1.11 Approved By & Approved On	
16.2.2 Calibration Points Tab	
16.2.3 Additional Info Tab	
16.2.3.1 P+ID Number & P+ID Revision Number	
16.2.3.2 Expected Man Hours	
16.2.4 User Defined Tab	
16.2.5 Notes Tab	
16.3 File Menu Options	
16.3.1 New Record[Ctrl + N]	
16.3.2 Copy Record[Ctrl + Y]	
16.3.3 Save Record[Ctrl + S]	
16.3.4 Find Record[Ctrl + F]	
16.3.5 List Records[Ctrl + L]	
16.3.6 Show Work History[Ctrl + K]	
16.3.7 Delete Record	
16.3.8 Close Form	
16.3.9 Exit DPCTrack2	16-7

# www.GlobalTestSupply.com

# 16.1 Loop Records

As with the equipment section, it is sometimes useful to associate Instruments with Loops and even to provide separate calibration certificates for each Loop. DPCTrack2 gives you the ability to manage Loop information. Just like the INSTRUMENT RECORD screen, the MASTER LOOP RECORD screen is used to enter all of the Loop's information that will remain constant, such as classification and department. The Loop records that you enter will act as the templates for creating calibration records for those Loops. The MASTER LOOP RECORD screen is accessed by clicking the speed button labeled "Loops" on Record Toolbar.

	Company	E Master Loop Record		-		Jax
	Instruments		XBB	Advanced Query Name		
	Loops	Loop ID LCOP-001	Description Process Loop			Last Cal Date Next Cal Date 05/04/20/1 (55/00/2012
Master	Equipment	General Info Calibration Points	Additional Info Use	r Defined   Notes		
Record	S Test Instruments	Location	- New	Department	- New	And the second second
Button	Calibrations	Building	· New	Classification Critical	•	Calbration Frequency First Cal Date Annual
	Documents	Responsible Technicia Technician	n · New	Equipment ID		06/04/2011 06/30/2012
	Upload/Download	Status In Service	• New	Document ID		F Keep On Schedule
	Logged Data	Status Modification Da	fe Pla			
						Approved By Administrator     Approved on 06/04/2011 12:51:49 PM
		I of 1 Current Query: Defau	k			

Figure 16.1

# 16.2 Tabbed Notebook Section

The tabbed notebook section of the MASTER LOOP RECORD screen contains five (5) different sub-screens or "pages" available for data entry. These pages are logically grouped on the tabs of the notebook. To open a tab page click it with your mouse. Each page and its associated fields are described below.

Note

It is not necessary to fill in all empty fields. However, you must enter a Loop ID in order to save a new record.

# 16.2.1 General Info Tab

This page (Figure 16.1) allows you to enter general information about the Loop.

### 16.2.1.1 Location & Building

These fields may be filled in from the drop down lists or you may select New. For more information see Chapter 12.

### 16.2.1.2 Responsible Technician

This field can be populated either be selecting from the drop down list or select New. For more information see Chapter 12.

# 16.2.1.3 Status

This field can be populated either be selecting from the drop down list or creating a new Status. For more information see Chapter 12.

### 16.2.1.4 Department

This field can be populated either be selecting from the drop down list or creating a new Department. For more information see Chapter 12.

### 16.2.1.5 Classification

This field may be filled in from the drop down list. For more information see Chapter 12.

### 16.2.1.6 Equipment ID

This field can be filled in from the drop down list. For more information see Chapter 14.

### 16.2.1.7 Document ID

This field can filled in from the drop down list. For more information see Chapter 13.

# 16.2.1.8 Calibration Frequency

This field can filled in from the drop down list. For more information see Chapter 12.

# 16.2.1.9 First Cal Date, Last Cal Date & Next Cal Date

These fields do not have to be filled in when entering a new Instrument. These fields will populate when a passing Calibration is entered. It is recommended to at least fill in the next Cal Date field, this will generate reminders.

# 16.2.1.10 Keep On Schedule

In addition to the check box here, this field may be selected at the Company level. (Chapter 9) If this field is selected, then this field will already be checked. This can be overridden on an individual basis.

A checkmark in this box will instruct the system to maintain the exact calibration frequency and date you have specified for the Instrument, despite calibrations or work that may be performed on a date that does not exactly match the Instrument's due date. For example, imagine that you have an Instrument with a yearly calibration frequency that is due for calibration on June 1, 2003, but is calibrated early, on May 25, 2003. As long as the *Keep On Schedule* check box is marked for this item, DPCTrack2 will roll the calibrated Instrument's next due date forward to June 1, 2004 (maintaining June 1<sup>st</sup> as the date to be calibrated). However, if this box were not checked and the same situation occurred, the system would have rolled the next due date forward to May 25, 2004 (maintaining the yearly frequency, but changing the actual date to be calibrated). Please note that the *Keep On End Of Month* calibration frequency setting will override the *Keep On Schedule* setting. See Chapter 12 for more details about entering calibration frequencies.

### 16.2.1.11 Approved By & Approved On

When this box is checked and saved, the fields will be filled in with the user and a date & time when it was approved. (Please note that if you have not been granted approval rights for Loops, the *Approved by* box will be grayed out and inaccessible.)

# 16.2.2 Calibration Points Tab

This page contains fields in which to enter calibration information for the Loop, such as # of Calibration points, Stated Accuracy, Resolution, etc. Entering calibration specification information for Loops is done in exactly the same manner as it is done for Instruments, therefore you may reference Chapter 15 (Master Instrument Record) for more information on how to use this screen.

### 16.2.3 Additional Info Tab

This tab page (Figure 16.2 below) is used among other things to note the Instruments that comprise the Loop. The *Available Instruments* list box shows every instrument that has been entered as a MASTER INSTRUMENT RECORD for the Company. And since Instruments in DPCTrack2 may be associated with any number of different Loops, the list of available instruments for any Loop will always contain the full master list of Instrument IDs. The list box labeled *Instruments Which Make Up This Loop* will show those Instruments that you designate as a part of the Loop. To move an Instrument from one box to the other, highlight it with your mouse and use the center arrow buttons as needed. In addition, you may change the order of the Instruments listed in the *Instruments Which Make Up This Loop* box by highlighting each of them and then clicking the up/down arrows located to the right of the box. The *Additional Info* tab also contains the date, time and person(s) responsible for the entry of the record and for the most recent modification made.

Note

The addition of a new calibration record for an Instrument assigned to a Loop, will not automatically update the next due date of its Loop. Conversely, the addition of a new calibration record for a Loop, will not automatically update the calibration due dates of its component Instruments.

# 16.2.3.1 P+ID Number & P+ID Revision Number

These fields can be filled as needed. Each field can contain up to 50 characters.

### 16.2.3.2 Expected Man Hours

The *Expected Man Hours* field may be used to document the amount of time that is expected for the item's calibration or repair.

16-5

Loop ID PRQC-21	Description Processing Loop temperature 21		Last Cal D 11/01/201	ate Next Cal Dat 02/28/2011
neral Info   Calibration Points	Additional Info			
P+ID Number	P+ID Revision Number	-	Exp Man Hrs 0.00	
Available Instrum 0116TT01 0117LT01 0117TT01 0119LT01 0119LT01 0120LT01 0120LT01 0120TT01	ients	Instruments Which Mak 0108LT01 0108TT01 0118LT01 0118TT01	e Up This Loop	<b>+</b> <b>+</b>
Entered By Robert Efford	Date Entered 03/31/2011 12 54.49 PM	Modified By Robert Efford	Last Modif 03/31/201	ied 11 1:02:28 PM

Figure 16.2

# 16.2.4 User Defined Tab

This tab page contains all user defined variables (fields) that have been set up for the MASTER LOOP RECORD screen. (See Chapter 8 for instructions about how to set up user defined variables.)

# 16.2.5 Notes Tab

This tab page is used to enter and/or view notes for the Loop record. To enter a new note, click the <u>Add a Note</u> button. Type text into the field provided and click the <u>Save Record</u> button on the screen's toolbar.

Once a note is entered and saved for the record it cannot be modified or deleted. As new notes are added, they will be inserted at the top of those listed (most recent notes first). As the record acquires multiple notes, you may change their order by clicking the <u>Sort Ascending/Descending</u> button.

# 16.3 File Menu Options

The following File Menu Options are for the Loop Record.

# 16.3.1 New Record[Ctrl + N]

Selecting this option will open a blank Master Loop Record screen. The ID must be entered before you can save the record.

# 16.3.2 Copy Record[Ctrl + Y]

This button will create a Copy of the current record. All fields will be copied except: ID, Serial Number, First & Last Cal dates, Approved by, Notes and any User Defined Signatures.

# 16.3.3 Save Record[Ctrl + S]

Selecting this option will save Master Loop data.

# 16.3.4 Find Record[Ctrl + F]

Selecting this option will open the Find Master Loop screen allowing searches by Master Loop ID or Serial Number.

# 16.3.5 List Records[Ctrl + L]

Selecting this button will open the list screen, where all records are listed. On this screen you have the option to scroll through the field or activate an Advanced Query.

# 16.3.6 Show Work History[Ctrl + K]

This button will open a new screen that will display all the work history (if the record has no history, the screen will not open). Double clicking on a listed record will open that record.

### 16.3.7 Delete Record

This option will allow you to Delete the Loop Record. If you do not have access to Delete Loop Records, this option will be grayed out and not available.

#### 16.3.8 Close Form

Closes the Master Loop screen.

#### 16.3.9 Exit DPCTrack2

This option will close DPCTrack2. If you have any unsaved work on any screens you will be prompted to Save before DPCTrack2 closes.

# Chapter 17 Test Instrument Record Screen

# Title

# Page

17.1 Test Instrument Records	
17.2 Tabbed Notebook Section	17-3
17.2.1 General Info Tab	
17.2.1.1 Manufacture	
17.2.1.2 Model Number. & Serial Number.	
17.2.1.3 Document ID	
17.2.1.4 Status & Status Modification Date	
17.2.1.5 Use This Test Instrument When Calibrating the	Following
Instrument Type	17-4
17.2.1.6 Calibration Frequency	
17.2.1.7 First Cal Date, Last Cal Date, & Next Cal Date.	
17.2.1.8 Keep on Schedule	
17.2.1.1.9 Date Sent for Cal & Date Returned	
17.2.1.10 Approved By & Approved On	
17.2.2 Calibration Points Tab	
17.2.3 Additional Info Tab	
17.2.4 User Defined Tab	
17.2.5 Notes Tab	
17.3 File Menu Options	
17.3.1 New Record $[Ctr] + N]$ .	
17.3.2 Copy Record $[Ctrl + Y]$	
17.3.3 Save Record $[Ctrl + S]$	
17.3.4 Find Record[Ctrl + F]	
17.3.5 List Records $[Ctrl + L]$	
17.3.6 Show Work History [Ctrl + K]	
17.3.7 Delete Record	
17.3.8 Close Form	
17.3.9 Exit DPCTrack2	

# www.GlobalTestSupply.com

# 17.1 Test Instrument Records

For a variety of reasons relating to quality control and record-keeping issues, DPCTrack2 stores data for Test Instruments separately. This screen is used to add, display, modify, and if necessary delete Test Instrument records.

In this section, you may add your company's test equipment. The TEST INSTRUMENT RECORD screen is accessed by clicking the speed button labeled "Test Instruments" on the Record Toolbar.

# 17.2 Tabbed Notebook Section

The tabbed notebook section of the TEST INSTRUMENT RECORD screen contains five (5) different sub-screens or "pages" available for data entry. These pages are logically grouped on the tabs of the notebook. Each page and its associated fields are described below.

	Company	E Test Instrument Record		
Test Instrument Record	Company Compan	Test Instrument Record      Test Instrument Record      Test Instrument ID     Description      Status      Test Instrument ID     Test	Advanced Duesy Name	
	Documents Documents Logged Data	In Jervice     I	Last Cal Date Next Cal Date [04/28/2011 [04/20/2012] V Keep On Schedule Date Sent For Cal Date Returned [05/13/2005 [05/13/2005]	
		2 of 3 Current Query: Default	Approved By Administrator     Approved on 05/31/2011 8.08.51 PM	

Figure 17.1

Note

It is not necessary to fill in all available fields. Only a Test Instrument ID is required to save a new record.

# 17.2.1 General Info Tab

This tab (Figure 17.1) allows you to enter general information about the Test Instrument like its manufacturer, vendor, model number, serial number, status, etc.

# 17.2.1.1 Manufacture

This field may be populated by either selecting from the drop down menu or entering a new Manufacture. See Chapter 12 for more information.

# 17.2.1.2 Model Number, & Serial Number

These fields can be filled in as needed. Each field can contain up to 100 characters.

# www.GlobalTestSupply.com

# 17.2.1.3 Document ID

This field can filled in from the drop down list. For more information see Chapter 13

# 17.2.1.4 Status, & Status Modification Date

This field may be populated by either selecting from the drop down menu or entering a new Status. See Chapter 12 for more information. Upon saving the record the Status Modification Date field will be filled in. This field will also change if the Status is changed from the Calibration screen.

# 17.2.1.5 Use This Test Instrument When Calibrating the Following Instrument Type

Documenting what "types" of Instruments a Test Instrument can calibrate helps in record keeping and in limiting the selection of available Test Instruments when entering a new calibration record. Instrument types may be very general like "Pressure" or "Temperature" or they may be more specific like "Level Transmitter" or "Flowmeter". The terminology is completely user-defined, allowing the system to be flexible enough to meet your needs.

The bottom portion of the *General Info* tab on the TEST INSTRUMENT RECORD screen contains two list boxes showing the instrument types that can and cannot be calibrated by the current Test Instrument. To move instrument types back and forth between the two lists, highlight the Instrument type(s) to be moved and click the appropriate center arrow button.

Utilizing these two boxes allows you to limit the display of available Test Instruments on the CALIBRATION RECORD screen, to test only the Instruments that are designated for use on the type of Instrument that is being calibrated. (See Chapter 12 for instructions on how to enter "Instrument Types".) If an Instrument has not been designated an *Instrument Type*, then all Test Instruments which have been entered into the system will be displayed in the *Available Test Instruments* box on the CALIBRATION RECORD screen.

# 17.2.1.6 Calibration Frequency

This field can filled in from the drop down list. For more information see Chapter 12

# 17.2.1.7 First Cal Date, Last Cal Date, & Next Cal Date

These fields do not have to be filled in when entering a new Instrument. These fields will populate when a passing Calibration is entered. It is recommended to at least fill in the next Cal Date field, this will generate reminders.

# 17.2.1.8 Keep on Schedule

In addition to the check box here, this field may be selected at the Company level. (Chapter 9) If this field is already selected, then this field will already be checked. This can be overridden on an individual basis.

A checkmark in this box will instruct the system to maintain the exact calibration frequency and date you have specified for the Instrument, despite calibrations or work that may be performed on a date that does not exactly match the Instrument's due date. For example, imagine that you have an Instrument with a yearly calibration frequency that is due for calibration on June 1, 2003, but is calibrated early, on May 25, 2003. As long as the *Keep On Schedule* check box is marked for this item, DPCTrack2 will roll the calibrated Instrument's next due date forward to June 1, 2004 (maintaining June 1<sup>st</sup> as the date to be calibrated). However, if this box were not checked and the same situation occurred, the system would have rolled the next due date forward to May 25, 2004 (maintaining the yearly frequency, but changing the actual date to be calibrated). Please note that the *Keep On End Of Month* calibration frequency setting will override the *Keep On Schedule* setting. See Chapter 12 for more details about entering calibration frequencies.

# 17.2.1.1.9 Date Sent for Cal & Date Returned

These fields are to be filled in manually and are optional.

#### 17.2.1.10 Approved By, & Approved On

When this box is checked and saved, the fields will be filled in with the user and a date & time when it was approved. (Please note that if you have not been granted approval power for Test Instruments, the *Approved by* box will be grayed out and inaccessible.)

# 17.2.2 Calibration Points Tab

This page contains fields in which to enter calibration information for the Test Instrument, such as # of cal points, stated accuracy, resolution, etc. Entering calibration specification information for Test Instruments is done in exactly the same manner as it is done for instruments, therefore you may reference Chapter 15 (Master Instrument Record) for more information on how to use this screen.

#### 17.2.3 Additional Info Tab

This page allows you to record additional information about the Test Instrument like its location, responsible technician, warranty expiration date, etc. You can also note which vendors sell or service the Test Instrument. To do this highlight the vendor desired, and click the appropriate arrow buttons between the two list boxes labeled *Available Vendors* and *Vendors Which Sell or Service This Test Instrument*. (Vendor records are added through the Lists menu at the top of the Home Screen, see Chapter 12) Additionally, you can see the date and time of the last modification made to the Test Instrument record.

# 17.2.4 User Defined Tab

This tab page contains all user defined variables (fields) that have been set up for the TEST INSTRUMENT RECORD screen. (See Chapter 8 for instructions about how to set up user defined variables.)

# 17.2.5 Notes Tab

This tab page is used to enter and/or view notes for the test instrument record. To enter a new note, click the <u>Add a Note</u> button. Type text into the field provided and click the <u>Save Record</u> button on the screen's toolbar.

Once a note is entered and saved for the record it cannot be modified or deleted. As new notes are added, they will be inserted at the top of those listed (most recent notes first). As the record acquires multiple notes, you may change their order by clicking the <u>Sort</u> <u>Ascending/Descending</u> button.

# 17.3 File Menu Options

The following File Menu Options are for the Test Instrument Record

# 17.3.1 New Record[Ctrl + N]

Selecting this option will open a blank Test Instrument Record screen. The Instrument ID must be entered before you can save the record.

### 17.3.2 Copy Record[Ctrl + Y]

This button will create a Copy of the current record. All fields will be copied except: ID, Serial Number, First & Last Cal dates, Approved by, Notes and any User Defined Signatures

# 17.3.3 Save Record[Ctrl + S]

Selecting this option will save Test Instrument data.

# 17.3.4 Find Record[Ctrl + F]

Selecting this option will open the Find Test Instrument screen allowing searches by Test Instrument ID or Serial Number.

17-5

# Find Quality Products Online at:

# www.GlobalTestSupply.com

# 17.3.5 List Records[Ctrl + L]

Selecting this button will open the list screen, where all records are listed. On this screen you have the option to scroll through the field or activate an Advanced Query.

### 17.3.6 Show Work History[Ctrl + K]

This button will open a new screen that will display all the work history (if the record has no history, the screen will not open). Double clicking on a listed record will open that record.

# 17.3.7 Delete Record

This option will allow you to Delete the Test Instrument Record. If you do not have access to Delete Test Instrument Records, this option will be grayed out and not available.

### 17.3.8 Close Form

Closes the Test Instrument screen

# 17.3.9 Exit DPCTrack2

This option will close DPCTrack2. If you have any unsaved work on any screens you will be prompted to Save before DPCTrack2 closes.

# Chapter 18 Upload/Download Screen

# Title

# Page

18.1	Getting Started	,
18.2	File Menu Options	ŀ
18.2.1	Initiate Download/Upload18-4	ŀ
18.2.2	Close Form	ŀ
18.2.3	Exit DPCTrack2	ŀ
18.3	Features	ŀ
18.3.1	Clear Calibrator Memory	ŀ
18.3.2	Set Calibrator Date/Time to Current Date/Time	;
18.3.3	View Number of Test Results	;
18.3.4	View/Edit Session Log	5
18.4	Lists	<u>,</u>
18.5	Help	;
18.6	Options	5
18.6.1	Download Options	5
18.6.1.1	1 Default Loop Power	;
18.6.1.2	2 User Entered Values (UEV)	;
18.6.1.3	3 Setup/Wrapup Messages	Ś
18.6.1.4	4 Default Temperature Standard	Ś
18.6.1.5	5 Fluke Options	Ś
18.6.2	Upload Options	1
18.6.2.1	1 Update Item's Status on Failure or Success	1
18.6.2.2	2 Add Note to All Calibrations Indicating Make, Model, and	
	Serial # of Device (if Available)	1
18.7	Downloading Calibration Items as Tasks	1
18.7.1	Download By18-7	1
18.7.1.1	1 By Cals Due	1
18.7.1.2	2 By Query	3
18.7.1.3	By Configuration	3
18.7.2	Tag List Operations	)
18.7.3	Tag List Edit Functions	0
18.7.4	Tag List Information Functions	0
18.7.5	Adding to the Tag List	1
18.7.6	Removing Items from the Tag List	1
18.7.7	Tag Construction	1
18.8	Uploading Results as Calibrations	2
18.8.1	Assign Technician to Calibrations	2
18.8.1.1	1 Who Calibrated	.2
18.8.1.2	2 Options	3

18.8.2	Default Calibration Type for Uploaded Calibrations	
18.8.3	Default Test Instrument Warning Options	
18.8.4	Initiate Upload	
18.8.4.1	Result Duplicates	
18.8.4.2	Calibration Record: Authorizing	
18.9 T	est Instrument Recognition	

Find Quality Products Online at:

# 18.1 Getting Started

Downloading refers to the transferring of one or more items as tasks to the Calibrator. Uploading pertains to copying of the calibration results and logged data to DPCTrack2 as calibration records. Figure 18.1 shows the Upload/Download screen.



Figure 18.1

**Find Quality Products Online at:** 

# www.GlobalTestSupply.com

# 18.2 File Menu Options

With the Upload/Download screen open, the following File menu options are available.



Figure 18.2

### 18.2.1 Initiate Download/Upload

Selecting this option will begin the download/upload process.

# 18.2.2 Close Form

Selecting this option will close the Upload/Download screen

# 18.2.3 Exit DPCTrack2

Selecting this option will close entire application

# 18.3 Features

This menu contains the following features:

### 18.3.1 Clear Calibrator Memory

If supported, this menu item will clear the current connected calibrator's memory, after displaying a confirmation message.

Note

Once results and procedures are cleared from your DPC they cannot be restored.

# **Find Quality Products Online at:**

# www.GlobalTestSupply.com

# 18.3.2 Set Calibrator Date/Time to Current Date/Time

If supported, this menu item will call a function which resets the internal clock of the calibrator device to your PC's current system date and time.

#### 18.3.3 View Number of Test Results

If supported, a message will appear indicating the number of calibration results that are contained within the calibrator's memory.

# 18.3.4 View/Edit Session Log

DPCTrack2 keeps a useful log of Uploads, Downloads and Memory Clears in a log. See Session Logging for more information.

# 18.4 Lists

Many of the standard fields in DPCTrack2 have drop-down Lists that are User Defined. This gives you the ability to customize many areas of the program to meet your needs. All of the Standard Lists can be accessed from the **Lists** menu. For further information about lists see Chapter 12.

# 18.5 Help

See Chapter 2 for more on the Help menu.

# 18.6 Options

During any Download or Upload operation, the Options screen allows default values to be set for tasks or results created. After modifying options the user may select **Save as Default** to save the current options as the default options for the next time the open the screen. The **Reset** button will return the current set of options to the previously saved defaults.

# 18.6.1 Download Options

Options for transferring items as tasks to the Documenting Calibrator.

#### 18.6.1.1 Default Loop Power

The Fluke calibrators have a power source available for transmitters and other instruments/loops that may need a separate power source. Choose your desired setting from the dropdown list, and all downloaded tasks will default to this setting when they are performed on the calibrator.

#### 18.6.1.2 User Entered Values (UEV)

A user-entered value allows the technician to overwrite the actual measured or sourced value with another numeric value, which is stored as the result. This value is used as the value stored in DPCTrack2. Choose either Source or Measure or both Source and Measure UEV to enable Source, Measure or both user-entered values. User-entered values can be useful for recording information that is read by some other means than the calibrator's actual sourcing or measuring capabilities

#### 18.6.1.3 Setup/Wrapup Messages

You can make messages display on the calibrator before and/or after the calibration procedure. The following options are available for message prompts:

None	No Message	
First Note	Displays the first Note that was added to the Instrument or Loop.	
Most Recent Note	Displays the Note that was added most recently to the Instrument or Loop.	
Item Description Fields	n Description Fields Displays the calibrated item's ID, Company, Location, Building, Department, Associated Document, Associated Equipment, and Serial Number (if applicable)	
Custom Message	Custom Messages are to be entered into the text area directly under the dropdown list that indicates what the setup message is comprised of.	
SOP Procedure	Displays the Procedure field of the Instrument or Loop's associated Document ID. See Chapter 13 on Documents.	

If a message's size is beyond the current calibrator's limit, as much of the message will be processed as possible and may be broken into multiple screens.

#### 18.6.1.4 Default Temperature Standard

This value may be set to use the current calibrator's default but may also be overridden for the current download session to **ITS-90** or **IPTS-68**.

### 18.6.1.5 Fluke Options

### 18.6.1.5.1 Show Prompt on Device for:

DPCTrack2 enables the tester to provide additional information about the tests

they perform in the field through the employment of six checkboxes on the

**Download Options** page. If a checkbox is selected, then the tester will be prompted for that information. The tester's response to the prompt(s) is saved as part of the testing information on a per Tag ID basis. The tester can decide if the prompt(s) will be presented before or after the test.

#### 18.6.1.5.2 Show Prompt (Before/After):

The tester can decide if the prompt(s) will be presented before or after the test.

# 18.6.1.5.3 Preserve <x% > Memory for Results:

Every calibrator has a certain amount of memory, which is broken up into tasks and results, somehow. By downloading, we erase the results memory and replace the tasks memory with our newly created procedures. This option allows the tester to save a defined percentage of the memory for calibration results.

# 18.6.2 Upload Options

Options for copying of the calibration results from the Calibrator to DPCTrack2 as calibration records.

### 18.6.2.1 Update Item's Status on Failure or Success

If you upload a calibration, you can automatically update the instrument or loop's status from Out of Service to In Service, or vice versa, according to the results of the calibration record. Check this box to perform this action automatically. You can still go into your master records and change this afterwards.

# 18.6.2.2 Add Note to All Calibrations Indicating Make, Model, and Serial # of Device (if Available)

This option will add a brief message to a new Note on every new Calibration record added. This note will show the user the manufacturer, model number, and serial number of the device used for upload.

# 18.7 Downloading Calibration Items as Tasks

This function is used to create a calibration task on a calibrator. Every calibrator has a certain amount of memory, which is broken up into tasks and results. By downloading, we erase the results memory and replace the tasks memory with our newly created procedures.

# Important

All task downloads will completely erase ALL procedures and results from the current calibrator's memory.

# ALWAYS double check to make sure that you are not erasing any data that you have not recorded elsewhere.

- 1. Select 'Download to Calibrator' from the Action checkbox.
- 2. Make sure your calibrator is set up for communication.
- 3. Be sure that you have properly set up the signal types used in the instruments you plan to download. See Signal Type Setup.

# 18.7.1 Download By

There are three methods to choose from for generating a list of Tags to download.

#### 18.7.1.1 By Cals Due

This option gives you a list of Instruments or Loops which are due before or on the specified Due Date. Leave the date field blank for all available items. To add an item to the list of Tags to be downloaded, simply check the checkbox next to it. Clicking on any item displays information in a memo box to the right of the checklist area. When a particular item cannot be added to the tag list, it is unavailable for checking and the reason it cannot be downloaded is displayed with the item information in the memo box.

18-7

Click Refresh List if you change the due date entered and want to reload the list.

Use the Backspace key to remove the Due Date value.

### 18.7.1.2 By Query

This option allows you to use an Instrument or Loop advanced query to add or remove Tags from the list of Tags to be Downloaded. Each query tab has the same functions:

New Query: Clicking the New button brings up the Advanced Query screen, with which you can build a new query for the selected record type.

Modify Query: Clicking the Modify button allows you to modify the current query, or create a new one if a query has not been loaded.

#### **View Options:**

Selection Criteria- This displays the criteria of the current query in a grid format.

**Query Preview-** This previews the selected query in a displayed grid.

**Check List-** This option generates a check list of calibration items that are found using the current query. Clicking on any item displays information in a memo box to the right of the checklist area. When a particular item cannot be added to the tag list, it is unavailable for checking and the reason it cannot be downloaded is displayed with the item information in the memo box.

You can switch between view options for the current query by clicking each option on the group of radio buttons.

Add All- This button attempts to add every valid calibration item found within the query's results to the list of Tags to be Downloaded. Any errors that occur are displayed after the function attempts to add all items found to the tag list.

**Remove All** - This button will attempt to remove every calibration item found within the query's results from the list of Tags to be Downloaded.

#### 18.7.1.3 By Configuration

This download option displays an organizational view of your DPCTrack2 data. Instruments, and Loops that are used as components of other Loops, or Equipment records. Each item appears as a sub-item of the record it is attached to. All downloadable items appear with an icon indicating their item type. To add an item to the list of Tags to be downloaded, simply check the checkbox next to it.

Clicking on any item displays information in a memo box to the right of the checklist area. When a particular item cannot be added to the tag list, it is unavailable for checking and the reason it cannot be downloaded is displayed with the item information in the memo box.

Click Refresh if the database has changed and you need to redisplay the organizational view.

For more information, see also Tag List Operations and Tag Construction.

At this point, you may click the **Initiate Download** button to start the downloading process. This may take a few moments, depending on how many tags you have generated.

During this process, some tags may cause errors. Clicking the Help button on any error message box will automatically bring you to the appropriate Help topic. See Also: Error Message Index. If an item cannot be downloaded, but others selected can, those items that do not cause any errors will still be downloaded.

# **Find Quality Products Online at:**

# www.GlobalTestSupply.com

Upon completion of a successful download, a message appears which reads "# procedure(s) downloaded successfully", where '#' is the number of procedures downloaded without error.

If all selected instruments cause irreconcilable errors, the message "Download Aborted. No procedures downloaded." will appear.

After either of these messages occurs, you can disconnect your calibrator and begin using any successfully downloaded procedures.

# 18.7.2 Tag List Operations

On the *Download* screen, the list of Tags to be downloaded provides an exact list of the items that the utility will attempt to download. It also allows you to view details about the tag like input and output ranges and signal types. See Figure 18.3 below.

Upload/Download		Jax
Download Upload Options		
<ul> <li>Download By:</li> <li>By Cals Due</li> </ul>	By Query     By Configuration	
Show Items Due for Calibration Dn or Befor	e (Blank date for all Items) 04/28/2012	List of Tags to Download:
C Refresh List	former and a manual la destruction	Options
Instrument EXAMI/P_TRANS Instrument EXAMINDICATOR Instrument EXAMPRES_TRAN1 Instrument EXAMPRES_TRANS Instrument EXAMPRESGAUGE Instrument EXAMRTD_TRANS Instrument EXAMRTD_TRANS Instrument EXAMTD_TRANS Instrument EXAMTEMPSWITCH	Instrument EXAMPRES_TRAN1 Description: Pressure Transmitter Last Cal Date: 04/28/2010 Next Cal Date: 04/30/2011 Status: In Service Responsible Technician: Instrument Type: Pressure Transmitter Location: Unit 3 Building: Manufacturer: Rosemount Model Number: 3051 Serial Number: 123L0Pressure Document ID:	Ports
		С сом6 сом7
		Calibrator Info
Close ? He	q	Initiate Download

Figure 18.3

# www.GlobalTestSupply.com

# 18.7.3 Tag List Edit Functions

These functions are available from the *Options* popup menu and by right-clicking on the list itself.

Clear All - Clears all Tags from the list.

Clear Instruments - Clears all Instrument Tags from the list.

Clear Loops - Clears all Loop Tags from the list.

*Remove Selected and All Related Tags* - If the currently selected Tag is an Instrument or a Loop, all other related Tags.

			lex
Download Upload Options			
Download By:     By Cals Due     O	By Query	By Configuration	
Show Items Due for Calibration On or Before (Bla	List of Tags to Download:		
C Refresh List			Options
Instrument EXAMI/P_TRANS Instrument EXAMINDICATOR Instrument EXAMPRES_TRAN1 Instrument EXAMPRES_TRANS Instrument EXAMPRESGAUGE Testrument EXAMPRESGAUGE	Instrument EXAMPRESGAUG Description: Pressure Gauge Last Cal Date: 10/15/2010 Next Cal Date: 04/30/2011	Ger All	G I-EXAMPHESGAUGE
Instrument EXAMPTLE SSWITCH Instrument EXAMPTLE TRANS Instrument EXAMPTLE TRANS Instrument EXAMTE_TRANS Instrument EXAMTEMPSWITCH	Status: In Service Responsible Technician: Instrument Type: Pressure G Location: Unit 3 Building: Manufacturer: Ashcroft Model Number: 1005	auge Clear All Clear Instrum Clear Loops Remove Sele View Details I	ents ted and All Related Tags or Selected Tag
	Serial Number: 123Gauge Document ID:	, ,	Ports C COM6 © COM7
< · · · · · · · · · · · · · · · · · · ·	•(	)+	
Sose ? Help			💦 Initiate Download

Figure 18.4

#### 18.7.4 Tag List Information Functions

Selecting *View Details for Selected Tag* from the popup menu, or by double-clicking the list itself will bring up the <u>View Tag Details</u> screen. See Figure 18.5 below.

This screen displays the Item Type, Item Code, Group Number, Group Name, Input Signal Type, Input Low Range, Input High Range, Output Signal Type, Output Low Range, Output High Range, and Number of Test Points for the currently selected Tag.

Click OK to close this screen.

18-10

View Tag Details - G1-EXAMPRESGAUGE				
Item Type	Instrument	S	pec Group #	1
Item Code	EXAMPRESGAU	GE		
First Cal Date 10/15/2010		Last Cal Date 10/15/2010		Next Cal Date 04/30/2011
Spec Group I Group Name Pressure Gauge	etails ———		# Cal Pts.	3]
Input Signal Typ psi	pe		Output Signal	Туре
Low Range 0.00	High Range 100.00		Low Range 0.00	High Range 100.00
		🗸 ок		

Figure 18.5

### 18.7.5 Adding to the Tag List

See 18.7 Downloading Calibration Items as Tasks for more on selecting Instruments and/or Loops to add to the Tag list. If a tag could not be added to the list, a reason will be displayed in a message prompt.

#### 18.7.6 Removing Items from the Tag List

Highlight an item and use the Delete key on your keyboard to remove an item from the list, or select an item and right-click on the list and *Remove Selected and All Related Tags*. Lastly you may select the item, click the Options... button and then select *Remove Selected and All Related Tags*.

### 18.7.7 Tag Construction

Downloaded Tasks are identified by their Tag. A Tag, in this utility, is a unique name given to a particular test point group, existing on a particular Instrument or Loop record.

In order to differentiate between multiple test point groups, this utility uses a group number *prefix* method.

For example, Instrument INST-01, test point group #2 would become the Tag "G2-INST-01".

# 18.8 Uploading Results as Calibrations

You can use DPCTrack2 to Upload Calibration results as new calibration records (See Figure 18.6 below). For more information about calibration records, see Chapter 19 Calibration Records.

Upload/Download	- = ×
Download Upload Options	
Assign Technician to Calibrations	Ports
Who Calibrated Technician	COM6
Options     Assign Technician to All Uploaded Calibrations (Ignore Uploaded ID)	
Assign Technician to Calibrations with Unassigned or Unknown Technicians     Use Technician ID as Uploaded from Device on All Calibrations (If Name Found)	
Default Calibration Type for Uploaded Calibrations	
Default Test Instrument Warning Options	
Not Found Add a Note O Ignore Warning	
Out Of Calibration Add a Note Ignore Warning	
	Calibrator Info
Glose ? Help	Pt Initiate Upload

Figure 18.6

- 1. Make sure your calibrator and PC are connected. See Setting Up Communications for more info.
- 2. Check the desired options for uploading calibrations. See chapter 18.6.2 above.

# 18.8.1 Assign Technician to Calibrations

#### 18.8.1.1 Who Calibrated

Choose your desired "Who Calibrated" value or corresponding option from the main screen. The DPCTrack2 Calibration screen has a field for 'Who Calibrated' - That is, a field for the Technician who performed this calibration. The Fluke calibrators can supply an ID value for the technician using the device. This ID can be associated with the DPCTrack2 User ID, and further associated with a Technician's Name.

Note

For the program to recognize the User ID, it must be entered into the device exactly as it appears in the User ID field in the DCPTrack2 Employee Screen.

# 18.8.1.2 Options

A. Assign Technician to All Uploaded Calibrations (Ignore Uploaded ID)

This option will assign the selected Technician (or blank option) to every uploaded calibration record, no matter what ID is sent back from the connected device.

**B**. Assign Technician to Calibrations with Unassigned or Unknown Technicians

This option will first check to see if the User ID uploaded from the calibrator matches an available Technician. If so, that Technician's name is used for the 'Who Calibrated' field in the Calibration record. If the ID is not found, the selected Technician (or blank option) will be entered in the 'Who Calibrated' field for that Calibration record.

C. Use Technician ID as Uploaded from Device on All Calibrations (If Name Found)

If the User ID retrieved from the device matches an available Technician, that Technician's name is used for the 'Who Calibrated' field in the Calibration record. If not, the field is simply left blank.

# 18.8.2 Default Calibration Type for Uploaded Calibrations

Choose your desired "Calibration Type" value for all uploaded calibrations.

# 18.8.3 Default Test Instrument Warning Options

Choose your desired Test Instrument Warning Options. During upload, the calibrator and other auxiliary test standards may or may not be recognized by the system. If so, certain warnings may apply according to your DPCTrack2 company options.

A. *Not Found*: If the Test Instrument is not found in the database, this type of warning may occur.

**B**. *Out of Calibration*: If the Test Instrument is not found in the database, but the Next Calibration Date is before today's date, this type of warning may occur.

C. *Not Approved*: If the Test Instrument is found in the database, but is not currently approved, this type of warning may occur.

The default behavior of DPCTrack2 is to add a note to a calibration record that has references to non-existence, out of calibration or unapproved test instruments. The note is designed to give later reviewers more information about associated test standards. These default actions can be overridden for the upload session and then individually on the Test Instruments tab of the Authorize Calibration Screen.

# 18.8.4 Initiate Upload

This process will automatically:

- 1. Upload all result data from the connected calibrator.
- 2. Skip over any Non-DPCTrack2 result data, such as aborted tasks with no calibration results. This data is considered incomplete and will not be added to your DPCTrack2 database.
- 3. Identify all valid results as being an Instrument or Loop and identify the test point group number for each one.
- 4. Add the calibrator and any Auxiliary Equipment found to the list of 'Test Instruments Used' in the calibration record screen. They are searched by Manufacturer, Model and Serial Number values, so be sure to check that the correct test instruments are listed. See also: Test Instrument Recognition (Chapter 18.9)
- 5. Check for the calibration due date of the calibrator and other auxiliary test equipment, if found in the database, and construct a set of warnings to appear in the

18-13

# www.GlobalTestSupply.com
Authorize Calibration Screen. See Test Instrument Recognition in Chapter 18.9 for more information.

- 6. Process all test points and readings according to the item's default test point groups if found, or it will generate default information for those test points and groups that are not found in the database.
- 7. Build a new Calibration record and display the Authorize Calibration Screen, for verification of all processed and uploaded data.
- 8. If authorized, the program will add the displayed record as a new, unfinalized Calibration record. To finalize or check over your calibration records, start DPCTrack2, log in with your user name and password, and open the Calibration Record Screen.

#### Note

When the Upload is completed, you may be asked if you want to clear the calibrator memory. (This is to prevent re-upload of calibration results.) See the Warnings below if you choose to clear the memory at this point:

#### Cauton

- Incomplete tasks will be cleared from memory in this process. Keep track of any instruments you may need to re-download.
- Non-uploadable results will be cleared from memory in this process. Record all data that you wish to keep separately.
- If result data is not cleared, it may be unintentionally uploaded again, and duplicate calibration records may result. This is why it is recommended that you clear the calibrator of data following a successful Upload.

#### 18.8.4.1 Result Duplicates

The upload function of the program only allows for one new calibration record for a particular Instrument or Loop during one Upload session.

If multiple results are Uploaded for a particular tag, the utility will display the date and time (if available) of the result record and ask the user to choose the one group that should be added to the current calibration record.

If you need to upload both cal records, perform the upload twice, choosing different groups each time the <u>Group Result Duplicate</u> screen appears.

#### 18.8.4.2 Calibration Record: Authorizing

DPCTrack2 contains a special feature that allows you to Authorize or Skip each Calibration result record uploaded from the device. It does this function via the Authorize Calibration Screen (Shown in Figure 18.7).



Figure 18.7 (Authorize Calibration Screen)

#### 18.8.4.2.1 Action Buttons

<u>Authorize</u> - This new calibration record will be added to the system, and all indicated date rolling and item closing will be performed

Authorize All - See below for more on Authorizing an entire Upload session.

<u>Skip</u> - This button will cause the current calibration addition to be canceled. No changes are made to the database, and other calibration records can still be added. This button is useful when uploading more than once from a given calibrator and the user has already created the current result as a Calibration record in the database.

Help - Opens this Help System.

#### **Screen Fields**

For most screen fields, see the DPCTrack2 Help System - Calibration Screen for more information. Only certain have special meaning in this utility.

"Roll Dates and/or Close These Items for Successful Calibration"

This checklist operates exactly the same as the same checklist in the Calibration screen. The user is required to check which updates they would like to proceed with, if the calibration has passed.

## www.GlobalTestSupply.com

"Messages"

This read-only tree view box will display messages similar to the following as they apply to the current calibration record:

"This Calibration has Failed."

"This Calibration has been Found Out of Spec."

This list will contain warnings for out of spec As Found and As Left results, as well as warnings for Incomplete Calibrations.

"Reason for Failure"

This field may be required for data entry if Require Reason for Failure on Failed Cal option is turned ON for the current Company record.

"Test Instruments/SOP/User Defined" Tab

The SOP and User-Defined portions of this tab simply contain the default values that may be filled in for User-Defined Variables and the SOP tab.

The Test Instruments section contains the listing of Test Instruments used for the current calibration. There may or may not be associated warnings for each listed item. The warning condition is indicated by the color of the icon for each Test Instrument's ID or description. The warning action and actual warning message data are found by expanding the tree (double-clicking or clicking the (+) button).

GREEN: No warnings and this item will be added to the list of Test Instruments used

**YELLOW**: Warnings possible, but the item will be added to the list of Test Instruments used

**RED**: Either the item does not exist or the warnings attached prevent the item from being added to the list of Test Instruments Used.

For each item you can choose to add a note for the warning or ignore the warning for this calibration record. This is accomplished by highlighting the Test Instrument you want to decide on and using the radio buttons that appear to the right of the Test Instrument list.

"Authorize All"

If there are any calibrations left to add, this button will display a dialog that displays all updates that will occur if any of the displayed uploaded calibrations are passing cals.

**Preview Updates Screen** - This screen displays the same updates as those that are checked by default in the Authorize Calibration Screen. This gives the user the opportunity to cancel the automatic authorization of all the remaining calibrations.

The user can decide to continue the normal pattern of Authorization by clicking "No" at this dialog, or they can choose to Auto-Authorize all uploaded calibrations by clicking "Yes."

### 18.9 Test Instrument Recognition

You can enter your calibrators and any other test equipment connected to the calibrators (for example, pressure modules) as Test Instruments.

18-16

# www.GlobalTestSupply.com

# Chapter 19 Calibration Screen

### Title

### Page

19.1 Calibration Records	9-3
19.2 Tabbed Notebook Section	9-3
19.2.1 Header Fields	9-3
19.2.1.1 Item Type	9-3
19.2.1.2 Item ID	9-3
19.2.1.3 Calibration ID	9-4
19.2.1.4 Calibrated & Scheduled Dates	9-4
19.2.1.5 Cal Frequency	9-4
19.2.2 Item Info (As of Calibration Record Entry Date)	9-4
19.2.3 General Calibration Info	9-4
19.2.3.1 Temperature & Humidity	9-4
19.2.3.2 Calibration Type	9-4
19.2.3.3 Certificate #	9-4
19.2.3.4 Who Calibrated	9-4
19.2.3.5 Man Hours	9-4
19.2.3.6 Reason for Failure	9-4
19.2.3.7 # of Cal Points	9-4
19.2.3.8 Finalized, Finalized By & Date Finalized	9-4
19.2.3.9 Automatic Date Rolling Functionality	9-4
19.3 Test Results Tab	9-5
19.3.1 Test Point Groups	9-5
19.3.2 Separate As Found/As Left Inputs	9-6
19.3.3 Modifying Calibration Specifications	9-6
19.3.4 Classifying the Result of a Calibration	9-7
19.3.5 Automatic Warnings and Messages	9-8
19.3.6 Warnings and Messages That May Appear as a Result of	
Options and Default Settings	9-9
19.3.6.1 [Warn, Restrict, Allow] If Calibrated Item Is Not Approved 19	9-9
19.3.6.2 Force Calibration Failure	9-9
19.3.6.3 Users Cannot Finalize Calibration They Entered	9-9
19.3.6.4 Require Reason For Failure On A Failed Calibration	9-10
19.3.6.5 Allow The User To Finalize Incomplete Calibrations	9-10
19.3.6.6 Only Show Active Test Instruments	9-10
19.3.6.7 [Allow, Warn, or Restrict] On Use Of An Unapproved Test	
Instrument	9-10
19.3.7 Entering Calibrations in Multi-Mode	9-10
19.4 Test Instruments Tab	9-11
19.4.1 How Instrument Types Affect the Available Test Instrument List 19	9-12

Find Quality Products Online at:

19.4.2	Show All	
19.5	SOP Tab	
19.6	User Defined Tab	
19.7	Notes Tab	

Find Quality Products Online at:

## 19.1 Calibration Records

This screen is used to add, display, modify and if necessary, delete the results of an Instrument, Loop, Test Instrument or System calibration. Once you have entered Master Instrument, Loop and Test Instrument records, you may create calibration records based upon the data you already established in the database. The CALIBRATION screen is accessed by clicking the speed button labeled **"Calibrations"** on the Record Toolbar.

	Company	E Calibration (Add	1				90
	Instruments	BUS	×	2	0000	Advanced Query Nar	ne 🖉 🖉
	Loops	Item Type Instrument	Tag1D J		Calibration ID Cr	Scheduled 5/04/2011	Cal Frequency
alibration	© Equipment	Calibration Information	Test Results   Test h	nstruments   SOP	User Defined   Notes	1	
Record	S Test Instruments	Description	Equipment	0	Equipment Description	Model Number	Senal Number
	Calibrations	Department	Location		Building	P+ID Number	P+ID Revision Number
	Documents	Classification	Status		Manufacturer	Item Approved By	Item Approved On
	Upload/Download	General Calibration Info Temp Humidity	Calibration Type				
	Logged Data	Certificate #	Who Calibrated	-			
	1	Man Hours Reason	for Failure	New     Eal Pts		Finalized By	Date Finalized
		Entered By		Date Entered	Finalized	Modified By	Last Modified
		New Current Query	r: Default	4	-		

Figure 19.1

Note

It is not necessary to fill in all empty fields. However, you must enter an Item ID, the Calibration Date, and either select "Pass", "Fail" or "Incomplete" to save a new record.

### 19.2 Tabbed Notebook Section

The tabbed notebook section of the CALIBRATION screen contains six (6) different subscreens or "pages" available for data entry. These pages are logically grouped on the tabs of the notebook. To open a tab page, click it with your mouse. Each page and its associated fields are described below.

#### 19.2.1 Header Fields

These fields will always appear at the top of the page no matter what tabbed page you are on

#### 19.2.1.1 Item Type

When adding a new record you must first select the *Item Type* from the drop down list (Instrument, Loop or Test Instrument)

#### 19.2.1.2 Item ID

There are two ways to enter an ID. If you know the ID you may type it in. (quick type does not function in this field) If you are not sure of the item's ID number, you may click the (...) button next to the *ID* field. This will invoke a master list of all items of the selected type. Selecting an item from the list and clicking the <u>OK</u> button will insert that ID into the field.

#### 19.2.1.3 Calibration ID

When a new calibration record is saved, the System assigns it a unique number, which then appears in this field indefinitely.

#### 19.2.1.4 Calibrated & Scheduled Dates

DPCTrack2 automatically inserts today's date into the *Calibrated* field, but this date can be modified by typing a new one into the field. The date in the *Scheduled Date* would be the date that the item is actually due for the calibration.

#### 19.2.1.5 Cal Frequency

This field will fill in automatically when the ID is selected. If the item does not have a frequency set up then this field will be blank. This field can not be modified.

#### 19.2.2 Item Info (As of Calibration Record Entry Date)

This portion of the page contains information pulled from the ID type entered. This field is not modifiable and will not change. (Example: If the location changed after the calibration was completed, this calibration record would always show the Location at the time the Calibration was performed)

#### 19.2.3 General Calibration Info

This portion of the page contains general information about the calibration.

#### 19.2.3.1 Temperature & Humidity

These two fields are alpha numeric and you can enter up to 20 characters in each.

#### 19.2.3.2 Calibration Type

This field can be filled in by selecting from the drop down list. For more information see Chapter 12

#### 19.2.3.3 Certificate #

This is an optional alpha numeric field available to help manage your calibrations. You can enter up to 20 Characters.

#### 19.2.3.4 Who Calibrated

You may either choose from the drop down list or to add a technician select New. For more information see Chapter 12

#### 19.2.3.5 Man Hours

This field can manually entered up to 9,999.99

#### 19.2.3.6 Reason for Failure

This field can be set as "Required" Company level have been turned on. If this option is turned on and a "Failed" calibration is entered, you will not be able to save until a reason is given. This is an alpha numeric field up to 50 characters.

#### 19.2.3.7 # of Cal Points

This field will list the amount of calibration points, if any, and is not modifiable.

#### 19.2.3.8 Finalized, Finalized By & Date Finalized

This check box is for finalization of a calibration. Depending on your settings, this box may not be accessible and grayed out. The Finalized By & Date Finalized fields will be filled in upon saving a Finalized calibration.

#### 19.2.3.9 Automatic Date Rolling Functionality

Keep in mind that when a new calibration record is entered for an Instrument, Loop or Test Instrument, DPCTrack2 is designed to automatically roll its next scheduled calibration date forward another frequency cycle upon a passing calibration. When

#### Find Quality Products Online at:

## www.GlobalTestSupply.com

entering a calibration, if the date calibrated is within the period of the current frequency, a checkbox will appear in the *Roll Dates and/or Close These Items On Calibration Completion* box on the *Calibration Information* tab (for more information on configuring frequencies see Chapter 12). The text of the checkbox indicates the current due date and the next scheduled date that will be applied to the item upon a successful calibration.

Once a new calibration record is saved, all events that took place as a result of the entered calibration will be listed, but grayed out and inaccessible in the *Roll Dates and/or Close These Items On Calibration Completion* box. These events include next due date that may have been rolled forward for calibration and updates to the item's status. From the time the calibration is saved, this information will always be available on the record. Additionally, you may double-click any of the items listed to open the specified record.

### 19.3 Test Results Tab

Once you have finished entering data on the *Calibration Information* tab you may proceed to enter the results of the calibration on the *Test Results* tab shown in Figure 19.2. All test points will be listed in order and grouped accordingly. You may use the <u>Next Group</u> and <u>Previous Group</u> buttons at the top of the tab to move between test point groups, if applicable.

#### 19.3.1 Test Point Groups

The *Point* column lists all test points for the current group by group number and test point number. All found as and left as values may be entered into the columns labeled as such in the *Readings* section of the grid. The calibration record shown in Figure 19.2 has the *Separate As Found/As Left Inputs* box unchecked, it shows both rows for each individual test point. If the box was checked then you would have to toggle between the two fields.

<del></del> Cali	ibration (Ad	d)							_ax			
Item Ty Instru	<b>/pe</b> ment	Tag I	D MPRES_TRANS	Ca	libration ID Cal	ibrated /29/2011	Scheduled 04/30/2011	Cal Frequency Annual				
Calibra	Calibration Information Test Results Test Instruments SOP User Defined Notes											
Group	Group 1 of 1 [Pressure Transmitter]     Input Signal            Previous Group         Show         Group Details         In Low Range         In High Range         mA         4.00         20.00      Output Signal         Output Signal         Output Type         Output Type         In Low Range         In High Range         mA         4.00         20.00         Content of the second seco											
	Pass Adjusted To Imp	C Fail	C Separate As Fot	Incomplete und/As Left Readings			👸 Modify Spec	es Status In Service	•			
Point	Input	Ac	tual Inputs	Output Specification:	s Read	dings	Description					
G-#	Nom In Val	In Val	In Type	Out Val Out Type	Fnd As	Lft As						
1.1	0.00	0.00	psi	4.00 mA								
1.2	50.00	50.00		12.00 mA								
1-3	100.00	100.00	psi	20.00 mA								
New	Current Que	ery: Default										

Figure 19.2

# www.GlobalTestSupply.com

If you are not utilizing *Separate As Found/As Left Inputs* and the left as value for a test point is the same as the found as value, then you can enter the *Fnd As* value, click on the *Lft As* cell, and just hit the equal (=) key on your keyboard to automatically transfer the same value to the *Lft As* cell. (This will only work if the *Lft As* value is blank.)

If you need to see more information about the item such as accuracies and/or limits you may display this information on the screen by selecting "Columns" from the **View** menu at the top of the screen. This will give you the option of choosing the additional information that you would like to see.

Additionally, the <u>Show Group Details</u> button will provide you with any other information for the test point group (as entered on the item's master record) that is not already shown on the screen.

When you add a new calibration record, any information entered into the *Description* column on the record providing the calibration specification source will automatically appear in this column on the CALIBRATION screen. You then have the option of modifying the default descriptions and/or adding new information into the other *Description* cells.

#### 19.3.2 Separate As Found/As Left Inputs

Marking this box will allow you to record separate as found and as left input values when entering calibration records for Instruments, Loops, and/or Test Instruments. The ability to document separate as found and as left inputs is useful when performing calibrations in which it is very difficult to reach the nominal input value as stated on the item's master record. The *Separate As Found/As Left Inputs* setting provides the ability to recalculate an item's expected output values and low and high limits to accurately reflect the input values that were achieved during the calibration.

When entering a calibration using *Separate As Found/As Left Inputs* you have the ability to change the view in the grid to either simplify things or give you a big picture view of the calibration. The button to the right of the *Separate As Found/As Left Inputs* box toggles to provide you with four (4) different options. Clicking this button with your mouse allows you to view and enter *Left As* values (Enter Left As or View Left As), view only the *Fnd As* values (View Found As), or view both columns at the same time (View Found As).

If the <u>View Found As/Left As</u> option is on then, every other cell appears with five (5) dashes (-----) denoting that values are not required in those cells. (Note: If the *Separate As Found/As Left Inputs* box is not marked, the toggle button will not appear on the screen.)

#### 19.3.3 Modifying Calibration Specifications

If you need to change any of the information or values in the calibration specifications grid, for example input signals, resolutions, signal types etc., you may do this by clicking the <u>Modify Specs</u> button. Doing this will open up most of the grid's cells and make them available for modification. The only columns that will stay inaccessible are those that are in the *Point* and *Input Specifications* sections. The values in the *Nom In Val* and *In* +/- columns represent the target setpoint for each input value in addition to the *Input Tolerance*, while the data in the *G*-# column denotes each row by group number and test point number within that group.

If your changes will affect the output values, low and high spec limits then click the <u>Recalculate</u> button to select from one of the following three options, "Calculate LINEAR outputs and limits", "Calculate SQUARE ROOT outputs and limits" or "Calculate Limits". (Note: If the item is set to "Linear" then the "Calculate SQUARE ROOT" will not be accessible and if set to "Square Root" then "Calculate LINEAR outputs and limits" will not be accessible. If "Manual" is selected then both will be available) Once

#### **Find Quality Products Online at:**

## www.GlobalTestSupply.com

you have finished making modifications, you may click the <u>Protect Specs</u> button to shield the columns again from accidental modification. The <u>Protect Specs</u> button appears when you click the Modify Specs button, see Figure 19.3 for an example.

tem Typ	se .	e II	ument ID		- 11	Calibration	ID Calbral	ed \$eh 2006 4/	eduled 30/2007	Cal Frequency	-				
albrah	on Information	Test Re	nuits Lost	Instruments	SOP Ue	er Defined	Notes	-				LAA	cancerd Guerra Na		10
guoup	T of T [Group	1	-	Input Signal				Out	put Signal			110		•	
5	Vertices.	1	Group Details	Input Type	InLo	+ Range	In High Ra	nge Out	put Type	Out Low Rang	pe Dut High Range	ed 2006	Scheduled 4/30/2007	Cal Requercy	
17 A	Past (justed To Imp	(° Fa	il Separate	C <sup>*</sup> Incom As Found/As	ylete Leit Readin	01-		1	Modily Speca	Statur	- 2		Output Signal		
ort	Input Specif	cations	Actu	al Inputs	Output S	pecification	R	eadings	1	no plon		ge	Output Type	Dut Low Range	Dut High Rang
1.1	0.0000	0.0000	0.0000	Dep	A (1000	Lose Type	A (12)	1399				-		_	
12	50,0000	0.0000	50,0000	Ling C	12 0000	-	12.19	12.06	-				Protect S	peca Status	
3	100.0000	0.0000	100 0000	DegC	20 0000	rah i	207	20	-			-	Recalcu	lite 1	2
4	100,0000	0.0000	100 0000	DepC	20 0000	This	12	20			-	and so the		Desception	
-5	50.0000	0.0000	50 0000	Deg C	12.0000	1	1219	12.19	-	-			JTA:		
-6	0.0000	0.0000	0.0000	DepC			4.02	4.02	-			3.9	3		
_	-					L	-	-		_		121	06		
- 1		Mar	HALL CA	and (ch	-	e the	loft)	000	00 DegC	50,0000	mA 20.23	20	1		
	1.1.1.1.1.1	MOC	my Sp	ecs (sn	own o	n the	ient)	000	00 DegC	20,0000	tsA 20.23	20			
Protect Space (shown on the right) 000 beg 12000 wA 2023															

Figure 19.3

There are several important things to remember when you elect to modify the calibration specifications for an item when entering its calibration record. These are as follows:

Modifying an item's calibration specifications in the CALIBRATION screen <u>will not</u> alter its master record. Permanent changes to calibration specs must be made in the MASTER INSTRUMENT, LOOP RECORD or TEST INSTRUMENT screens.

If a "Linear" or "Square Root" *Correlation to Output* was selected on the calibrated item's master record, then the output values in the grid on the CALIBRATION screen will not be modifiable, however any changes made to input values will automatically trigger an update to their corresponding output values.

Options selected on the COMPANY RECORD screen may affect your ability to modify information in the calibration specifications grid. (See Chapter 9 for more information.)

### 19.3.4 Classifying the Result of a Calibration

Depending on the results of the calibration, you may select *Pass, Fail* or *Incomplete* in the box above the test point grid. If you do not select an option, the System will not allow you to save the calibration. In addition, if the *Adjusted to Improve* box is applicable to your calibration, it is suggested that you check it since this can be used as selection criteria in advanced queries. By default, this can be used to indicate that the item was adjusted between the As Found and As Left tests.

DPCTrack2 provides you with the ability to mark an unfinished calibration as "Incomplete". The *Incomplete* circle can only be chosen if neither of the other two result circles have been selected. Denoting a calibration record as incomplete instructs the System to ignore the information currently entered on the record so that saving it does not generate any failure or out of tolerance warnings and none of the dates are rolled forward. This feature allows you to save your work often without affecting the state of the current item, or enter calibrations that may take hours or even days to obtain appropriate readings.

#### 19.3.5 Automatic Warnings and Messages

There are several automatic warnings and messages that may appear on your screen as you save a new calibration record. In this case the term "automatic" refers to the fact that the appearance of these warnings and messages does not hinge upon the selection of any Company options or default settings that may have been established in the database.



Figure 19.4

- 1. If you attempt to save a new record but have not selected the *Pass, Fail* or *Incomplete* circle, the System will warn you of this and you will not be able to continue with the save until one of them is selected.
- 2. If you try to save a failed calibration record, but you have selected the *Pass* circle instead of the *Fail* circle, the System will also warn you (see Figure 19.4). In addition, this warning screen will also tell you at which test point(s), in which groups the item failed. When the message screen appears, you may click the <u>Yes</u> button to instruct the System to automatically mark the *Fail* circle for you, thus saving the record as a failed calibration. If you click the <u>No</u> button, the new record will be saved as a passed calibration and the *Pass* circle will remain selected. Finally, clicking the <u>Cancel</u> button will return you to the unsaved record. Conversely, if the *Fail* circle is selected, but there are not any test points that were actually left outside of the acceptable spec limits, then upon saving the record the System will warn you of this and ask if you would like the *Pass* circle selected instead.
- 3. There is also warning that will be displayed if there are any "Found As" readings that are out of tolerance. This warning will be displayed on every save.
- 4. If during a calibration the item specs have changed, then the user will receive a warning message. This warning will be displayed on every save.
- 5. Another message that may appear on your screen when saving a new calibration record has to do with the current status of the Instrument, Loop or Test Instrument. If in the company's COMPANY RECORD, you chose a *Calibration Failed Status* and a *Calibration Passed Status* (see Chapter 9), then a message may appear asking if you would like to have the System change the status of the item for you. The appearance of this message depends upon the results of the calibration, whether the *Pass* or *Fail* button has been selected for the record.

# Find Quality Products Online at: www.GlobalTestSupply.com

For example, imagine that you are in the process of saving a calibration record that failed. If the item's current status is "In Service", but the *Calibration Failed Status* that was declared in its COMPANY RECORD was "Needs Repair", then a message will appear asking if you would like to have the item's status changed from "In Service" to "Needs Repair". Conversely, if you are saving a passed calibration and the item's current status is "Needs Repair", but the *Calibration Passed Status* that was declared was "In Service", then a message will appear asking if you would like to have the item's status changed to "In Service". It is important to remember that you do not need to wait for the program to suggest a status change. The *Status* field on the *Test Results* tab will remain active in the *Calibration* screen until the record is saved. Therefore, prior to saving a new record, you can manually change an item's status at any time so that as soon as the new record is saved the status will have been changed on the item's master record as well.

# 19.3.6 Warnings and Messages That May Appear as a Result of Options and Default Settings

There are other warnings and messages that may appear when you save a calibration record. The appearance of these warnings and messages depends upon the selection of various Company options and default settings that may have been established in the database.

#### 19.3.6.1 [Warn, Restrict, Allow] If Calibrated Item Is Not Approved

This setting is used to manage the entry of calibration records for approved and unapproved item master records (master records for Instruments, Loops and Test Instruments). For more information see Chapter 9 If "Allow" was selected for this field in the COMPANY RECORD screen, then you will be able to enter calibration records for items whose master records have not been approved yet. If this is the case, then no messages will appear on the screen when adding a new calibration record for an unapproved item. If "Restrict" or "Warn" was selected, then when you attempt to initiate a new calibration record for an unapproved item, an appropriate message will appear on the screen to let you know whether or not you may proceed. If "Warn" was selected, you may get a warning while saving the record that the current item is not approved.

#### 19.3.6.2 Force Calibration Failure

This is an option that when selected will not allow a failed calibration (one with at least one as-left value that is outside of the acceptable limits) to be saved as a passed calibration. If this check box was marked in the COMPANY RECORD screen, (see Chapter 9) then upon attempting to save a failed calibration with the *Pass* circle marked, the message that usually details the test point groups that have failed test points informs you that the System will automatically reset the result to the *Fail* circle instead. You can either accept this action by clicking *OK* or cancel the save process by clicking *Cancel*. If the out of tolerance *Lft As* values are then adjusted to within tolerance, the *Pass* circle may be selected again, in which case the forced failure message will no longer appear on the screen when the record is saved.

#### 19.3.6.3 Users Cannot Finalize Calibration They Entered

This is an option that disallows the same user to enter and then finalize a calibration record. If this check box was marked in the COMPANY RECORD screen, (see Chapter 9) then upon attempting to save a calibration record that you both initially entered and then finalized, a message will appear on the screen informing you that you cannot proceed with the save until the *Finalized* box is unchecked.

#### Find Quality Products Online at:

# www.GlobalTestSupply.com

#### 19.3.6.4 Require Reason For Failure On A Failed Calibration

This is an option that when selected will not allow you to save a failed calibration record unless the *Reason for Failure* field has been completed. If this check box was marked in the COMPANY RECORD screen, (see Chapter 9) then upon attempting to save a failed calibration without this field filled in, a message will appear on the screen instructing you that you cannot proceed with the save until a *Reason for Failure* is documented.

#### 19.3.6.5 Allow The User To Finalize Incomplete Calibrations

This is an option that when selected will allow "Incomplete" calibrations records (ones whose *Incomplete* circle is marked) to be finalized. If this check box <u>was not</u> marked in the COMPANY RECORD screen, (see Chapter 9) then the *Finalized* box will be grayed out on any calibration marked as incomplete. Once the *Pass* or *Fail* circle is marked, the *Finalized* box will become accessible again. If this check <u>was</u> marked in the COMPANY RECORD screen, then the *Finalized* box will always be available regardless of the circle selected.

#### 19.3.6.6 Only Show Active Test Instruments

This is an option that if selected on the Company screen, (see Chapter 9) will restrict the display of Test Instruments in the CALIBRATION screen to only those Test Instruments that are currently assigned an "active" status (on whose record has the *Show items with this status on calibration scheduling reports* box marked). All Test Instruments in the System that are not assigned an "active" status or if their status is left blank will not be displayed on the screen and therefore will not be available for assignment to a calibration record.

#### 19.3.6.7 [Allow, Warn, or Restrict] On Use Of An Unapproved Test Instrument

This is a setting that is used to manage the selection of approved and unapproved Test Instruments in the CALIBRATION screen. If "Allow" was chosen for this field, from the Company screen, (see Chapter 9) then users will be able to assign unapproved Test Instruments to calibration records without any warning message appearing on the screen. If "Restrict" was selected for this field then any unapproved Test Instruments will not even be listed in the *Available Test Instruments* box, regardless of their current status. Finally, if "Warn" was selected, than when a user attempts to select an unapproved Test Instrument to be moved to the *Test Instruments Used in Calibration* box, a message will appear on the screen warning them that they have chosen a currently unapproved test standard.

#### 19.3.7 Entering Calibrations in Multi-Mode

DPCTrack2 provides you with the ability to add multiple calibrations at once without having to save each one before moving onto the next. This is done by selecting "Turn on Multi-Mode" from the **Multi-Mode** menu at the top of the *Calibration* screen. When this method of record entry is selected, the top of the *Calibration* screen will then hold the IDs of each calibration in progress and the advanced query section and toggle buttons will disappear. (See Figure 19.5).

To select multiple items to work on at the same time, initiate each calibration record just as you would normally by clicking the "Add New Record" button, selecting the appropriate *Item Type* and entering the item's ID. As each new calibration is started, it will be posted at the top of the screen in the toolbar. You may also select calibration records that have already been saved to view and/or work with in "Multi-Mode". To add existing calibrations to your current group, click the "List Records" button and doubleclick the desired calibrations one by one from the list.

#### **Find Quality Products Online at:**

## www.GlobalTestSupply.com

Once a calibration record is completed and saved, the text on its button will turn black and its ID will no longer contain the word "New" next to it. (Note: Each calibration record must be saved individually. Calibration records cannot be saved as a group.)

B H 7 (6	× l=	7 )-0-1	11 - 61248 = 11 . CHART	TI-001
tem Type Calibration Internation	Instrument D	Call	Calibration Record	led Cal Frequency 2005
nem Into (As of Calibrati Description Temperature Indicator	on Record Entry Datel Equipment ID	Equere	Currently Displayed	Serval Number 10102514811)
Department	Location QLI West Cheste	PA Building		P+ID Revision Number
Classification	Statue In Service	нат	Only Saved	V. Item Approved On 04/19/2006 9 33:05 AM
General Calibration Into Temp Humidity Centricate II V	Calibration Type	Rol Dates a	Calibration in the Active Group	Completion to 03/31/2007 [If Passed] to 04/30/2007 [If Passed]
Man Hours Beason I	or Failure 1	CalPts		Date Finalized
Eutora Eu		ale Enlered	Modified Ba	Last Modiled

Figure 19.5

Calibrations may be dropped from the current group at any time regardless of whether or not they have been saved. To remove an open calibration record from the current "Multi-Mode" group, select its button in the toolbar or select it from the **Multi-Mode** menu, then choose "Drop Current Calibration" from the menu. This will remove the selected calibration from the current group. To turn off the "Multi-Mode" functionality you must drop all but one record from the active group, then choose "Turn off Multi-Mode", again from the **Multi-Mode** menu. Note: Upon exiting from the Calibration screen, Multi-Mode will turn off and will have to be reactivated.

### 19.4 Test Instruments Tab

This tab page allows you to document the Test Instruments that were used in the calibration. It has two list boxes, titled Available Test Instruments and Test Instruments Used in Calibration. Noting the Test Instruments used in calibrations is necessary for most Quality Assurance programs. It can also be useful in the investigation of problem calibrations, and allows for users to perform reverse traceability on their instrumentation.

All Test Instruments IDs listed are followed by the name of the company that owns them to make for easier identification. You may select any number of Test Instruments from the *Available Test Instruments* list and move them to the *Test Instruments Used in Calibration* list. To do this, highlight the Test Instruments desired and click the center arrow buttons, as needed.

#### 19.4.1 How Instrument Types Affect the Available Test Instrument List

If you have entered a calibration for an Instrument that has been assigned an *Instrument Type*, (see Chapter 17) then only the Test Instruments that were set to calibrate that Instrument type will be listed in the *Available Test Instruments* box. If the *Instrument Type* field on the Instrument's master record was left blank, then all Test Instruments will be displayed in the *Available Test Instruments* box. Note that this functionality is not applicable to calibrations entered for Loops, Systems or other Test Instruments.

In addition, the "Quick View" function allows you to view information from each Test Instrument's master record. To do this, highlight one or more Test Instruments and rightclick with your mouse. A box labeled "Quick View of Selected Test Instruments" will appear. Click this box with your mouse and every Test Instrument you highlighted will appear in a grid showing their model numbers, serial numbers, statuses, etc.

#### 19.4.2 Show All

Selecting the *Show All* button will show all Test Instruments regardless of Instrument Types

### 19.5 SOP Tab

This tab displays information about the SOP that was linked to the calibrated item. It shows the *SOP Number*, *Revision Number*, *SOP Title* and any data entered onto the *Procedure* tab of the SOP record. This page is a read-only screen meaning that it cannot be modified in any way. It is included in the CALIBRATION screen so that it may be easily referenced.

The <u>Change SOP</u> button allows you to document the actual SOP that was followed when the calibration was performed, if it differed from that recorded on the item's master record. To record a different SOP number with a calibration record, click the <u>Change</u> <u>SOP</u> button. This action will invoke the <u>Select Calibration Procedure Used</u> screen. In this screen you may then highlight the SOP desired and click the <u>Change</u> button. If however, you would like to remove the current SOP, but not replace it, then click the <u>Clear SOP</u> button.

Keep in mind that if you elect to change or add a SOP used for the calibration of an item, it will only appear on that calibration record. The item's master record will not be affected in any way.

### 19.6 User Defined Tab

This tab page contains all user defined variables (fields) that have been set up for the CALIBRATION screen. (See Chapter 10 for instructions about how to set up user defined variables.)

#### Note

If the CALIBRATION screen contains user defined variables whose names match user defined variables on the calibrated item's Master record and the variable is NOT a signature, the value will be filled in as a default value from the master record upon initial calibration entry. However, the user can still modify the user defined variables in the CALIBRATION screen.

# www.GlobalTestSupply.com

### 19.7 Notes Tab

This tab page is used to enter and/or view notes for the calibration record. To enter a new note, click the <u>Add a Note</u> button. Type text into the field provided and click the <u>Save</u> <u>Record</u> button on the screen's toolbar.

Once a note is entered and saved for the record it cannot be modified or deleted. As new notes are added, they will be inserted at the top of those listed (most recent notes first). As the record acquires multiple notes, you may change their order by clicking the <u>Sort</u> <u>Ascending/Descending</u> button.

# Chapter 20 Import DPCTrack Data

### Title

### Page

Import DPCTrack Data	
Field Mapping	
Frequency Mapping	
Possible Errors/Warnings	
Compatibility Limitations	
Limitations For Instrument Imports	
Limitations For History Imports	
	Import DPCTrack Data Field Mapping Frequency Mapping Possible Errors/Warnings Compatibility Limitations Limitations For Instrument Imports Limitations For History Imports

## 20.1 Import DPCTrack Data

DPCTrack2 allows the ability to move data from DPC/Track to the new DPCTrack2 database. Before you can perform the Import, you will need to perform an Export of your History, Instruments and Procedures from DPC/Track, to ensure that you have the most up-to-date records. For more information about Exporting records from your DPC/Track database, refer to your DPC/Track User Manual.

The Import DPCTrack Data screen can be accessed from the Home screen by selecting TOOLS  $\rightarrow$  "Import DPCTrack Data". You must be a member of the ADMIN group to access this screen. The screen shown below (Figure 20.1) is separated into three (3) sections. The first section allows you to identify the current locations of your History, Instruments & Procedures, as well as, define the destination of the Log file.

E DPC Track Le	egacy Data Im	iport			-8x
History File Locati	on				🕞 Find
Instrument File Lo	cation				🕒 Find
Procedure File Lo	cation				🕞 Find
Migration Log File C:\DPCTrack2\L	Location .ogs\Conversion_	_Log_02JUN2011_11454	5.log		🕞 Change
Field Mapping Set Instruments "S In Service Map "Location" to Location	Status'' to	Map "Responsible" to Responsible Technicia Map "Area" to Building	n ¥	Default Testpoir 10.00 50.00 90.00	nts (in %) + -
Frequency Mapping Click Here to Retrieve Frequencies and Attempt Auto Map	Interval Unit	Interval Value	Resultant	Frequency	
<b>?</b> <u>H</u> elp		/alidate Files	Initiate Impor		<u>C</u> lose

Figure 20.1

# www.GlobalTestSupply.com

#### 20.1.1 Field Mapping

The second section shows you how your old DPC/Track data will be mapped into DPCTrack2. The Status field will default to the first status defined e.g "In Service" in the list, "Responsible" in DPC/Track will be mapped to "Responsible Technician" in DPCTrack2, "Location" will be mapped to "Location", "Area" in DPC/Track will be mapped to "Building" in DPCTrack2. See 20.3.1 Limitations For Instrument Imports for further explanation. The Default Testpoints (in %) are the percent of span for the input testpoint if "Default" was specified in DPC/Track. The output span will be determined by the "Correlation to Output" as designated for the given item in DPCTrack2. If the data in these fields does not exist, the program will create them.

#### 20.1.2 Frequency Mapping

The third section allows you to map your DPC/Track intervals into DPCTrack2 calibration frequencies. Figure 20.2 shows the *Auto Map* feature has already matched 4 of the frequencies. You can then choose from the existing frequencies to match them manually, or if the frequency does not exist, you can close the Import DPCTrack screen and add the frequencies that you need.

-Frequency Mapping	g				
	Interval Unit	Interval Value	Resultant Frequency		
	Daγs	21	3 weeks		
Click Here to	Weeks	3			
Retrieve	Months	6	Semi-Annual		
Frequencies	Quarters	6			
and Attempt	Years	1	Annual		
Auto Map	Weeks	6			
	Years	3			
	Months	1	1 month		
	P				
? Help	Valid	late Files 🗸 🗸	Initiate Import		

Figure 20.2

When all your fields have been mapped, you can select the "Validate Files" to make sure that the file structures are correct.

Ν	ote
---	-----

It is recommended that you perform a Backup of the database before you Import data. This will give you an opportunity to review the error log, fix any problems, restore the database and perform another Import if necessary.

Selecting "Initiate Import" will open a conformation screen. (If there are any fields that have not been mapped, you will also see an additional warning.) Selecting "No" will cancel the Import. Selecting "Yes" will initiate the Import. Upon completion of the Import, you will receive a conformation screen. The log can be viewed either on the screen, or you can navigate to the Log file.

All records imported will have the *Approved* checkbox checked with a corresponding Time/Date stamp.

## 20.2 Possible Errors/Warnings

- Duplicate ID If the ID already exists for the same Item Type in the database, the record will not be imported.
- Duplicate ID's for different Item Types If the Company setting for "Prevent Duplicate ID's Across All Record Types" is checked, then the record will Not be imported if a record already exists with the same ID.
- Tag IDs (Instruments) or Loop IDs that are greater than thirty two (32) characters DPCtrack2 has field length restrictions and if either of these ID fields are too long the ID will not be created.
- List Items and open text fields that exceed the field length limits will be truncated:
  - o Manufacture 50 characters
  - Responsible Technician 50 characters
  - Signal Type 50 Characters
  - o Model & Serial Number 100 characters

## 20.3 Compatibility Limitations

#### 20.3.1 Limitations For Instrument Imports

The following is a list of limitations:

- **Description Field** The Description field is new to DPCTrack2 and Imported records will use the same value as the "Instrument Type".
- **Buildings** Buildings in DPCTrack2 are a component of a Location, if the Location field in DPC/Track is blank, then a Location of "Not Specified" will be created and the Building will be assigned as a component.
- **Test Equipment** Test Equipments in DPC/Track are NOT imported. These records will have to be manually entered into DPCTrack2.

#### 20.3.2 Limitations For History Imports

The following is a list of limitations:

- Next Cal Date When possible the utility will attempt to calculate the "Next Cal Date" on the Instrument screen. To do this, the Instrument record must have a calibration frequency assigned.
- **Test Equipment Used For Calibrations** DPCTrack2 will list the Test Equipment used for calibrations (if any) with the value listed for the Serial Number. If the Serial Number field is blank, the Test Equipment will NOT be associated to the calibration.
- **History Records Without a Valid ID** If the Tag ID does not exist as a record in DPC/Track, DPCTrack2 or if the Tag ID is blank, the calibration history will NOT be imported.

Note

There is no limit to how many times you can import your data, but keep in mind that if you perform multiple imports with the same "history\_out.asc" file, you will create duplicate calibration results in DPCTrack2.

Example: An Import is performed that creates 40 Instruments each with 3 calibration results. Your log file indicates that 3 calibration results for the same Instrument ID were not imported because the "ID Does Not Exist in the Database". If you manually create the Instrument ID and run the import again, there will be no change to the previously imported Instrument records but 3 additional calibration results will be created for the original Instruments.

#### Note

*If the Instrument record already exists in DPCTrack2, the import will NOT update the record.* 

#### Note

*The following records will not be migrated into DPCTrack2 from DPCTrack files* 

- Instrument Records with no Tag ID
- Instrument Records with a Tag ID longer than 32 characters
- Instrument Records with duplicate Tag IDs (first one will be migrated, subsequent ones will be kicked out)
- History Records with a blank Tag ID
- History Records that do not have a corresponding Instrument record in the database
- *History Records that are not one of the following types:* 
  - o 74x Binary
  - o Manual Binary
  - o Manual Analog
  - o 702 Analog
  - o 74x Analog
  - o 74x Logged Data

www.GlobalTestSupply.com

# Chapter 21 Advanced Queries

### Title

### Page

21.1	Advanced Queries	
21.1.1	Running Previously Saved Advanced Queries	
21.1.2	Creating New Advanced Queries and Modifying Existing Quer	ies21-3
21.1.2.1	Display Fields Section	
21.1.2.2	2 Sort Fields Section	21-5
21.1.2.3	Selection Criteria Section	
21.1.2.4	Wildcard Characters (Matching Parts of Strings using	
	"LIKE" and "NOT LIKE")	21-6
21.1.2.5	5 Using Date Field Key Words	
21.1.3	Action Button Sets	21-9
21.1.3.1	Action Buttons Set 1 (shown beside the Selection Criteria	
	During Query Execution box)	21-9
21.1.3.2	Action Buttons Set 2 (shown below the Selection Criteria	
	During Query Execution box)	21-10
21.1.4	Navigating Between Records Included in an Advanced Query I	List 21-10
21.1.5	Printing Lists and Saving Them to External Files	21-11
21.1.6	Using Advanced Queries in Other Parts of the Program	

### 21.1 Advanced Queries

In each of the main screens in DPCTrack2, (except the Company screen) you have the option of listing all of the records that have been entered into the system for the company. This option is available from either the **File** menu or the sub-category toolbar in each of those screens (see Chapter 5).

When pulling up a list however, DPCTrack2 lets you go further by giving you the ability to perform more detailed inquiries and saving them for later use. These are referred to as, "Advanced Queries". Using advanced queries allows you to generate more refined record lists based upon specific sets of criteria determined by you.

#### 21.1.1 Running Previously Saved Advanced Queries

Every main screen has an *Advanced Query Name* field in its header. This drop-down list will always contain the names of all queries previously saved for the current record type. To run a previously saved query, select it from the drop-down list and click the <u>Execute</u> <u>Query</u> button next to the field.

#### 21.1.2 Creating New Advanced Queries and Modifying Existing Queries

To create a new query or modify an existing one you must actually access the ADVANCED QUERY screen. This may be done in one of two ways. First, you must have one of the record screens in the program open, then either click the <u>Open Advanced</u> <u>Query</u> button in the record screen's header (Figure 21.1) or click the <u>List Records</u> button on the screen's sub-category toolbar. Once in the full list of records, click the button labeled <u>Advanced</u> at the top of the list grid screen. (Please note that although advanced queries can be created and accessed in many areas of the program, for the sake of clarity and consistency, the MASTER INSTRUMENT screen will be used as the basis for all examples and instructions included in this section.)



Figure 21.1

**Find Quality Products Online at:** 

# www.GlobalTestSupply.com

The ADVANCED QUERY screen (shown in Figure 21.2) has several different sections, each of which is described below. To build an advanced query you can define criteria in each of the sections or any combination of the sections. The selection options for each area of the screen are comprised of every field in the record type you are currently working in. This includes any user defined variables added to the record type.

In addition, all fields will be listed under their current label names. This is important to note if you have modified field label names (see Chapter 8). For example, if you changed the label of the *Instrument ID* field to "Asset #", "Asset #" will appear in each section's field name list. "Instrument ID" will not be shown.



Figure 21.2

#### 21.1.2.1 Display Fields Section

This section lets you determine which fields you want to be displayed in the advanced query list. To select a field that you want displayed, highlight it in the *Available Fields* box and click the <u>Add</u> button. This will move it to the *Other Fields To Display* box. To move it back, highlight it again and click the <u>Remove</u> button. You may also change the order in which they are to appear. To do this, highlight one of the fields in the "Other Fields to Displayed" and use the Move arrows to define the order.

The fields displayed should include at least those that will be used in the selection criteria for the query, but keep in mind that you may choose as many fields as you like to appear in the list. For example, if you were building a query to list all instruments calibrated yearly, then you would probably want to at least display the *Calibration Frequency* field. However, to make the list more detailed, you could also have each instrument's *Model Number* and *Serial Number* displayed. Please note that the *ID Number* and *Description* fields will always be displayed in advanced query lists. There is no option to remove these.

21-4

**Find Quality Products Online at:** 

#### 21.1.2.2 Sort Fields Section

This section lets you determine how the advanced query records should be sorted. For example, you might want to generate a query list in which the instrument records shown are sorted by *Department*. Sorting by one or more fields is not necessary, however it will make your advanced query listings more organized. To select a field to sort by, highlight it in the *Available Fields* box and click the <u>Add</u> button. To move it back, highlight it again and click the <u>Remove</u> button.

#### 21.1.2.3 Selection Criteria Section

This section, which comprises the entire gray area of the screen, is the most important part of constructing an advanced query. It is in this section, that you state the selection criteria that **must be** met in order for a record to be included on the query list generated. If you plan to use at least two different sets of selection criteria then you must click either the *And* or *Or* circle. If you choose *And*, the query will include those records that meet <u>all</u> of the selection criteria you have defined. If you choose *Or*, the query will include records that meet either one set of selection criteria <u>or</u> the other. If you are only going to use one set of selection criteria, then it does not matter which circle is marked.

For every set of selection criteria that you decide to use in your query, you must perform the following steps:

- 1. Choose a field from the Selection Field Name drop-down list.
- 2. Select an *Operation* (i.e. =, >, <, etc.).
- 3. Enter a *Selection Value*. Depending on the type of *Selection Field Name* you chose in Step 1, the *Selection Value* may either be typed into this field manually or selected from a drop-down list. For example, if your *Selection Value* were a date, then you would key the desired date into the field or select a date keyword from the drop-down list. However, if the value is a manufacturer, then the manufacturer's name can only be inserted into the field by selecting it from the drop-down list. (The drop-down list is activated upon declaration of the *Selection Field Name* in Step 1. In this example, it would contain all manufacturers that have been assigned to at least one instrument record in the system for the company.)
- 4. Once you have performed Steps 1-3, you must click the <u>Add To Selection Criteria</u> button which will move it into the *Selection Criteria During Query Execution* box.
- 5. Click the Execute button to generate the query list.

An example of a completed advanced query can be seen in Figure 21.3 on the next page. It shows an advanced query for the MASTER INSTRUMENT RECORD screen that will generate a list of every instrument manufactured by "Foxboro" **and** is calibrated "Annually". The query will also sort the listed records by their *Last Cal Date*. Finally, data from the following fields will be shown for each record included in the query list: *Instrument ID*, *Description*, *Calibration Frequency*, *Last Cal Date* and *Manufacturer*.

## www.GlobalTestSupply.com

-	Instrument	t								-8x
							🗸 ок	?{] <u>A</u> dvanced	🗙 Cancel	
Г	Instrument ID	Description	Calibration Frequency	Last Cal Date	Manufacturer					
	INST-001	Flow Meter	Annual	04/26/2010	Foxboro					_
	INST-002	Flow Meter	Annual	04/26/2010	Foxboro					
	INST-003	Flow Meter	Annual		Foxboro					
	INST-004	Transmitter	Annual	03/26/2011	Foxboro					
	INST-005	Transmitter	Annual	02/26/2011	Foxboro					
E	of 5 Current	t Ouervi (C	alibration Frequency -	"0.000.0al") Acc	l (Manufacturo)	r – "Foxbore")				
5	of 5 Currer	nt Query: (C	alibration Frequency =	- "Annual") And	l (Manufacture	r = "Foxboro")				<b>V</b>

Figure 21.3

#### 21.1.2.4 Wildcard Characters (Matching Parts of Strings using "LIKE" and "NOT LIKE")

In addition to building queries for an, exact selection criteria, you may also build queries using wildcard characters to match a likeness. For example, you can build a query that generates a list of all instruments whose description is "LIKE" (or contains the words), "pressure" and "valve". Whether the instrument's description is "pressure relief valve" or "pressure control valve", it will appear on a list generated by the execution of this type of advanced query.

When constructing these types of queries, you should substitute wildcard characters (% or \_) for the unknown parts of the string. If you know how many characters are in the missing part of the string, you should use one or more underscore (\_) characters; otherwise, the percent (%) character is appropriate.

To build the pressure valve query mentioned on the previous page, you would perform the following steps:

- 1. Assuming that "pressure valve" is part of at least one instrument's description, first choose *Description* from the *Selection Field Name* drop-down list.
- 2. Select "LIKE" from the Operation drop-down list.
- 3. Type "%pressure%valve%" into the Selection Value field.
- 4. Finally, click the <u>Add To Selection Criteria</u> button to move it into the *Selection Criteria During Query Execution* box. Your screen will look like the one shown in Figure 21.4.
- 5. Click the <u>Execute</u> button to generate a query list showing all instruments with "pressure valve" in their description.

# Find Quality Products Online at:

21-6

www.GlobalTestSupply.com

😁 Advanced Que	ry:(Untitled)						_ax
<ul> <li>Display Fields</li> <li>Available Fields</li> <li>Approval Date</li> <li>Approved By</li> <li>Building</li> <li>Classification</li> <li>Date Entered</li> <li>Department</li> <li>Document ID</li> <li>Entered By</li> <li>Equipment ID</li> <li>Exp Man Hrs</li> <li>Erst Cl Date</li> </ul>		→ <u>A</u> dd → <u>R</u> emove	Always Displayed Instrument ID Description Other Fields To Disp Calibration Frequenc Last Cal Date	lay 29	Move	Sort Fields Available Fields Keep On Schedule Last Modified Location Manufacturer Add Last Cal Date	<b>♦</b> <u>B</u> emove
Selection Criteria	nd 🕒 Or 🛛 🗋 Desc	Selection Field	i Name 🛷	Operation LIKE 🤝	Selection Va	lue	
s	Selection Criteria D	uring Query Exec	ution			Add To Selection Criteria 븆	
<u>R</u> emove <b>±</b>	F	ield Name			Lookup Val	ue	
Group C Ungroup All X Move Up Move Down	( [	escription		LIKE	%pressure%	valve%	]
Execute	🕒 <u>R</u> etrieve	Beset	Save	😫 Sav <u>e</u> As	ti <u>D</u> ele	ete X <u>C</u> ancel	? <u>H</u> elp

Figure 21.4

In this example, you use the percent (%) wildcard since you are not sure how many characters are in the missing parts of the description. Conversely, if you wanted to pull up a query list showing every instrument that **did not** have "pressure" and "valve" in its description, then you would perform the same steps, but instead you would insert "NOT LIKE" into the *Operation* field.

An example where the wildcard would be useful is as follows:

- 1. Imagine that all of your Instrument ID's begin with "INST" followed by a dash and two numeric characters, starting with "01". Using the underscore (\_) wildcard, you could pull up a query list showing all instruments whose ID's are in the "21's". To do this you would perform the following steps:
- 2. Select Instrument ID from the Selection Field Name drop-down list.
- 3. Choose "LIKE" from the Operation drop-down list.
- 4. Enter "INST-2\_" into the *Selection Value* field.
- 5. Finally, click the <u>Add To Selection Criteria</u> button to move it into the *Selection Criteria During Query Execution* box. Your screen will look like the one shown in Figure 21.5 below.
- 6. Click the <u>Execute</u> button to generate a query list showing ten instruments, beginning with "INST-21" and ending with "INST-29".

21-7

🚥 Advanced Quer	y : (Untitled)					-BX
Display Fields     Available Fields     Approval Date     Approved By     Building     Classification     Date Entered     Department     Document ID     Entered By     Equipment ID     Expt Pathenet     Siret Pathenet	↓ Add • Bemove	Always Displayed Instrument ID Description Other Fields To Display Calibration Frequency Last Cal Date		Move	Sort Fields Available Fields Lest Modified Location Manufacturer ▲Add ▲ B Last Cal Date	emove
- Selection Criteria	Selection Field	Name I	Dperation	Selection Val	ue	
Si	election Criteria During Query Exect		-	Add To Selection Criteria 븆		
<u>R</u> emove <b>±</b>	Field Name			Lookup Valu	ie	
Group 🍋	(Instrument ID		LIKE	INST-2_	]	
Ungroup All X Move Up A Move Down V						
Execute	🕞 <u>R</u> etrieve	Save	🖺 Sav <u>e</u> As		te X <u>C</u> ancel	<u>7 H</u> elp

Figure 21.5

#### 21.1.2.5 Using Date Field Key Words

You also have the ability to use date field key words in advanced queries. Date field key words like "End of week", "End of month", "End of year", "Today" and "Tomorrow" are useful for queries involving dates, that may be used on a regular basis. Using this functionality, you could build an advanced query to show all instruments that are due for calibration by the "End of month" date, then save and execute it on a monthly basis. Using the "End of month" date field key word instructs the system to always substitute the last day of the current month into the selection criteria. To do this you would perform the following steps:

- 1. Select Next Cal Date from the Selection Field Name drop-down list.
- 2. Choose "<=" from the Operation drop-down list.
- 3. Choose "End of month" from the Selection Value field's drop-down list.
- 4. Finally, click the <u>Add To Selection Criteria</u> button to move it into the *Selection Criteria During Query Execution* box. Your screen will look like the one shown in Figure 21.6 below.
- 5. Click the <u>Execute</u> button to generate a query list showing all instruments due for calibration by the end of the current month.

픅 Advanced Quer	y: (Untitled)					_ax
Display Fields Available Fields Keep On Schedule Last Cal Date Last Modified Location Manufacturer Model Number Modified By Note ID P+ID Number P+ID Revision Numbe Beronoxible Tachnick	er Add	Always Displayed Instrument ID Description Other Fields To Displ Calibration Frequenc, Next Cal Date	ay y	Move	Sort Fields Available Fields Modified By Note ID P+ID Revision Number ₽+ID Revision Number ▲Add Next Cal Date	▲ <u>B</u> emove
Selection Criteria	d 🕒 Or Next Cal Date	d Name 🛷	Operation <= 💐	Selection Val	ue	
S	election Criteria During Query Exe	cution		A	Add To Selection Criteria	+
<u>R</u> emove <b>±</b>	Field Name			Lookup Valu	ie	
<u>G</u> roup ि <u>Ungroup All ★</u> Move Up Move Down ↓	( Next Cal Date		<=	End of mont	h	)
Execute	➡ <u>R</u> etrieve ➡ <u>R</u> eset	Save	🖺 Sav <u>e</u> As	Delet	e X Cancel	<u>? H</u> elp

Figure 21.6

#### 21.1.3 Action Button Sets

21.1.3.1 Action Buttons Set 1 (shown beside the Selection Criteria During Query Execution box)

#### 21.1.3.1.1 Remove

To remove selection criteria from the *Selection Criteria During Query Execution* box, select any portion of the line of text with your mouse and click the <u>Remove</u> button.

#### 21.1.3.1.2 Group

When you have multiple sets of selection criteria in your query, the <u>Group</u> button may be used to put parentheses around those sets that you want to keep together. For example, imagine you have built a query with the following three sets of selection criteria:

(Status = In Service **OR** Status = Out of Service) **AND** Cal Due Date = Today

Using the <u>Group</u> button to put parentheses around the first two sets of selection criteria forces the system to use them together. This will result in a query list consisting of two types of instruments. Some will have a status of "In Service" **and** a calibration due date equal to today's date; the others will have a status of "Out of Service" **and** a calibration due date date equal to today's date.

If you do not group the statuses together, the system will pull up a list with two other types of instruments. Some will have a status of "Out of Service" **and** a calibration due date equal to today's date, while the others will have a status of "In Service" with no regard to calibration due date.

To group two or more sets of selection criteria together, highlight them with your mouse and click the <u>Group</u> button. You will notice that when you do this, an extra set of parentheses appears around those sets of selection criteria.

#### 21.1.3.1.3 Ungroup All

To ungroup two or more sets of selection criteria, highlight them with your mouse and click the <u>Ungroup All</u> button. You will notice when you do this that the extra parentheses disappear.

#### 21.1.3.1.4 Move Up or Move Down

You may also change the order of two or more sets of selection criteria in your query. To do this highlight the one(s) you want to move and click the appropriate button, <u>Move Up</u> or <u>Move Down</u>.

# 21.1.3.2 Action Buttons Set 2 (shown below the Selection Criteria During Query Execution box)

#### 21.1.3.2.1 Execute

The <u>Execute</u> button applies the criteria you have selected (and that are currently displayed in the *Selection Criteria During Query Execution* box) to all of the records in the system for the company, thus generating the query list.

#### 21.1.3.2.2 Save

The <u>Save</u> button is used to save the query with a unique name so it may be applied and used again at another time. If you modify a previously saved query and want to save it under a different name, you can do this with the <u>Save As</u> button.

#### 21.1.3.2.3 Retrieve

The <u>Retrieve</u> button is used to find previously saved queries so that they may be executed again.

#### 21.1.3.2.4 Reset

The <u>Reset</u> button is used to automatically clear the details currently shown on the ADVANCED QUERY screen so that you may begin building a different query.

#### 21.1.3.2.5 Cancel

The <u>Cancel</u> button returns you to the last list of records you were in and the <u>Help</u> button activates the online HELP SYSTEM.

#### 21.1.3.2.6 Delete

The <u>Delete</u> button is used to delete a previously saved query from the system. To do this, click the <u>Delete</u> button. This will invoke the "User Query" box, which has a drop-down list containing all queries saved in the system for the company. From the drop-down list, select the query to be deleted and click the <u>OK</u> button. A message will then appear to confirm the successful deletion of the advanced query.

#### 21.1.4 Navigating Between Records Included in an Advanced Query List

Once a query list has been generated and is currently displayed on your screen, you may click the OK button to return to the main screen you are working in. Doing this will isolate the listed query records from all other records of that type in the system. This will allow you to use the navigation buttons to toggle between only those records that were included on the query list, so you may view each record individually.

While an advanced query is active, click the Find Record button and attempt to pull up a record that was not included in the current query list, a message will appear on the screen warning you of this. Clicking the Yes button at the message will pull up the specified record, but the current advanced query and its generated list will be deactivated, thus enabling you to once again navigate between all records of that type in the system for the company. Clicking the No button will not pull up the specified record, but the program will confirm its presence in the database. In addition, the current advanced query and its generated list of records will remain active.

21-10

### Find Quality Products Online at:

# www.GlobalTestSupply.com

To return to the full list of instruments in the database, you must perform the following steps:

- 1. Return to the ADVANCED QUERY screen.
- 2. Once in the ADVANCED QUERY screen, click the Reset button.
- 3. Once the query details are cleared from the screen, click the Execute button. The list generated will once again include all records in the system for the company.

Another option is to exit out of the screen and reopen the screen.

#### 21.1.5 Printing Lists and Saving Them to External Files

Any list generated in DPCTrack2 may be printed and/or saved to an external file allowing you to distribute them manually, via paper, e-mail, etc. To do this, pull up any list of records on your screen and right-click anywhere on the list with your mouse. This will invoke a dialog box with four different options, "Save To Excel Spreadsheet", "Save To Text File", "Print" and "Print Setup".

Selecting one of the first two options will enable you to save the list in either format in a selected location. Save the file under a unique name, then access and utilize it as desired.

Selecting "Print Setup" will invoke the PRINT SETUP screen. In the PRINT SETUP screen you can change the size, style and color of the fonts in both the report's header and footer. To do this, click the <u>Edit Font</u> buttons in those sections of the screen. The list, when printed, will appear exactly as it does on your screen. Therefore, you may decide to increase or decrease the widths of the columns shown in the list. Select a different number from the "Column Spacing" section's drop-down list. As you select different numbers, "ColA", "ColB", etc. will change positions to illustrate how the list will look when printed.

You may also select additional data to be included in the report's header and/or footer. Highlight any of the items listed in the "Available" boxes and use the center arrow keys to move them to the desired "Displayed" boxes. Selecting "Other" will invoke the INPUT FORM screen in which you may type additional information to be shown in the printout's header or footer.

To save your print settings, click the <u>Set as Defaults</u> button, then click <u>OK</u>. Once you are back in the list screen, click the <u>Print</u> button and proceed as you normally would when printing a document from your computer. Your print settings will remain as you configured until you modify again.

#### 21.1.6 Using Advanced Queries in Other Parts of the Program

Once you have built and saved advanced queries, they become available for reporting purposes. To do this, select a report to run, enter any required parameter values, click the *Advanced Selection* tab then choose a query to report with. (See Chapter 23 for more information about using advanced queries with reports.)

## www.GlobalTestSupply.com

# Chapter 22 DPCTrack Explorer

### Title

### Page

22.1	DPCTrack Explorer	
22.1.1	Grouping	
22.1.2	Pop-up Menu Options	
22.1.3	Status Indicator Icons	
22.1.4	Resetting the Tree	
22.1.5	Displaying Additional Information	

## 22.1 DPCTrack Explorer

DPCTrack Explorer allows you to quickly view all of the company's records, as well as their relationships to one another. This tool (shown in Figure 22.1) may be accessed by selecting "DPCTrack Explorer" from the **Main Toolbar** on the Home Screen.

DPCTrack 2.0 : Product	tion			lax
File Tools Records Reports	Lists Help			
Quality Lab Inc		View Reminders	DPCTrack Explorer	
Quality Lab Inc	Etem Type     Quelty Lab In     The Trunch     The Trunch	View Reminders	DPCTrack Explorer	
	Cals Due in 60 Days	4/30/20		
🛃 start 🔰 🎦 DPC	Track User Ma 闷 Inbox - Mi	icrosoft 🔯 22. DPCTrack Expl.	DPCTrack 2.0 Sear	ch Desktop 🔎 🖉 🗩 3:41 PM

#### Figure 22.1

By default, the box on the left side of the screen lists each item type individually along with all of the records of that item type that currently exist for the company. Expanding the tree for Equipment and Loops allows you to view all of those items' components as well as related records. In addition, highlighting any individual item on the screen will display all of its details in the box in the display pane.

The floating display window can also be docked/undocked to the left side of the screen by clicking the subtron in the upper right of the display window. (See Figure 22.2 for an example.) The side toolbar can be resized by clicking and dragging the splitter bar that appears on the right edge of the DPCTrack Explorer.

# www.GlobalTestSupply.com

### 22.1.1 Grouping

Another useful tool found in this screen is the ability to group the list of items that appear on the tree by different fields: *Item Type*, *Classification*, *Department*, *Frequency*, *Location*, *Manufacturer*, *Responsible Technician*, *Scheduled*, *Work Due by Department* and *Work Due by Location*. Grouping the tree grants you faster access to the category of your choice. For example, when grouping by Location you can more easily see the items that should be in the current Location or Building you are performing work in. To change the grouping on the tree, select a field name from the top drop-down list. For example, Figure 22.2 below illustrates the Location grouping. Items with no Location assigned appear in the **<Blank>** folder, and all other items are categorized by their Location and Building values.



Figure 22.2

Note

The selected filter will be saved when you close the Explorer and will be selected by default the next time you open it.

#### 22.1.2 Pop-up Menu Options

Right-clicking on an item in the tree gives you a variety of options, depending on the type of item that is selected.

#### **Context-Specific Menu Options:**

- **"Expand Selected"** This option expands the selected item if there are any subitems attached to it.
- "Expand All" This option expands all items with sub-items in all visible folders.
- **"Open Selected Item"** This option opens the corresponding record screen for the selected record and navigates directly to that record. If the corresponding record

22-4

### Find Quality Products Online at:

# www.GlobalTestSupply.com

screen is already open, it will attempt to navigate to the selected record.

Note

You can also open the selected item if it has no sub-items by doubleclicking the item.

• **"Enter Calibration Record"** - This option opens the Calibration Record screen and automatically chooses the current item as the basis for a new calibration history record.

#### 22.1.3 Status Indicator Icons

All items are indicated by an icon that is the same as their Records Toolbar button icon. During some situations, an additional icon may appear to the left of these icons to indicate a particular situation:



This icon indicates an overdue item.

#### 22.1.4 Resetting the Tree

You may reset the tree of items shown on the Explorer by right-clicking the DPCTrack Explorer button and clicking "Refresh Tree". If DPCTrack Explorer is already open, it will refresh and reopen. If DPCTrack Explorer is not open, "Refresh Tree" will also open the Explorer.

#### 22.1.5 Displaying Additional Information

The DPCTrack Explorer can be displayed 3 (three) different ways:

- Item ID
- Item ID : Description
- Description : Item ID

The settings to change the display for DPCTrack Explorer are on the SYSTEM OPTIONS screen, Below are screen shots of the three options. See Figures 22.3 - 22.5



# www.GlobalTestSupply.com

# Chapter 23 Reporting System

### Title

### Page

23.1	Reports	. 23-3
23.1.1	Report Parameters Tab	. 23-3
23.1.2	Advanced Selection Tab	. 23-4
23.2	Other Options Available on the Reports Menu	. 23-5
23.2.1	Set Report Directory	. 23-5
23.2.2	Report Maintenance	. 23-6
23.3	Printing	. 23-6
23.4	Setting Up New Reports	. 23-6
23.4.1	Custom Reports	. 23-6
23.4.2	Report Maintenance	. 23-7
23.4.2.	l General Info Tab	. 23-7
23.4.2.2	2 Report Parameters Tab	. 23-8
23.5	Adding New Reports from Scripts	. 23-9
23.6	Deleting Reports	. 23-10
# 23.1 Reports

DPCTrack2 comes equipped with many standard reports, all of which were designed with *Business Object's Crystal Reports*<sup>TM</sup>. Reports in DPCTrack2 may be accessed from the **Reports** menu in the Home Screen. This menu lists every report group already established in the system. To use an individual report, highlight its group, then select it from the full list of reports in that group. A complete list of all of the program's standard reports, in addition to descriptions of each report can be found in Chapter 24 of this user manual.

When you select a report to run, the View Report screen will open with the selected report's title appearing in the View Report Screen Header. This screen (shown in Figure 23.1 below) is comprised of two tabs, *Report Parameters* and *Advanced Selection*.

View Report: Instrument W	orksheet (Spec Summ	ary)				
ile						
Report Parameters Advanced Selec	tion					
Beginning Due Date:						
1.00						
Ending Due Date:						
1						
	(					
		a Erint	Previe <u>w</u>	Cancel		
start 💦 🖓 Calendar	- Microsof	rack User Man 🗐	23.Reporting Syste	DPCTrack 2.0	Bearch Desktop	🧟 🐼 🛄 2:15 PM

Figure 23.1

### 23.1.1 Report Parameters Tab

The *Report Parameters* tab is used to enter specific parameter values if they are required to run the selected report. Parameter values, which will limit the data shown, may be an item ID, a specific calibration date, a date range, a file name or a test point number. For example, to print an "Instruments Due Report" showing all instruments that are due for calibration in a particular month, you must enter the starting and ending dates of that month.

# www.GlobalTestSupply.com

#### 23.1.2 Advanced Selection Tab

DPCTrack2's reporting system helps you run more specific reports by allowing you to use advanced queries you have saved, if the report supports it. The Advanced Selection tab (shown in Figure 23.2) is used to select a query to apply to the selected report.

To use an advanced query in a report you must perform the following steps:

- 1. Select the desired report from the **Reports** menu.
- 2. Enter valid report parameter values, if required, then go to the Advanced Selection tab. In the Advanced Selection tab select the query you would like to use from the Choose Existing Selection drop-down list. (Every advanced query you have saved for the record type you are reporting on will be available on the drop-down list.) Once you have chosen a query, its details will be shown on the screen.
- 3. If you would like to include the parameter values requested on the *Report Parameters* tab, then check the box titled, Include Report Parameters in Record Selection. If you would prefer to run the report only with the advanced query you have chosen, then leave the box unchecked so that the parameters are ignored. (If there are no parameters this box is not presented.)
- Once you have completed steps 1-3, you may click the Report Preview button or 4. Print.

💳 View Report: Instrument Worksheet (Spec Summary)
File
Report Parameters [Advanced Selection]
Choose Existing Selection   Image: Model with the selection Image: Model with the selection
Selection Criteria
Soft Fields
Cancel
😻 Start 👘 Celender - Microsof 🎦 DPCTrack User Man 🖆 23. Reporting Syste 📼 DPCTrack 2.0 Search Desktop 🖉 🌾 🕞 🦌 📃 2:16 PM

Figure 23.2

### **Find Quality Products Online at:**

# www.GlobalTestSupply.com

From the *Advanced Selection* tab, you may also create a new advanced query or modify an existing query by choosing the <u>New</u> or <u>Modify</u> buttons located to the right of the *Choose Existing Selection* field. Both of these buttons will invoke the ADVANCED QUERY screen. To modify an existing query, you must first select it from the *Choose Existing Selection* field's drop-down list and then click the <u>Modify</u> button. (See Chapter 21 for information about creating or modifying advanced queries.)

It is important to note that due to the characteristics of their design or their intended use, some standard reports cannot be run with the use of an advanced query. Below is a list of all standard reports in DPCTrack2 that **cannot** be used with an advanced query:

Active Users Report	Instrument Test Point Analysis	Test Instrument Test Point Analysis
Calibration Alert Report	Instrument Test Point Trend	Test Instrument Test Point Trend
Company Configuration	Loop Test Point Analysis	Test Instrument Reverse Traceability
Document Report	Loop Test Point Trend	User Lists
Events Due (This Company)	System Options	Active Users
Failed Calibrations Report	Security Log Report	

If a report cannot be used with an advanced query, then the *Advanced Selection* tab will not be present.

# 23.2 Other Options Available on the Reports Menu

The **Reports** menu at the top of the Home Screen provides two additional options that are very important when working with DPCTrack2's reporting system.

### 23.2.1 Set Report Directory

Selecting "Set Report Directory" from the Reports menu invokes the SELECT DIRECTORY screen (shown in Figure 23.3). This screen is used to specify the directory in which your DPCTrack2 report files reside. When you initially install DPCTrack2, the standard report files will automatically be located in the correct directory. Please note that you should not change this default location unless you must have your reports reside in another directory on your computer or on your network.

23-5

	Directory <u>Name:</u> C:\Program Files\Fluke\DPCTrack	2.0\Reports	
	Directories:	Elles: (*.*)	
Shows location of folder where all report files reside.	C:\ Program Files Fluke DPCTrack 2.0 Reports backup	calbancodelableAvpt CalibrationAlertReportSpp1 DocDure.rpt document.rpt equipbancodelableImpt Event/over.rpt Failed CalibrationsReport_rpt Drives:	Shows the name of the report files that reside in the selected director

Figure 23.3

### 23.2.2 Report Maintenance

Selecting "Report Maintenance" from the Reports menu invokes the REPORT MAINTENANCE screen. This screen is used to install new reports into your DPCTrack2 system or modify the setup of existing reports.

#### 23.3 Printing

Once you have selected to print, click the <u>Print</u> button and proceed as you normally would when printing a report from the program. The associated worksheets will be printed in order and grouped together.

# 23.4 Setting Up New Reports

### 23.4.1 Custom Reports

Although DPCTrack2 comes equipped with many standard reports, some users choose to have reports customized to meet their specific needs. If you have chosen to create your own custom reports or have decided to have Prime Technologies customize them for you, once a report has been modified or a new one designed, it must then be installed into your DPCTrack2 program.

**Find Quality Products Online at:** 

#### 23.4.2 Report Maintenance

To install a new or modified an existing report, you must first select "Report Maintenance" from the **Reports** menu that is available when the Home Screen is open. This will invoke the REPORT MAINTENANCE screen shown in Figure 23.4.

= Report Maintenance (Add)	-83
ile Edit	
General Info: Report Parameters	
Report Identification Information Report Name	File Name
Report Description	
Query Type Used For Further Selection Report Group	New New

Figure 23.4

#### 23.4.2.1 General Info Tab

This tab page is used to enter the general information about the new report. In the field labeled *Report Name*, you must enter a unique name for the report so that it may be distinguishable from the other reports already in the system. This field has a limit of 50 characters. The field labeled *File Name* is used to enter the actual file name of the report (as it is listed in your **Report Directory**).

Note

You must move the report into the designated directory <u>before</u> you enter the file name. In addition, the file name <u>must</u> contain the ".rpt" extension. If you are not sure of the file's name, click the <u>Browse</u> button next to the "File Name" field to select from a list of all reports in the Report Directory.

The *Report Description* field is used to enter a description of the new report. This field does not need to contain data, however it is useful for documenting specific information about the new report such as its author or its function. This field has a limit 3,996 characters.

If there is a chance that you will use advanced queries when executing the new report, then you **must** make a selection from the drop-down list for the *Query Type Used For Further Selection* field. The selections available on the drop-down list are the table names of every screen in the program where advanced queries may be used. The query type selected must match the main data table that was used in the report's design. For example, if you are installing a new calibration report, you should choose "CALIBRAT" from the drop-down list for this field so that advanced queries created and saved for the CALIBRATION screen will be available for use when executing this new report.

Finally, the *Report Group* field is used to designate the report group that the new report should be included in. To choose an existing report group for the new report to reside in, select one from the field's drop-down list. If the report group desired is not listed, click the <u>New</u> button next to the field to add it to the system.

#### 23.4.2.2 Report Parameters Tab

This tab page (Figure 23.5) is used to establish the parameters that will be required to run the new report. Parameters are useful in that they allow you to limit the number of reports that are generated by the system at any one time. If parameters were included in the report's design, then it is necessary to enter them here.

For example, the figure below shows two parameters used for the "Instruments Due Report" which comes as a standard report with your system. This report uses date parameters so that it can show all instruments that are due for calibration within a period of time or date range specified by the user. Without date parameters, the report would show every instrument in the system for the current company regardless of when they were due.

Edit		
eneral Info Report Parame	ters	
Report Variables Variable Name	Variable Type Variable Screen Pror	npt

Figure 23.5

If parameters were not used in the new report's design then you do not need to utilize this tab page in any way. Examples of standard reports that do not use parameters are the inventory reports and master reports.

Most reports however, have parameters that were hard-coded in their design, in which case the fields for *Variable Name* must read **exactly** the same as the parameters that were entered into the report's design. If the parameters shown on this screen do not match those in the report's design, the program will not be able to run it and you will see an error message appear on your screen when you attempt to preview or print the report.

The fields for *Variable Type* can only be filled with data selected from the drop-down lists. Variable types must correspond directly to the variable names you are using (e.g. Date, Instrument ID, Status, etc). In addition, the selections shown on these drop-down lists cannot be deleted, added to or modified.

Finally, the fields for *Variable Screen Prompt* are used to enter the wording that you would like to appear on the **Report Parameters** tab page of the REPORTING SYSTEM screen (e.g. Start Date, End Date, Instrument ID, etc.).

### Find Quality Products Online at:

Once you have completed both tab pages for the new report you must save the record. This will make it a selection under its "Report Group" on the **Reports** menu when the Home Screen is open.

## 23.5 Adding New Reports from Scripts

Another method by which a new report may be added to the database is to select "Add New From Script..." from the **File** menu. This method enables you to automatically add the report and its setup to your system so that you do not have to manually perform the steps described earlier in this section.

To use this method you must first copy the new report file into the correct report directory and secondly you must have the correct .ini file in your possession and residing somewhere on your computer or network. In most cases this .ini file will have been supplied to you by Prime Technologies if you elected to utilize Prime Technologies' report customization services. The .ini file contains all the information required for the new report to be setup properly in your database.

Get Report Inst	Get Report Install Script									
Look jn:	DPCTrack :	2.0			(+ E 💣	*				
My Recent Docum Desktop My Documents	in Help Manual Reports									
My Computer	File name:	(					Open			
Му	Files of type:	Ini Files					<u>open</u> Cancel			
Network Places		🚍 Open a	as read-only							

Figure 23.6

Selecting the "Add New From Script..." option on the **File** menu will invoke the GET REPORT INSTALL SCRIPT screen shown in Figure 23.6. This screen allows you to locate the required .ini file on your computer or network. Once you have located the file you can double-click or highlight it and click the <u>Open</u> button to initiate it. Upon doing so, a message will appear on your screen. This message will state the report's title and confirm your decision to add it to your system. If you click the <u>Yes</u> button on the message, the report will automatically be added just as if you had set it up in your database manually.

If the report to be added from the .ini file already exists in the system or if a different report with the same name exists in the database, you will not be able to add the new report to the system. If this occurs, you will either need to delete the existing report or change the name of the new report in the .ini. file.

### Find Quality Products Online at:

# www.GlobalTestSupply.com

# 23.6 Deleting Reports

The deletion of a report from your database is also done through the REPORT MAINTENANCE screen and is accomplished by performing the following steps:

- 1. With the REPORT MAINTENANCE screen open, click the <u>List Records</u> button on the sub-category toolbar.
- 2. While in the list screen, select the report you would like to delete and click <u>OK</u> so that the record is displayed on the screen.
- 3. From the screen's File menu, select "Delete Report".
- 4. When the confirmation message appears, click OK.
- 5. The program will then confirm that the report was deleted successfully and it will no longer appear as a selection on the **Reports** menu.

# Chapter 24 The Logged Data Screen

### Title

### Page

24.1 What is Logged Data?	. 24-3
24.2 Uploading Logged Data	. 24-4
24.2.1 Selecting Port	. 24-4
24.2.2 Upload Logs Button	. 24-5
24.2.3 Show Logged Data Button	. 24-6
24.2.4 Log Record	. 24-6
24.2.4.1 Data Log ID	. 24-6
24.2.4.2 Item Type	. 24-6
24.2.4.3 Item ID	. 24-6
24.2.4.4 Tag ID	. 24-6
24.2.4.5 Logged By	. 24-6
24.2.4.6 Manufacturer	. 24-6
24.2.4.7 Model Number	. 24-6
24.2.4.7 Serial Number	. 24-7
24.2.4.8 Start Time	. 24-7
24.2.4.9 Stop Time	. 24-7
24.2.4.10 # Values	. 24-7
24.2.4.11 # Values Req	. 24-7
24.2.4.12 # Source Value	. 24-7
24.2.4.13 # Time Interval	. 24-7
24.2.4.14 Min Value	. 24-7
24.2.4.15 Max Value	. 24-7
24.2.4.16 Date Entered	. 24-7
24.2.4.17 Entered By	. 24-7
24.3 Viewing Log Records	. 24-8
24.3.1 Listing Log Records	. 24-9
24.3.2 Navigating Log Records	. 24-9
24.4 Viewing Logged Data Report	. 24-10

# www.GlobalTestSupply.com

# 24.1 What is Logged Data?

Among the many features of DPCTrack2 is the Logged Data screen See Figure 24.1 below. Fluke Documenting Process Calibrators allow users to log and capture data over time to help spot, diagnose and prevent intermittent problems or anomalies that can cause facility down time.

Logged	Data							
6		?	000		🗸 Upload Log	I Data	ced Query Name	
Log Record Log ID	I Item Type	Item ID		Tag ID		Logged By		
Manufactu	rer	Model Numb	per	Serial Numbe	r	Start Time	Stop Time	-
#Values	#Values Req	Min Value	Max Value	Source Value	Time Interval	Date Entered	Entered By	-
.og Equipn	nent							
_								
D dia								
.oy neaur								

Figure 24.1

The Logged Data screen allows users to import recorded data from the Fluke calibrator directly to the DPCTrack2 database.

Logged data is used to monitor specified conditions in a selected environment and record periodic measurements. This data is typically not associated with any Tag ID, though it may be, and therefore stands alone as an independent record and given a unique Log ID.

Example: Record the periodic conditions of a chamber by taking five readings per minute over a ten minute span. These readings are saved as a log and uploaded to the DPCTrack2 database and available for review and interpretation.

Note

Uploading data through the Upload/Download screen will not transfer Logged Data from the calibrator to the DPCTrack2 database. Logged Data can only be uploaded through the Logged Data screen.

# 24.2 Uploading Logged Data

To upload Logged Data from the Fluke calibrator to the DPCTrack2 database, first plug the calibrator into the appropriate port on your workstation, turn the calibrator on, and select the *Upload Logged Data* button at the top of the screen.

### 24.2.1 Selecting Port

Select the appropriate port in the *Ports* section, and click *Calibrator Info* below to verify the application is recognizing the calibrator correctly. Figure 24.2 shows the calibrator info. If there are no ports present or incorrect calibrator information is displayed, select the *Refresh* button to refresh the Ports.



Figure 24.2

www.GlobalTestSupply.com

### 24.2.2 Upload Logs Button

Next, click the *Upload Logs* button see Figure 24.3 below, the application will automatically upload all logs present on the calibrator to the DPCTrack2 database.

E Logged Data			Lex
	Show Log Data	Advanced Query Name	
Ports			
C COM6 C COM8			
Calibrator Info			
Upload Logs			
1 of 7 Current Query: Default			

Figure 24.3

#### 24.2.3 Show Logged Data Button

After the Upload is complete, click the *Show Logged Data* button to navigate to the Logged Data record you just uploaded. See Figure 24.4 below.

E Logged Data	_ # X
Advanced Log Data	d Query Name
C Log Record	
Data Log ID Item Type Item ID Tag ID Logged By 3 TT RDS	
Manufacturer Model Number Serial Number Start Time 123 06/01/2011 3:24:51 PM	Stop Time 06/01/2011 3:25:48 PM
# Values # Values Req 20 Min Value 20 Max Value -0.005 mV DC Source Value 0.004 mV DC Time Interval 0 Date Entered 0.002/2011 3:0	Entered By 5:22 PM Administrator
- Log Equipment	
Data Log ID Company Name Item Type Item ID Item Description Manufacturer Model Number Serial Number Ta	ag ID Last Cal Date Next Cal Date Status 🔼
▶ 3 Fluke 744 1544061	
	~
	>
C Log Readings	
Data Log ID Position Value Valid Value Display Unit Base Unit Multiplier Resolution Log Time	<u>~</u>
▶ 3 1 0.002 True mV DC Volts DC 0.001 3	
3 2 0.002 True mV DC Volts DC 0.001 3	
3 3 0.002 True mV DC Volts DC 0.001 3	
	<u> </u>

Figure 24.4

#### 24.2.4 Log Record

Upon navigating to the record you just uploaded, several automatically populated fields are visible. This portion of the page contains information pulled from the logged record and the Tag ID. These fields are not modifiable. They include:

#### 24.2.4.1 Data Log ID

This field displays the log record identifier assigned by the system.

#### 24.2.4.2 Item Type

This field displays the asset type i.e. Instrument or Loop for which the logged data was captured.

#### 24.2.4.3 Item ID

This field displays the asset identifier for the Instrument or Loop.

#### 24.2.4.4 Tag ID

This field displays the asset identifier entered on the calibrator, at the time of upload, for the Instrument or Loop. This may or may not be the same as the Item ID.

#### 24.2.4.5 Logged By

This field displays the ID of the individual responsible for the upload.

#### 24.2.4.6 Manufacturer

This field displays the manufacturer for the Instrument or Loop ID associated with the Tag ID.

#### 24.2.4.7 Model Number

This field displays the model number for the Instrument or Loop ID associated with the Tag ID.

### Find Quality Products Online at:

# www.GlobalTestSupply.com

#### 24.2.4.7 Serial Number

This field displays the serial number for the Instrument or Loop ID associated with the Tag ID.

#### 24.2.4.8 Start Time

A Time/Date Stamp is visible reflecting when the Logging for this Log record began.

#### 24.2.4.9 Stop Time

A Time/Date Stamp is visible reflecting when the Logging for this Log record ended.

#### 24.2.4.10 # Values

This field displays the number of readings actually taken for this Log record.

#### 24.2.4.11 # Values Req

This field displays the number of readings requested be taken for this Log record.

#### 24.2.4.12 # Source Value

This field displays the energy amount provided.

#### 24.2.4.13 # Time Interval

This field displays the segment of time between readings.

#### 24.2.4.14 Min Value

This field displays the minimum value of the uploaded Log record with the corresponding unit.

#### 24.2.4.15 Max Value

This field displays the maximum value of the uploaded Log record with the corresponding unit.

#### 24.2.4.16 Date Entered

A Time/Date Stamp is visible reflecting when the Log was uploaded.

#### 24.2.4.17 Entered By

This field displays the user that entered the Log upload.

# 24.3 Viewing Log Records

After uploading Logged Data from the calibrator, individual logs are saved to the DPCTrack2 database and assigned a unique Log ID. If you attached a Tag ID to the log on the calibrator, the upload will automatically attach applicable item information to the log record. See 24.5 below.

E Logged Da	ıta												-BX
	۵ 🖻	?		90		Upload	Log C	ata	Advand	ed Quer	y Name	•	
Log Record -							-		10020		1.11.1		
Data Log ID II 11 II	tem Type nstrument	Item ID TT		Tag ID TT			F	.ogged I RDS	Ву				
Manufacturer ABB		Model Nun 123tt	nber	Serial N 123TT	lumber		S O	6 tart Tim 6/02/2	ie 011 2:43:08 Pl	M	Stop Time 06/02/201	1 2:44:06 PM	
# Values 30	#Values Req 30	Min Value -0.061 r	Max mV DC	Value 0.058 mV D(	Sourc	e Value 0	Timel	Interval 2	Date Entered 06/02/2011	3:46:35 F	Ente M Adm	rred By inistrator	
- Log Equipment													
Data Log ID	Company Name	Item Type	Item ID Item	Description	Manufa	cturer Mo	odel N	umber	Serial Number	Tag ID	Last Cal Dat	e Next Cal Da	ite Status 杰
▶ 11					Fluke	74	4		1544061				
<													>
- Log Readings													
Data Log ID	Position Value	Valid Value	Display Unit	Base Unit N	Aultiplier	Resolutio	on Lo	g Time					~
▶ 11	1 -0.012	True	mV DC	Volts DC	0.001		3						
11	2 -0.011	True	mV DC	Volts DC	0.001		3						
11	3 0.003	True	mV DC	Volts DC	0.001		3						
11 of 11 Curre	ent Query: Defa	ult											11.

Figure 24.5

24-8

Find Quality Products Online at:

#### 24.3.1 Listing Log Records

To access a list of all uploaded Logged Data records click the *List* button (folder icon) on the *Logged Data* screen's toolbar or select *File*  $\rightarrow$  *List Records*. Figure 24.6 shows the list of uploaded Log records.

	E Logged Data				
				✓ OK ?( <u>] A</u> dvanced X Cancel	
	Data Log ID	Date Entered	Tag ID		~
IC	1	06/02/2011 3:05:22 PM			
	2	06/02/2011 3:05:22 PM			
	3	06/02/2011 3:05:22 PM	TT		
	4	06/02/2011 3:05:22 PM	AA		
	5	06/02/2011 3:14:36 PM			
	6	06/02/2011 3:14:36 PM			
	7	06/02/2011 3:14:36 PM	TT		
	8	06/02/2011 3:14:36 PM	AA		
	9	06/02/2011 3:43:09 PM			
	10	06/02/2011 3:46:35 PM			
	11	06/02/2011 3:46:35 PM	TT		
					~
	11 of 11 Cur	rent Query: Default			li.

Figure 24.6

### 24.3.2 Navigating Log Records

Like other record types in DPCTrack2, users may navigate between Logged Data records by using the green navigation arrows at the top of the screen.

# 24.4 Viewing Logged Data Report

DPCTrack2 comes with several standard reports, including the *Data Log Trend* report. To view this report, simply click the *Report Preview* button. See Figure 24.7 below.

्रि ा ¶g   × र + ४   ा /1 Perview	a n 🔤 🗉	1	Busineputifiete I
	I Fluke Customer Irem Type Irem ID Data LogID 4 Logged By	DATA LOG TREND (Companylame (String)) MEBUBECUTEF Medel Number Serial Number Date Entered 4/38/201	
		Value / Reading #	
	4 	i	

Figure 24.7

The report may be printed from either the Logged Data screen or the Report Preview screen by clicking the Print Report button on the top toolbar.

24-10

# Chapter 25 Backing Up and Restoring Data

### Title

### Page

25.1	Backing Up	25-3
25.2	Restore From Backup	

# 25.1 Backing Up

Since you are running a Microsoft® Access version of DPCTrack2, it is recommended that you back up your database files on a regular basis. Backing up your data regularly is your insurance policy that information will never be lost. Selecting "Backup Database" from the Tools menu at the top of the Home Screen provides you with an easy way to do this. Selecting this option will open the SELECT A BACKUP DATABASE FROM FILE screen shown in Figure 25.1 Backing up DPCTrack2 does not delete any information from your system. It makes a copy of your data, which may then be stored in a secure location.

Select a Backu	p Database fro	m file			? ×
Save jn:	🚞 Backups			* E 🗗 I	
My Recent Docum Desktop	20110509_pr 20110526_d; 20110531_d; 20110531_d;	ocalv5_backup.mdb ictrack2_backup.mdb ictrack2_backup.mdb			
My Documents					
My Computer					_
My Network Places	File <u>n</u> ame:	20110531_dpctrack3	2_backup.mdb	۲	Save
	Save as <u>type</u> :	MS Access Databas	e	-	Cancel

Figure 25.1

When backing up your data, you may select the directory that you would like the copy of your data to be sent to. (This will default to the "Backups" folder) The file name will default to "<today's date\_dpctrack2\_backup.mdb" is the file name for your DPCTrack2 database and should be left as it is shown on the screen.

Note

The file extension ".mdb" cannot be modified. Once you have selected a backup file destination, click the Save button. When the backup has completed, a confirmation message will appear on your screen.

A system reminder may be set so that you never forget to back up your database. This reminder functionality is available in all versions of DPCTrack2. In the SYSTEM OPTIONS screen you may enter a value for "Number of Days Between Backup Warnings" See Chapter 7 for more information. Based upon this number the system will bring up a routine reminder. For example, if you enter "30" into this field, then every 30 days a reminder will appear on your screen as you try to shut down the program. (Note that only users whose groups have the ability to perform backups will see this reminder.)

When the reminder appears on your screen you may proceed with the automatic backup. Once the backup has finished, the date shown in the field for Last date the system database was backed up, which is also located on the SYSTEM OPTIONS screen, will be changed to the current date. When the reminder message appears, you inform the system that the files have already been backed up, then you will be asked if you would like the date reset. You may choose to ignore the reminder, in which case it will continue to come up every time you exit the system or until the backup date is manually reset.

# 25.2 Restore From Backup

To restore your database from a backup, first either change the file name of the existing database or move it to another location. Then, navigate to the "Backup" folder and copy the backup file and paste it into the "Data" folder. Change the file name to "DPCTrack2.mdb".

If you have changed the database location during installation, choose that folder instead of "Data".

# Chapter 26 Troubleshooting

### Title

### Page

26.1	Troubleshooting - Downloading Instruments as Tasks	26-3
26.2	Troubleshooting - Device Communication	26-3
26.3	Troubleshooting - Uploading Results	26-4

# 26.1 Troubleshooting - Downloading Instruments as Tasks

Possible problems:

• Make sure the test point groups you are attempting to download have ALL of the following:

Input Signal Type, Output Signal Type, Input High Limit, Input Low Limit, Output High Limit, Input Low Limit, and Specification and Limit In and Out values for each test point.

- Also, ensure that **both** signal types are associated with the appropriate options for **both** Input and Output. See Signal Type setup for more.
- Ensure that all test point values ("In Val" column) are within the Input Low Range and Input High Range of the device.

Ensure that all Modes selected can be configured in the same combination on your DPC unit. For example, TC Source and TC Measure cannot be used at the same time.

# 26.2 Troubleshooting - Device Communication

Possible communication problems:

- Be sure to check that the COM port you are using is present on your computer.
- If no COM ports are present, click the refresh button
- If refresh does not complete (i.e. progress bar continues to run for an excessive period of time) then press Alt+ F4 to close the application, and if able, disconnect any other comm devices and retry after reconnecting them.
- Be sure the cable is connected to the calibrator properly, and to your PC's serial port as well. Consult your calibrator's documentation for the correct method of connection.
- Programs that use a serial port to connect to other external devices, such as Palm Pilots, should be shut down when using this program with that same serial port. The computer needs to recognize that the COM port is free, and can be used for communication with the calibrator device.

# www.GlobalTestSupply.com

# 26.3 Troubleshooting - Uploading Results

Possible uploading problems:

- If the Tag used for a result stored on the calibrator is not found in the Instrument or Loop screens, the user will be prompted to save the result to a file. To avoid this, create an Instrument or Loop record with an ID matching the Tag entered on the Calibrator before uploading.
- Remember that after Authorizing a calibration during Upload, the user may review and update the Calibration record in the Calibration Screen if there are additional values to view, edit, or remove from the record.

26-4

# Appendix A Report Descriptions Listed by Groups

## Alert Group

#### **Calibration Alert Report**

This report shows all Instruments, Test Instruments and Loops, calibrated within a specified period of time that had at least one "As-Found" value that was outside of its high or low spec limit.

#### Failed Calibrations Report

This report shows all Instruments, Test Instruments and Loops that failed calibration within a specified period of time.

### Calibration Group

#### **Calibration Bar Code Label**

Bar codes are visual representations of alphanumeric characters designed to be read by a scanner. This Bar Code Label contains the item's Bar Code ID, Item's ID, the name of the Technician who performed the Calibration, the Last Calibration Date and its Next Due Date. Bar code labeling provides numerous advantages to indexing, itemizing and tracking. Dimensions for this label are 2" X 2".

#### **Calibration Label**

These labels help comply with the requirements for generic calibration industry standards requirements. This label contains a Title, the Item's ID, the name of the Technician who performed the Calibration, the Calibration Date and its Next Due Date. Dimensions for this label are  $1\frac{3}{4}$  "W X 1" H.

#### Instrument Calibration Report (Spec Summary)

This is a completed calibration report for Instruments showing some master information, results of the calibration (calibration specs plus "As-Found" and "As-Left" values and deviation percentage), and Test Instrument(s) used. This is a good report to choose for those Instruments whose calibrations are fairly simple, those with test points that remain consistent with regard to stated accuracy, accuracy percentage and resolution since this information is summarized at the top of the report.

#### Instrument Calibration Report (Specs/Test Point)

This is also a completed calibration report for Instruments, although this report shows more detail than the one previously described. This is a good report to choose for those Instruments whose calibrations are more complex. It includes the same information as the

A-1

### Find Quality Products Online at:

other calibration report, but instead of summarizing the stated accuracy, accuracy percentage and resolution at the top of the report, it displays this information for each test point individually.

#### Instrument Test Point Analysis

This report shows an analysis of a single Instrument calibration. A line graph is included so that you may easily compare the expected, As-Found, and As-Left values for the calibration.

#### Instrument Test Point Trend

This report allows you to trend an Instrument's maximum deviation over a specified period of time. A line graph is included so that you may easily view this information.

#### Loop Calibration Report (Spec Summary)

This is a completed calibration report for Loops showing some master information, results of the calibration (calibration specs plus "As-Found" and "As-Left" values and deviation percentage), its comprising Instrument(s), and the Test Instrument(s) used. This is a good report to choose for those Loops whose calibrations are fairly simple- those with test points that remain consistent with regard to stated accuracy, accuracy percentage and resolution since this information is summarized at the top of the report.

#### Loop Calibration Report (Specs/Test Point)

This is also a completed calibration report for Loops, although this report shows more detail than the one previously described. This is a good report to choose for those Loops whose calibrations are more complex. It includes the same information as the other Loop calibration report, but instead of summarizing the stated accuracy, accuracy percentage and resolution at the top of the report, it displays this information for each test point individually

#### Loop Test Point Analysis

This report shows an analysis of a single Loop calibration. A line graph is included so that you may easily compare the expected, As-Found and As-Left values for the calibration.

#### Loop Test Point Trend

This report allows you to trend a Loop's maximum deviation over a specified period of time. A line graph is included so that you may easily view this information.

#### Test Instrument Calibration (Spec Summary)

This is a completed calibration report for Test Instruments showing some master information, results of the calibration (calibration specs plus "As-Found" and "As-Left" values and deviation percentage), and the Test Instrument(s) used. This is a good report to choose for those Test Instruments whose calibrations are fairly simple- those with test points that remain consistent with regard to stated accuracy, accuracy percentage and resolution since this information is summarized at the top of the report.

#### Test Instrument Calibration (Specs/Test Point)

This is also a completed calibration report for Test Instruments, although this report shows more detail than the one previously described. This is a good report to choose for those Test Instruments whose calibrations are more complex. It includes the same information as the other Test Instrument calibration report, but instead of summarizing the stated accuracy, accuracy percentage and resolution at the top of the report, it displays this information for each test point individually.

# www.GlobalTestSupply.com

#### Test Instrument Test Point Analysis

This report shows an analysis of a single Test Instrument calibration. A line graph is included so that you may easily compare the expected, As-Found and As-Left values for the calibration.

#### **Test Instrument Test Point Trend**

This report allows you to trend a Test Instrument's maximum deviation over a specified period of time. A line graph is included so that you may easily view this information.

## **Company Group**

#### **Events Due (This Company)**

This report shows all Instrument, Loops and Test Instruments due for calibration and all SOP's that have expired within a specified period of time for the company.

## Document Group

#### **Document Report**

This report can be printed for each Document record entered into the system for the company. It shows all of the information entered for a Document including the procedure tab. On the Document Report Parameters Tab, the specific Document Number and Revision Number must be specified.

#### **Documents Due Report**

This report lists all Documents that will expire within a specified date range.

### Equipment Group

#### Equipment Bar Code Label

This Bar Code Label contains the actual Bar Code, Item ID, Description and the Last Calibration Date and its Next Due Date. They may also be scanned back into the program making the entry of data, creation of records and/or the taking of a physical inventory faster and easier. Dimensions for this label are 2" X 2".

### Instrument Group

#### Instrument Bar Code Label

This Bar Code Label contains the actual Bar Code, Item ID, Description and the Last Calibration Date and its Next Due Date. They may also be scanned back into the program making the entry of data, creation of records and/or the taking of a physical inventory faster and easier. Dimensions for this label are 2" X 2".

#### Instrument Master (Spec Summary)

This is a report that shows all of the master information for an Instrument, with the stated accuracy, accuracy percentage and resolution information for the calibration test points summarized at the top of the report.

#### Instrument Master (Specs/Test Point)

This is also a report that shows all of the master information for an Instrument, however it is more detailed in that the stated accuracy, accuracy percentage and resolution information are displayed for each test point individually.

Find Quality Products Online at:

#### Instrument Worksheet (Spec Summary)

This report looks similar to the Instrument Calibration Report (Spec Summary) except for the fact that it has blank lines on which to write the "As-Found" and "As-Left" values for the Instrument's calibration. It also has an area in which to document the Test Instrument(s) used, comments and whether the Instrument passed or failed. You can print out worksheets for all Instruments due for calibration within a specified period of time and give them to your technician to complete on the job.

#### Instrument Worksheet (Spec/Test Point)

This report is similar to the other Instrument worksheet except for the fact that it lists the stated accuracy, accuracy percentage and resolution for each individual test point, as opposed to summarizing this information at the top of the report.

#### Instrument Due Report

This report lists all the Instruments that will be due for calibration within a specified date range.

## **Inventory Group**

#### Instrument Inventory

This report shows a list of all Instruments entered for the company. The following fields from the Master Instrument Record are displayed on the report: Instrument ID, Description, Manufacturer, Model Number, Serial Number, Last Cal Date, Next Cal Due, and Status.

#### Loop Inventory

This report shows a list of all Loops entered for the Company. The following fields from the Master Loop Record are displayed on the report: Loop ID, Description, Manufacturer, Last Cal Date, Next Cal Due, and Status.

#### Test Instrument Inventory

This report lists all Test Instruments entered into the system for the company. The following fields from the Master Loop Record are displayed on the report: Test Instrument ID, Description, Manufacturer, Model Number, Serial Number, Last Cal Date, Next Cal Due, and Status.

## Logged Data Group

#### Data Log Report

This report shows an analysis of a single Logged Record. A line graph is included so that you may easily view the source values / logged data readings taken over a number of readings / time.

## Loop Group

#### Loop Bar Code Label

This Bar Code Label contains the actual Bar Code, Item ID, Description and the Last Calibration Date and its Next Due Date. They may also be scanned back into the program making the entry of data, creation of records and/or the taking of a physical inventory faster and easier. Dimensions for this label are 2" X 2".

#### Loop Master (Spec Summary)

This is a report that shows all of the master information for a Loop, with the stated accuracy, accuracy percentage and resolution information for the calibration test points summarized at the top of the report.

#### Find Quality Products Online at:

# www.GlobalTestSupply.com

#### Loop Master (Spec/Test Point)

This is also a report that shows all of the master information for a Loop, however it is more detailed in that the stated accuracy, accuracy percentage and resolution information are displayed for each test point individually.

#### Loop Worksheet (Spec Summary)

This report looks similar to the Loop Calibration Report (Spec Summary) except for the fact that it has blank lines on which to write the "As-Found" and "As-Left" values for the Loop's calibration. It also has an area in which to document the Test Instrument(s) used, comments and whether the Loop passed or failed. You can print out worksheets for all Loops due for calibration within a specified period of time and give them to your technician to complete on the job.

#### Loop Worksheet (Specs/Test Point)

This report is similar to the other Loop worksheet except for the fact that it lists the stated accuracy, accuracy percentage and resolution for each individual test point, as opposed to summarizing this information at the top of the report.

#### Loops Due Report

This report lists all of the Loops that will be due for calibration within a specified date range.

### Test Instrument Group

#### Test Instrument Bar Code Label

This Bar Code Label contains the actual Bar Code, Item ID, Description and the Last Calibration Date and its Next Due Date. They may also be scanned back into the program making the entry of data, creation of records and/or the taking of a physical inventory faster and easier. Dimensions for this label are 2" X 2".

#### Test Instrument Master (Spec Summary)

This is a report that shows all of the master information for a Test Instrument, with the stated accuracy, accuracy percentage and resolution information for the calibration test points summarized at the top of the report.

#### Test Instrument Master (Specs/Test Point)

This is also a report that shows all of the master information for a Test Instrument, however it is more detailed in that the stated accuracy, accuracy percentage and resolution information are displayed for each test point individually.

#### Test Instrument Reverse Traceability

This report shows all Instruments, Test Instruments and Loops that were calibrated by a particular Test Instrument during a specified period of time.

#### Test Instrument Worksheet (Spec Summary)

This report looks similar to the Test Instrument Report (spec summary) except for the fact that it has blank lines on which to write the "As-Found" and "As-Left" values for the Test Instrument's calibration. It also has an area in which to document the Test Instrument(s) used, comments and whether the Test Instrument passed or failed. You can print out worksheets for all Test Instruments due for calibration within specified period of time and give them to your technician to complete on the job.

#### Test Instrument Worksheet (Specs/Test Point)

This report is similar to the other Test Instrument worksheet except for the fact that it lists the stated accuracy, accuracy percentage and resolution for each individual test point, as opposed to summarizing this information at the top of the report. It has an area to record

A-5

### **Find Quality Products Online at:**

the Test Instrument(s) used, comments, and whether the Test Instrument passed or failed. It has blanks lines to record the stated accuracy, accuracy percentage and resolution for each individual test point.

#### Test Instrument Due Report

This report lists all Test Instruments that will be due for calibration within a specified date range.

## **User Group**

### Active Users Report

This report shows the User IDs and Names of all users who are currently logged onto DPCTrack2.

#### Security Log Report

This report shows all user logon activity (with exact time stamp and Log Details: successful logon, invalid user ID and/or password attempts, forced log offs, time expired, etc..) recorded within a specified date range.

# Appendix B Frequently Asked Questions

## Frequently Asked Questions List

- Q. I get an error message, "Error 114", when attempting to preview or print a report.
- A. The report directory is not set correctly. To set it correctly, go to the Reports menu then select "Set Report Directory". Please Note: When you initially install DPCTrack2 the standard report files will automatically be located in the subdirectory labeled "Reports" (Access program). You should not change this default location unless you have your reports reside in another directory on your computer or on your network.
- Q. I get an error message, "Error 519" when attempting to preview or print a report.
- A. One of the report parameters entered on the report's record is incorrect. Open the report's record in the REPORT MAINTENANCE screen and make sure that all the report parameter *Variable Names* and *Variable Types* match those in the design of the report.
- Q. I get an error message "Error 534" when attempting to preview or print a report.
- A. This happens because the report is already open on the user's screen. The report cannot be opened more than once simultaneously. If working with reports locally, on their own workstation, then reboot the machine. If working with reports on a server, restart DPCTrack2 and try again.
- Q. Why does my item(s) not show up on scheduling reports like the "Events Due Report" and "Calibration Worksheets"?
- A. In order for records with statuses (Loops, Instruments and Test Instruments) to appear on scheduling reports like the "Events Due Report" and "Calibration Worksheets" you must first assign them a status that is considered active. To do this, go to the Lists menu at the top of the Home Screen and choose "Statuses". For each active status (i.e., "In Service"), mark the box labeled *Indicates an Active Status* and save the record.

# www.GlobalTestSupply.com

- Q. How come my Document ID's are not showing up on the "Document ID" dropdown lists?
- A. The *SOP Type* assigned to those documents do not have the *Make Available as an SOP* box marked.
- Q. One of my Calibration Frequencies is misspelled, how do I change that?
- A. The first step is to go to the Lists menu and select "Calibration Frequency". Then in the CALIBRATION FREQUENCY screen, add the new calibration frequency with the correct spelling, and save the record. The next step is to go to all the records that are using the frequency with the wrong spelling and change them to the frequency with the correct spelling. Once the frequency with the incorrect spelling is no longer being used, you may go back to the CALIBRATION FREQUENCY screen, open the record for the misspelled frequency, then select FILE "Delete Record". If the misspelled frequency is still in use, you will get a warning to inform you of this.

The best way to filter out records that are using a particular list item is to create and run an advanced query. To create and run an advance query, follow these steps:

- 1. Imagine that you have a calibration frequency spelled "Weekley" and you wish to change it to "Weekly". First, you would open the MASTER INSTRUMENT RECORD screen (or any other screen where there are records currently using term "Weekley".
- 2. Click the Open Advanced Query button on the screen's toolbar to open the ADVANCED QUERY screen.
- 3. In the Display Fields section, move select "Calibration Frequency" to the Other Fields To Display box.
- 4. In the Selection Criteria section select, "Calibration Frequency" from the Selection Field Name drop-down list.
- 5. Select "=" from the Operation drop-down list.
- 6. Select "Weekley" from the Selection Value drop-down list.
- 7. Click the Add To Selection Criteria button.
- 8. Click the Execute button. This will generate a list of all records that are currently using the Calibration Frequency called "Weekley".
- 9. From the list, select each item one by one to change the frequency to the correct one.
- Q. I get a message saying "Maximum users exceeded. Try again later"
- A. This message indicates that the maximum number of "Licensed Users' are currently logged onto the program. You must either wait for another user to log off, freeing up a seat, or if you are in the ADMIN group, you could force log off a User.

Note

Manually forcing off another user will cause them to lose any unsaved work.

- Q. Do I need to fill in all fields when creating a new record?
- A. You do not need to fill all empty fields when creating a new record. In most cases only an ID is necessary to save a new record. For calibration records, the *Item Type, ID* and *Calibrated* fields are required. For document records, a

*Document ID* and *Revision Number* are necessary for saving a new record. You will be warned by the system if you have not completed all the fields required to save a particular record.

- Q. I attempted to set up a chronological numbering system for my instruments, but the order is still incorrect. What did I do wrong?
- A. If you have decided to set up a chronological numbering system for the items in your database, do not begin with the number "1", instead begin with "01" or "001" depending on the number of records that you plan to enter in the system for that record type. This will insure that your entries will remain in the order that you intend.
- Q. What is the <u>Copy Record</u> button for?
- A. If you are entering many Instruments, Loops or Test Instruments of the same make, model number, description, etc., utilize the <u>Copy Record</u> button (available on the toolbar of each of those screens) so that you only have to enter a new ID, serial number (if applicable) and calibration dates. Please note though that copying an Instrument record does not copy its association with Loop records, also copying a Loop will not copy the "Instruments That Make Up This Loop" into the newly created Loop.
- Q. *Are there any typing short cut features in DPCTrack2?*
- A. Yes. All date fields throughout the system have "Hot Keys". Type the following letters or symbols to insert these dates if on the System Option screen you have chosen one of the following date formats, "mm/dd/yyyy" or "dd/mm/yyyy"
  - " $\mathbf{T}$ " = Today's date.
  - "**M**" = first day of the current month.

(Type "**M**" again and the date will change to the first date of the previous month)

• "**H**" = Last day of the current month or the last date of the month currently shown in the field.

(Type "**H**" again and the date will change to the last day of the next month)

• "Y" = First day of the current year.

(Type "**Y**" again and the date will change to the first day of the previous year)

• "**R**" = Last day of the current year or the last date of the year currently shown in the field.

(Type "**R**" again and the date will change to the last day of the next year)

- "+" = Forward the date currently displayed.
- "-" = Reverse the date currently displayed.

For date fields using the 'dd-mmm-yyyy' format, the "+" and "-" shortcuts are available, in addition to the following:

- "Shift" + "Home" = Today's date.
- "**Page Up**" = First day of the current year.

(Type "**Page Up**" again and the date will change to the first day of the previous year)

• "**Page Down**" = Last day of the current year.

#### **Find Quality Products Online at:**

(Type "**Page Down**" again and the date will change to the last day of the next year)

• "Home" = First day of the current month.

(Type "**Home**" again and the date will change to the first date of the previous month)

• "End" = Last day of the current month.

(Type "**End**" again and the date will change to the last day of the next month)

- Q. *Must I enter both "Found As" and "Left As" Values if the values are the same when entering a calibration record?*
- A. Not always. If the calibration record being entered does not use *Separate As Found/As Left Inputs*, then once you enter a "Fnd As" value you may tab to the corresponding "Lft As" cell and hit the "=" key. This will copy the exact "Fnd As" value into the "Lft As" cell. Note: The field must be blank for this to work.
- Q. *After making changes to a record and saving it, I realized that I did not need to make the changes. Why didn't my <u>Cancel Changes</u> button work?*
- A. The <u>Cancel Changes</u> button will work anytime before the changes are saved. Once a record has been saved though, its previous data cannot be restored.
- Q. What is the "Quick Type" feature?
- A. All fields in the system with an associated drop-down list have a "Quick Type" feature. This means that you may begin typing the desired entry (as long as it is already on the drop-down list) and DPCTrack2 will automatically insert it into the field.
- Q. Can I print lists generated from Advanced Queries?
- A. Right-clicking on any grid list that you have generated, for example a list resulting from an Advanced Query, will allow you to export it to a variety of different formats like a Microsoft Excel® or Word® document. In addition, you will also see an option to print the list directly from DPCTrack2.
- Q. Why am I not able to make changes to the test point grid in the CALIBRATION screen?
- A. If you would like to make changes to the test point grid in the CALIBRATION screen, you can do this by clicking the <u>Modify Specs</u> button. This will open up the grid and allow you to modify any of the cells present. All numeric cells can be modified by typing over the existing value; all signal type, stated accuracy or resolution cells can only be modified by activating the cell's drop-down list. In addition, clicking the <u>Recalculate</u> button will recalculate the high/low spec and /or control limits if those are affected by your changes. To make the grid inaccessible again, click the <u>Protect Specs</u> button and continue to enter the rest of your data. However, performing these actions will not update the item's master record. Permanent changes must actually be made in the item's master screen. Please keep in mind though that several settings such as *Prevent Accuracy Modifications During Calibration* in the COMPANY RECORD screen, selection of a "Linear" or "Square Root" *Correlation to Output* for an item may affect your ability to modify various information in the calibration specifications grid.

# www.GlobalTestSupply.com

- Q. If I modify an existing master record, will my changes affect calibration records previously entered for that item?
- A. Making modifications to an existing master Instrument, Loop or Test Instrument record will not affect the calibration records previously entered for that item. Since master records are in essence, templates to be used in the addition of calibration records, any modifications made to one of these will only be seen when the user enters a new calibration record for that item.
- Q. Why am I not able to use an advanced query to run some of the standard reports in the system?
- A. Due to the characteristics of their design or their intended use, some standard reports cannot be run with the use of an advanced query. Below is a list of all standard reports in DPCTrack2 that cannot be used with an advanced query:

Active Users Report	Loop Test Point Analysis
Document Report	Loop Test Point Trend
Events Due (This Company)	Security Log Report
Instrument Bar Code Label	Test Instrument Test Point Analysis
Instrument Test Point Analysis	Test Instrument Test Point Trend
Instrument Test Point Trend	Test Instrument Reverse Traceability

- Q. What options do I have when exporting data from reports?
- A. All reports generated may be exported in a variety of formats to a number of different destinations including e-mail. To do this, preview a report on your screen, then click the <u>Export</u> button on the top of the *Report Preview* screen to make your selections.
- Q. *How do I set up calibration frequencies correctly?*
- A. The "Calibration Frequency" list option allows you to define and set up specific frequencies that can be applied to all items that get calibrated. Calibration frequencies help the program calculate due dates for item calibrations. Common ones would be "Yearly", "Semi-annually", "Quarterly", etc. Selecting the *Keep On End of Month* box for a frequency will instruct the system, when calculating a due date based upon the frequency, to always use the last day of the month that the item will be due. In addition, the *Allow system to Roll Dates Forward if Actual Event Date is within [#] Days of Scheduled Event Date* field allows you to declare exactly how soon before the due date, or a calibration can be successfully completed and still have the next due date automatically roll forward. Any numeric value may be entered into this field, and the number used can be different for every calibration frequency entered into the database.