

FLUKE®

62 MAX/62 MAX +

Infrared Thermometer

Users Manual

PN 4060712
April 2012 Rev. 1, 11/12
© 2012 Fluke Corporation. All rights reserved. Printed in China.
Specifications are subject to change without notice.
All product names are trademarks of their respective companies.

LIMITED WARRANTY AND LIMITATION OF LIABILITY

This Fluke product will be free from defects in material and workmanship for three years from the date of purchase. This warranty does not cover fuses, disposable batteries, or damage from accident, neglect, misuse, alteration, contamination, or abnormal conditions of operation or handling. Resellers are not authorized to extend any other warranty on Fluke's behalf. To obtain service during the warranty period, contact your nearest Fluke authorized service center to obtain return authorization information, then send the product to that Service Center with a description of the problem.

THIS WARRANTY IS YOUR ONLY REMEDY. NO OTHER WARRANTIES, SUCH AS FITNESS FOR A PARTICULAR PURPOSE, ARE EXPRESSED OR IMPLIED. FLUKE IS NOT LIABLE FOR ANY SPECIAL, INDIRECT, INCIDENTAL OR CONSEQUENTIAL DAMAGES OR LOSSES, ARISING FROM ANY CAUSE OR THEORY. Since some states or countries do not allow the exclusion or limitation of an implied warranty or of incidental or consequential damages, this limitation of liability may not apply to you.

Fluke Corporation
P.O. Box 9090
Everett, WA 98206-9090
U.S.A.

Fluke Europe B.V.
P.O. Box 1186
5602 BD Eindhoven
The Netherlands

11/99

Table of Contents

Title	Page
Introduction.....	1
How to Contact Fluke	1
Safety Information	2
Maintenance.....	6
How to Change the Battery	6
How to Clean the Product	6
Specifications	7
Standards and Agency Approval.....	9
The Product.....	10

Introduction

The Fluke 62 MAX and 62 MAX + Infrared Thermometers (the Product) can determine the surface temperature by measuring the amount of infrared energy radiated by the target's surface. Note that the Japanese models indicate Celsius only.

Warning

Read all safety information before you use the Product.

Safety Information

A **Warning** identifies conditions and procedures that are dangerous to the user. A **Caution** identifies conditions and procedures that can cause damage to the Product or the equipment under test.

Table 1 tells you about symbols used on the Product and in this manual.

Warning



To prevent eye damage and personal injury:

- **Read all safety Information before you use the Product.**
- **Do not use the Product if it operates incorrectly.**
- **Use the Product only as specified, or the protection supplied by the Product can be compromised.**
- **Before you use the Product, inspect the case. Do not use the Product if it appears damaged. Look for cracks or missing plastic.**

Infrared Thermometer
Safety Information





- See emissivity information for actual temperatures. Reflective objects result in lower than actual temperature measurements. These objects pose a burn hazard.
- Do not look directly into the laser with optical tools (for example, binoculars, telescopes, microscopes). Optical tools can focus the laser and be dangerous to the eye.
- Do not look into the laser. Do not point laser directly at persons or animals or indirectly off reflective surfaces.
- Replace the batteries when the low battery indicator shows to prevent incorrect measurements.
- Do not use the Product around explosive gas, vapor, or in damp or wet environments.
- Use the Product only as specified or hazardous laser radiation exposure can occur.

Table 1. Symbols

Symbol	Meaning	Symbol	Meaning
	Risk of danger. Important information. See Manual.		This product complies with the WEEE Directive (2002/96/EC) marking requirements. The affixed label indicates that you must not discard this electrical/electronic product in domestic household waste. Product Category: With reference to the equipment types in the WEEE Directive Annex I, this product is classed as category 9 "Monitoring and Control Instrumentation" product. Do not dispose of this product as unsorted municipal waste. Go to Fluke's website for recycling information.

Infrared Thermometer
Safety Information

Table 1. Symbols (cont.)

Symbol	Meaning	Symbol	Meaning
	Warning. Laser.	CE	Conforms to European Union directives.
	Battery		Conforms to relevant Australian standards.
 沪制01120009号	Conforms to China Metrology Certification		

Maintenance

⚠ Caution

To avoid damage to the Product, do not leave the thermometer on or near objects of high temperature.

How to Change the Battery

To install or change the AA IEC LR06 battery, open the battery compartment and replace the battery as shown in Figure 16.

How to Clean the Product

Use soap and water on a damp sponge or soft cloth to clean the Product case. Carefully wipe the surface with a moist cotton swab. The swab may be moistened with water. See Figure 17.

**Infrared Thermometer
Specifications**

Specifications

	62 MAX	62 MAX +
Temperature Range	-30 °C to 500 °C (-22 °F to 932 °F)	-30 °C to 650 °C (-22 °F to 1202 °F)
Accuracy (Calibration geometry with ambient temperature 23 °C ±2 °C)	≥0 °C: ±1.5 °C or ±1.5 % of reading, whichever is greater (≥32 °F: ±3 °F or ±1.5 % of reading, whichever is greater) ≥ -10 °C to <0 °C: ±2 °C (≥14 °F to <32 °F: ±4 °F) < -10 °C: ±3 °C (<14 °F: ±6 °F)	≥0 °C: ±1 °C or ±1 % of reading, whichever is greater (≥32 °F: ±2 °F or ±1 % of reading, whichever is greater) ≥ -10 °C to <0 °C: ±2 °C (≥14 °F to <32 °F: ±4 °F) < -10 °C: ±3 °C (<14 °F: ±6 °F)
Response Time (95 %)	<500 ms (95 % of reading)	<300 ms (95 % of reading)
Spectral Response	8 to 14 microns	
Emissivity	0.10 to 1.00	
Temperature Coefficient	±0.1 °C/°C or ±0.1 %/°C of reading (whichever is greater)	

62 MAX/62 MAX +
Users Manual

Optical Resolution	10:1 (calculated at 90 % energy)	12:1 (calculated at 90 % energy)
Display Resolution	0.1 °C (0.2 °F)	
Repeatability (% of reading)	±0.8 % of reading or ±1.0 °C (2 °F), whichever is greater	±0.5 % of reading or ±0.5 °C (1 °F), whichever is greater
Power	1 AA IEC LR06 Battery	
Battery Life	10 hours with laser and backlight on	8 hours with laser and backlight on
Weight	255 g (8.99 oz)	
Size	(175 x 85 x 75) mm (6.88 x 3.34 x 2.95) inches	
Operating Temperature	0 °C to 50 °C (32 °F to 122 °F)	
Storage Temperature	-20 °C to 60 °C (-4 °F to 140 °F), (without battery)	
Operating Humidity	10 % to 90 % RH non-condensing @ 30 °C (86 °F)	
Operating Altitude	2000 meters above mean sea level	
Storage Altitude	12,000 meters above mean sea level	

***Infrared Thermometer
Standards and Agency Approval***


Ingress Protection Rating	IP 54 per IEC 60529
Drop Test	3 meters
Vibration and Shock	IEC 60068-2-6 2.5 g, 10 to 200 Hz, IEC 60068-2-27, 50 g, 11 ms
EMC	EN 61326-1:2006 EN 61326-2:2006

Standards and Agency Approval

Compliance EN/IEC 61010-1
Laser Safety EN 60825-1 Class 2
Implement Standard Q/SXAV37

62 MAX/62 MAX +
Users Manual


The Product

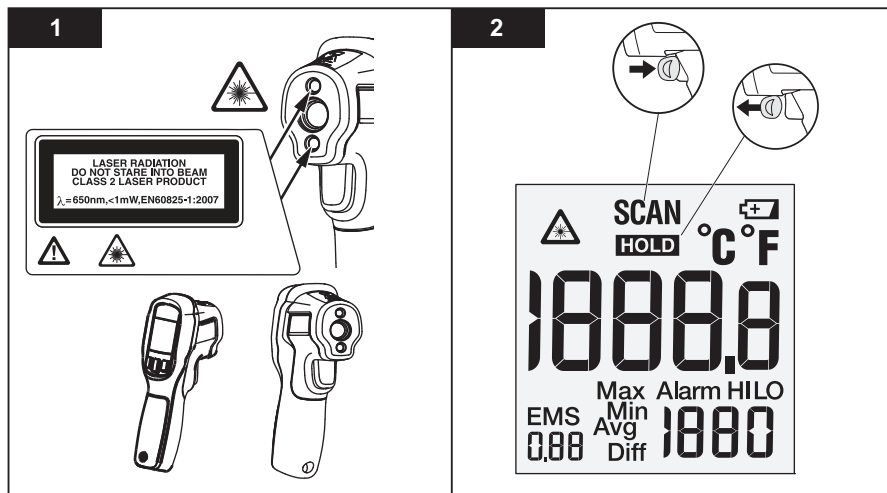


Infrared Thermometer
The Product

<p>3</p>	<p>4</p> <p>°F/°C</p>				
<p>5</p>	<p>5</p> <p>EMS</p> <p>6</p> <p>Max/Min/Avg/Diff</p> <table border="1"> <tr> <td> <p>SCAN °F</p> <p>68.0</p> <p>EMS Max 90</p> <p>0.35</p> <p>SEL</p> </td> <td> <p>SCAN °F</p> <p>68.0</p> <p>EMS Min 68</p> <p>0.35</p> <p>SEL</p> </td> <td> <p>SCAN °F</p> <p>68.0</p> <p>EMS Avg 76</p> <p>0.35</p> <p>SEL</p> </td> <td> <p>SCAN °F</p> <p>68.0</p> <p>EMS Diff 22</p> <p>0.35</p> <p>SEL</p> </td> </tr> </table>	<p>SCAN °F</p> <p>68.0</p> <p>EMS Max 90</p> <p>0.35</p> <p>SEL</p>	<p>SCAN °F</p> <p>68.0</p> <p>EMS Min 68</p> <p>0.35</p> <p>SEL</p>	<p>SCAN °F</p> <p>68.0</p> <p>EMS Avg 76</p> <p>0.35</p> <p>SEL</p>	<p>SCAN °F</p> <p>68.0</p> <p>EMS Diff 22</p> <p>0.35</p> <p>SEL</p>
<p>SCAN °F</p> <p>68.0</p> <p>EMS Max 90</p> <p>0.35</p> <p>SEL</p>	<p>SCAN °F</p> <p>68.0</p> <p>EMS Min 68</p> <p>0.35</p> <p>SEL</p>	<p>SCAN °F</p> <p>68.0</p> <p>EMS Avg 76</p> <p>0.35</p> <p>SEL</p>	<p>SCAN °F</p> <p>68.0</p> <p>EMS Diff 22</p> <p>0.35</p> <p>SEL</p>		


gtt14.eps

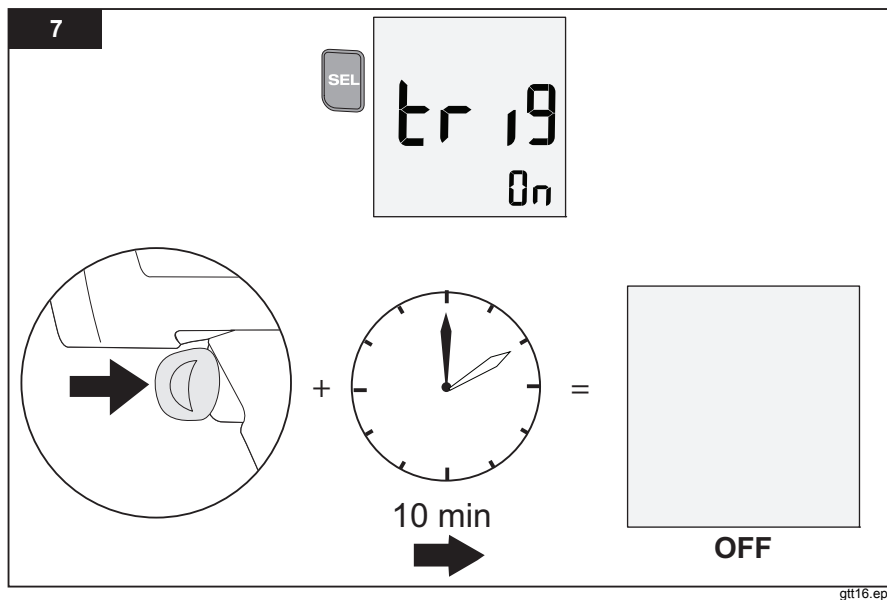

Infrared Thermometer
The Product

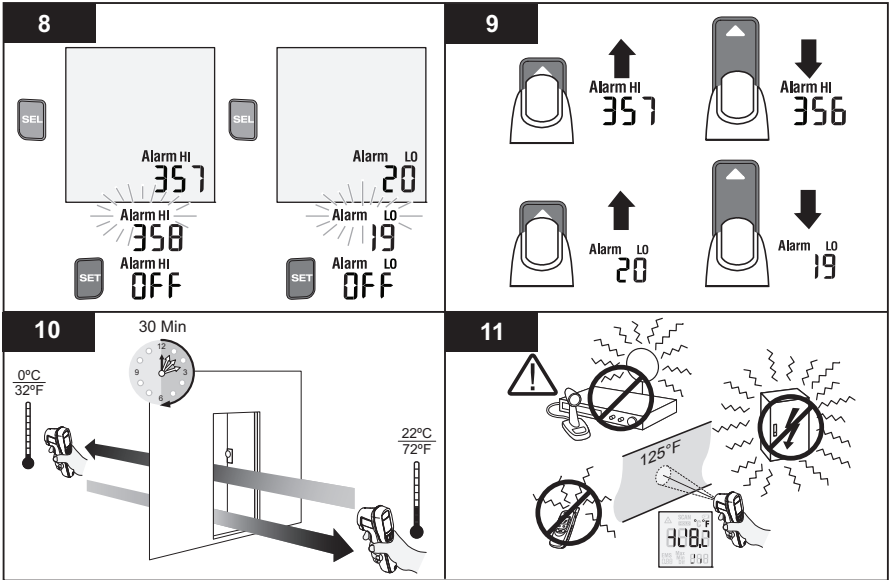

62 MAX/62 MAX +
Users Manual

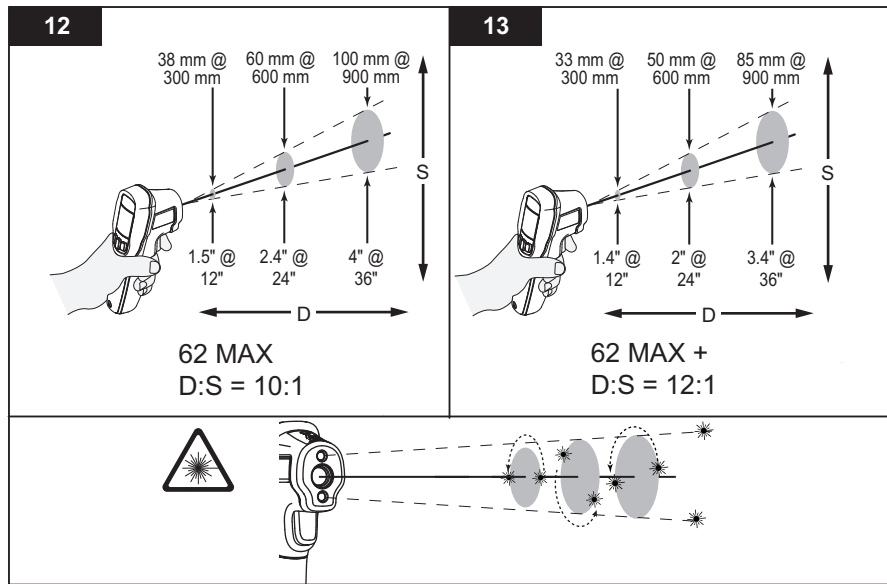

gtt08-11.eps

Infrared Thermometer
The Product

14

SCAN

SCAN °F 1888.8
EMS Max Alarm HI LO
0.88 Min Avg Diff 1888

SCAN °F 90.0
EMS Max 90

SCAN °F 70.0
EMS Max 70

SCAN °F 80.0
EMS 0.95 Min 70

SCAN °F 68.0
EMS 0.95 Max 90

SCAN °F 68.0
EMS 0.95 Min 68

SCAN °F 68.0
EMS 0.95 Avg 76

SCAN °F 68.0
EMS 0.95 Diff 22

SEL


SEL

SEL


SEL

SEL

gtt03.eps

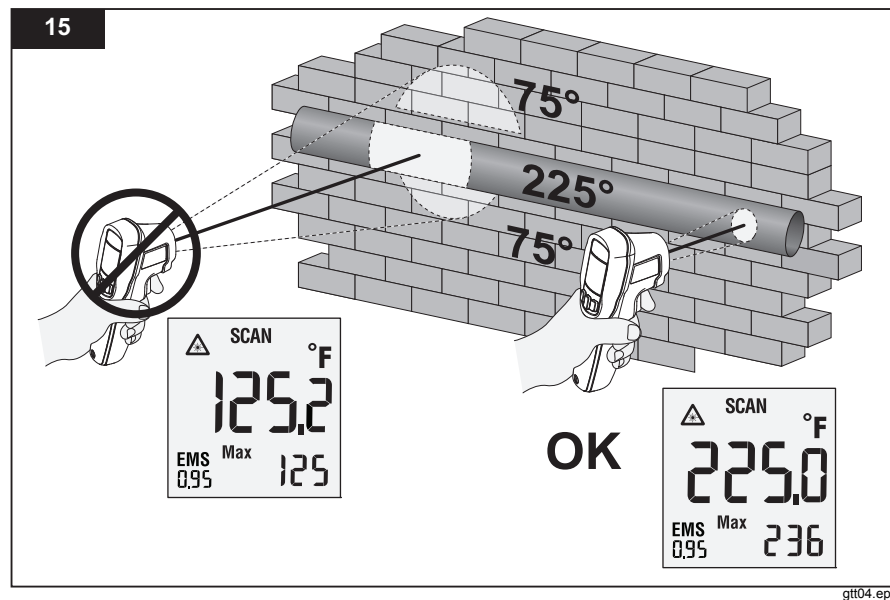

Infrared Thermometer
The Product

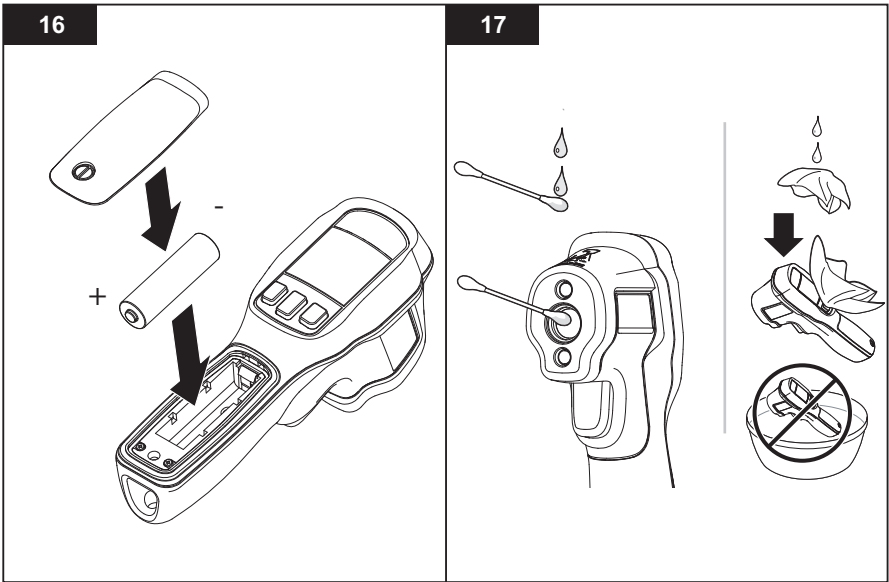

gtt13.eps